

United States Department of the Interior
National Park Service**National Register of Historic Places Registration Form**

This form is for use in nominating or requesting determinations for individual properties and districts. See instructions in National Register Bulletin, *How to Complete the National Register of Historic Places Registration Form*. If any item does not apply to the property being documented, enter "N/A" for "not applicable." For functions, architectural classification, materials, and areas of significance, enter only categories and subcategories from the instructions.

1. Name of PropertyHistoric name: Biltmore HillsOther names/site number: N/AName of related multiple property listing: N/A**2. Location**Street & number: Bunche, Dandridge, Fitzgerald & Waters Drives; Campanella, Gilliam & Owens Lanes; Hadley & Newcombe Roads; Kitt PlaceCity or town: Raleigh State: NC County: WakeNot For Publication: N/A Vicinity: N/A**3. State/Federal Agency Certification**

As the designated authority under the National Historic Preservation Act, as amended,

I hereby certify that this x nomination request for determination of eligibility meets the documentation standards for registering properties in the National Register of Historic Places and meets the procedural and professional requirements set forth in 36 CFR Part 60.In my opinion, the property x meets does not meet the National Register Criteria. I recommend that this property be considered significant at the following level(s) of significance: national statewide x local

Applicable National Register Criteria:

x A B x C D_____
Signature of certifying official/Title:_____
Date_____
State or Federal agency/bureau or Tribal GovernmentIn my opinion, the property meets does not meet the National Register criteria._____
Signature of commenting official:_____
Date_____
Title :_____
State or Federal agency/bureau
or Tribal Government

Biltmore Hills
Name of Property

Wake, NC
County and State

4. National Park Service Certification

I hereby certify that this property is:

- ☐ entered in the National Register
☐ determined eligible for the National Register
☐ determined not eligible for the National Register
☐ removed from the National Register
☐ other (explain:) _____

Signature of the Keeper

Date of Action

5. Classification

Ownership of Property

- Private: ☒
- Public – Local ☐
- Public – State ☐
- Public – Federal ☐

Category of Property

- Building(s) ☐
- District ☒
- Site ☐
- Structure ☐
- Object ☐

Number of Resources within Property

Contributing	Noncontributing	
<u>293</u>	<u>197</u>	buildings
<u>0</u>	<u>0</u>	sites
<u>0</u>	<u>9</u>	structures
<u>1</u>	<u>4</u>	objects
<u>294</u>	<u>210</u>	Total

Biltmore Hills
Name of Property

Wake, NC
County and State

Number of contributing resources previously listed in the National Register 0

6. Function or Use
Historic Functions

DOMESTIC: single dwelling

Current Functions

DOMESTIC: single dwelling

Biltmore Hills
Name of Property

Wake, NC
County and State

7. Description

Architectural Classification

MODERN MOVEMENT Ranch

MODERN MOVEMENT Split-Level

MODERN MOVEMENT Raised Ranch

Materials:

Foundations: BRICK

Walls: BRICK, SYNTHETICS-vinyl, WOOD, STONE

Roofs: ASPHALT

Narrative Description

Summary Paragraph

Located roughly two miles south southeast of downtown Raleigh and immediately south of and adjacent to that section of interstate I-40 known colloquially as “The Beltline,” Biltmore Hills is a roughly 105-acre, single-family residential subdivision organized around ten roads. It has three cul-de-sacs along its southeastern section, otherwise the roads terminate at “T” junctions or extend outside the neighborhood. The community is composed exclusively of single-family homes set on generous lots. The majority of the 348 houses are single-story ranch-style homes although there are some raised ranches, split-levels and a handful of two-story homes. While some homes have been altered, no homes have been torn down, and the community continues to communicate the appearance of a modest mid-century neighborhood built to federally promulgated design standards.

Narrative Description

Biltmore Hills is a neighborhood of approximately 105 acres. The boundaries incorporate land with a slightly rolling topography. A small, unnamed stream defines the neighborhood’s western boundary. When the neighborhood was originally built, a single road north connected it to neighboring Rochester Heights, although residents remember walking through the wooded area between them as well. Neighborhood plats show the intervening land reserved as potential right-of-way. In the mid-1970s the last leg of a ring road highway, the aforementioned Beltline, was completed between these two traditionally African American communities. It now forms much of Biltmore Hills’ northern boundary.

Biltmore Hills

Name of Property

Wake, NC

County and State

The plats for the neighborhood were drawn by an engineer named John Lloyd Castleberry, Jr. (1924-2011). A 1948 graduate of what is now North Carolina State University, he was an engineer and surveyor. While he did a great deal of work for real estate developer Ed Richards, it appears he also had a private practice. Among other projects, he worked for years surveying and mapping the numerous parcels that were assembled to become the Research Triangle Park. His plan for the Biltmore Hills neighborhood included long blocks (some ranging between one-fourth to one-third of a mile long), curving roads, cul-de-sacs, and lots that range from about one-fifth to two-thirds of an acre. Most lots are rectangular in shape, though many lots at street corners and along short side streets are polygonal.

The lots were and are bound by covenants. Parcels are reserved for single-family residential use, and each parcel can house no more than one detached dwelling of no more than 2.5 stories and a garage for a maximum of two cars. The covenants state that in order to assure a level of quality, houses must cost at least \$6,000. The ground floor area must be at least 750 square feet (not including porches or garage). Lots must have a 25-foot setback from the front lot line, though corner lots are allowed to have a 20-foot setback on one side, providing the other side has a 25-foot setback. Setbacks from interior lot lines must be at least seven feet. Accessory dwelling units are not permitted. Property owners are not allowed to host any nuisance or offensive activities.¹

The community falls between the definitions of custom and tract subdivisions outlined in Ruth Little's study "The Development of Modernism in Raleigh 1945-1965." Houses were speculatively built, but the use of multiple prototype designs gives the neighborhood a visual variety usually found in custom subdivisions.² Ranch houses predominate, representing 284 of the 348 houses. An additional nineteen are split-levels. Only eighteen are two stories tall. All are of frame construction, with 335 having brick veneer on some or part of the exterior. Of the 348 homes, 268 (77%) have been identified as one of a specific type that repeats more than once within the community. Fifteen different types have been identified and are outlined below with a list of their defining characteristics and the properties that have been built to that type. It is conceivable that some houses that have been altered greatly may have been built as a specific type but no longer can be identified as such.

Type 1 is a one-story, side-gabled frame house. The facade is four bays across. The central bays contain a single-leaf door and a bank of three small sash windows. The exterior bays contain paired larger sash windows in the bay adjacent to the door, and a single sash window in the remaining bay. Exterior cladding varies but is either brick veneer, wooden siding, or a combination thereof.

Examples:

Bunch—712, 745, 810, 833, 1207, 725

Campanella—800, 821, 836, 852

¹ "Declaration," *Wake County Deed Book 1416*, 189.

² M. Ruth Little, "The Development of Modernism in Raleigh 1945-1965," North Carolina State Historic Preservation Office, 2006.

Biltmore Hills

Name of Property

Wake, NC

County and State

Dandridge—2127, 2501
Fitzgerald—701, 714, 752
Hadley—604, 823, 856, 919, 1008, 1101, 1111
Newcombe—722, 808, 829, 848, 857, 860, 913
Owens—2106

Type 2 is a slight variation on Type 1, where the exterior bay adjacent to the entrance has a single window and the other exterior bay houses paired windows.

Examples:

Bunche—732, 749, 812, 905, 1203, 1216, 705
Campanella—813, 853
Dandridge—2405, 2305, 2119
Fitzgerald—721, 728, 745
Hadley—608, 700, 819, 832, 852, 907, 916, 1107
Newcombe—800, 849, 914
Owens—2109

Type 3 is a one-story, side-gabled frame house. The facade is four bays across. On one side of the single-leaf entrance are large, paired windows. On the other side of the entrance the facade is clad in brick veneer up to the sill level of either two sets of paired windows, or 3 windows, set close to the eaves. Examples:

Bunche—701, 706, 721, 728, 737, 740, 757, 765, 809, 817, 818, 1208, 1211
Campanella—801, 804, 816, 824, 828, 841, 848, 856, 860
Dandridge—2314, 2115, 2107
Fitzgerald—705, 713, 720, 732, 741, 2509, 2513
Gilliam—2000, 2120, 2131, 2200, 2207, 2208
Hadley—708, 813, 836, 840, 844, 911, 1011, 1100
Kitt—1104, 1108, 1116
Newcombe—701, 718, 824, 825, 828, 833, 841, 853, 900, 910, 812, 840
Waters—1921, 2009

Type 4 is a frame, one-story, front-gabled house. A single-leaf primary entrance is centered under the gable and to one side of the entrance are paired windows. In many cases, the side of the facade without windows is clad with brick veneer and has a wing wall that extends beyond the gable front. Examples:

Bunche—709, 724, 729, 748, 760, 801
Campanella—808, 817, 857
Fitzgerald—717, 744, 800, 2508
Hadley—620, 820, 607, 707, 827,
Newcombe—820, 837
Owens—2105

Type 5 is a one-story, side-gabled house. The facade is four bays across. The exterior bays have single sash windows. The interior bays contain a single-leaf door and one set

Biltmore Hills

Name of Property

Wake, NC

County and State

of paired sash windows. Frequently the house is clad in brick veneer and there are framed panels below the windows. Examples:

Bunche—718, 744, 756, 813, 1212, 829

Campanella—832, 845, 865, 812

Dandridge—2123

Fitzgerald—724, 737, 748, 2306

Hadley—601, 616, 801, 904, 1004, 1104

Newcombe—832, 852, 907

Owens—2101

Type 6 is a one-story, side-gabled house. The facade is four bays across. The principal entrance is a single-leaf door. To one side of the entrance is a single sash window, to the other side of the entrance are two sets of paired sash windows. Examples:

Bunche—713, 741, 752, 821, 1215

Campanella—805, 844

Dandridge—2135, 2500

Fitzgerald—709, 729, 740, 749, 804, 2404

Gilliam—2124, 2204

Hadley—600, 704, 807, 828, 848, 923, 1012

Newcombe—816, 821, 844, 856, 901

Type 7 is a one-story, side-gabled house. The facade is four bays across. The principal entrance is a single-leaf door. Flanking the entrance are paired sash windows and the remaining exterior bay houses a single sash window. In some cases, the entrance and flanking bays are clad in weatherboard and the fourth bay in brick veneer with a framed panel below the window. This includes cases where the flanking windows are not the same size. Examples:

Bunche—717, 753, 764, 805, 822, 1204, 736

Campanella—809, 820, 849, 861

Dandridge—2111, 2131, 2309

Fitzgerald—725, 736, 2408, 2519, 706

Gilliam—2205

Hadley—701, 712, 816, 1007, 1103, 920

Newcombe—804, 817, 836, 845

Type 8 is a one-story, side-gabled house. The facade is four bays across. The principal entrance is a single-leaf door. To one side of the entrance is a brick veneered bay with large, paired windows; on the opposite side, brick veneer up to the sill level of smaller windows with framing above. In some cases, there are paired sash windows closer to the entrance and a single sash window beyond; in others, two or three sliding windows in two groupings. Examples:

Campanella—833

Dandridge—2114

Hadley—824

Biltmore Hills

Name of Property

Wake, NC

County and State

Type 9 is a one-story, front-gabled house with a projecting front-gabled porch supported by three posts—one at each end and one centered under the porch gable. Within the porch is a central window and an offset single-leaf door. Beyond the entrance door is a large window that is outside of the porch. Examples:

Bunche—825

Dandridge—2126

Hadley—839, 859, 863, 903

Kitt—1119

Type 10 is a split-level house. It has a side-gabled core with a projecting front-gabled wing. The front-gabled wing has two bays with windows and in some cases, when built on a slope, has an exposed basement. At the juncture of the two wings on the facade is a single leaf entrance in the side-gabled portion and beyond it, opposite the projecting wing, is a large cased opening for a single window assembly, in some cases a Chicago window. Examples:

Bunche—1008

Gilliam—2004, 2116

Kitt—1101, 1103, 1112

Waters—1925, 2003, 2016

Type 11 is a one-story, side-gabled house with a cross-gabled front porch. Centered beneath the porch gable is a single-leaf entrance flanked on either side by a window. Within the porch, the cladding of the facade alternates between framed and brick-veneered sections. The brick sections flank the framed openings for the door and windows. Examples:

Dandridge—2118, 2201

Fitzgerald—756, 808

Hadley—847

Type 12 is a telescoping, side-gabled, split-level ranch. The taller section has two sets of windows, often paired, set high on the wall plane towards the gable. The single-leaf entrance is in the lower section at its juncture with the adjacent section, and beyond it is a single window assembly, often a Chicago-style window. Examples:

Bunche—1104, 1100

Gilliam—2105, 2108, 2112, 2115

Waters—2006, 2013

Type 13 is a symmetrical two-story, side-gabled house. The first-floor facade is clad in brick veneer and its second floor is frame. The facade has three bays. On the first floor is a central, single-leaf entrance flanked by sash windows. There are three sash windows in the second-floor facade aligned above the masonry openings below. Examples:

Bunche—904

Gilliam—2100, 2104

Biltmore Hills

Name of Property

Wake, NC

County and State

Type 14 is a two-story, side-gabled house with a brick first story and a frame, or frame and brick second story. The primary entrance is via a single-leaf door within an offset, first-floor inset porch supported by two posts, that stretches for one half the width of the facade. Examples:

Bunche—1003, 1103

Waters—2017, 2021, 2025

Type 15 is a one-story, side-gabled house that has a single-leaf recessed entrance with canted wing walls. On one side of the entrance is a Chicago-style window and on the other side are two sash windows. Examples:

Kitt—1111, 1115

Waters—2001

Inventory

Bunche Drive

House, 701 Bunche Drive 1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, two-panel, six-light door. West of the entrance are two sets of paired six-over-six sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The entrance and windows immediately to its east are sheltered by a cross-gabled porch with cast metal supports. The east end wall of the house has two one-over-one windows. The masonry end wall of the carport has three single-light windows, two smaller and narrower than the third. The west elevation has two one-over-one windows and there is siding in the gable.

House, 705 Bunche Drive 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a gabled portico, accessed by masonry steps. Immediately west of the entrance is a bank of one-over-one windows set high at the eave, sharing a common rowlock sill. Further west are paired one-over-one windows. East of the entrance is a single one-over-one window. The west elevation has two windows and grooved wooden paneling in the gable. The east elevation has paired one-over-one windows, a single leaf door, and grooved wooden paneling in the gable.

Shed c. 2000 Barely visible northeast of the house is a shed with a single-leaf door. **Noncontributing Building**

House, 706 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an oval inset light. West of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest to the entrance are paired. East of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. A masonry deck with a planter spans the east bay and entrance. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has paired sash windows and a door; the west has two sash windows.

House, 709 Bunche Drive 1959

Noncontributing Building

The one-story, front-gabled house is clad in brick veneer, vinyl siding and synthetic shingles. The facade is clad in vinyl siding with shingles in the gables. A single-leaf entrance is centered roughly under the gable. To its west are paired one-over-one windows. To its east there is no fenestration. The east elevation is clad in brick veneer and has

Biltmore Hills

Wake, NC

Name of Property

County and State

three windows and a double-leaf door. The west elevation, also clad in brick veneer, has a single-leaf door and four one-over-one windows, the center two of which are paired.

House, 712 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps sheltered by a fixed metal awning with cast metal supports. Immediately west of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single six-over-six window. East of the entrance is a vinyl siding clad bay with paired six-over-six windows. The west elevation is brick-veneered and has two six-over-six windows and vinyl siding in the gable. The east elevation has one window and a door.

Shed ca. 1980 Northwest of the house is a side-gabled metal shed. **Noncontributing Building**

House, 713 Bunche Drive 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance accessed by a wooden ramp. West of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. East of the entrance is a single six-over-six wooden sash window with a rowlock sill. The west gable end has two six-over-six wooden sash windows and wooden paneling in the gable; the east has a paired six-over-six wooden sash windows, a single-leaf door and wooden paneling in the gable.

House, 717 Bunche Drive 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and what appears to be hardboard weatherboard. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the paired six-over-six sash windows on either side of it are in the weatherboarded section of the facade. To the west is a brick veneered bay with a single six-over-six sash window. A shed-roofed porch with foliate cast metal supports shelters the entrance and eastern windows, the other windows on the facade have fixed metal awnings. The west elevation is clad in brick veneer with weatherboard in the gable and at least one window with a fixed metal awning. The east elevation appears to have a rear addition with an exterior end brick chimney.

House, 718 Bunche Drive 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance are three one-over-one wooden sash windows, two paired, all with wooden panels below and a rowlock sill. West of the entrance is a single such window. The east and west elevations are brick veneer with vinyl siding in the gable. The west elevation has two windows; the east a single window and a door.

House, 721 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and wooden siding. It has broad eaves. The facade has a single-leaf entrance door sheltered by a fixed metal awning. East of the entrance are three windows, two of which are paired and all three of which have fixed metal awnings, set between the eaves and a rowlock sill within wooden paneling set above brick veneer. West of the entrance are large paired one-over-one windows also with a fixed metal awning. The gable ends are clad in brick. The east gable end has two windows with fixed metal awnings; the west has paired windows with a fixed metal awning and a single-leaf door.

Shed ca. 1990 Northwest of the house is a prefabricated metal shed. **Noncontributing Building**

House, 724 Bunche Drive 1959

Noncontributing Building

Originally constructed as one of the model front-gabled houses, this home was renovated between 2013 and 2022. It continues to be a one-story front-gabled house. The facade is largely clad in what appears to be hardiplank. It has a slightly projecting, smaller front gable at the west centered above paired one-over-one windows. Both front gables are pedimented and clad in synthetic shingles. The six-light, two-panel entrance door is sheltered by a gabled hood supported by brackets. The east and west elevations are brick veneer. The east elevation has three one-over-one windows and a single leaf door. The west elevation has four one-over-one windows, the center two of which are paired, and a single-leaf door.

Shed ca. 1990 Southwest of the house is a frame, shed-roofed shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 725 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and aluminum siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps sheltered by a portico comprising a fixed metal awning and cast metal supports. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill and a fixed metal awning. Further east is a bay clad in aluminum siding with a single six-over-six window with a fixed metal awning. West of the entrance is an aluminum siding clad bay with paired six-over-six windows sharing a fixed metal awning. The east and west elevations are brick-veneered with aluminum siding the gables.

Shed ca. 1980 Northwest of the house is a frame, gable-roofed shed **Noncontributing Building**

House, 728 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired, sliding glass windows, set between the eaves and a rowlock sill within a panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end was not visible; the east appears to have a window and a door.

Shed ca. 1990 Southwest of the house is a prefabricated, metal gable-roofed shed. **Noncontributing Building**

House, 729 Bunche Drive 1960

Contributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance door with an integrated fan light is centered roughly under the gable. To its east are paired one-over-one windows. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The east elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade. The west elevation, also clad in brick veneer, has four windows and a door in the original section and appears to have windows and a door in the rear addition. Aerial photos suggest the addition was built between 1981 and 1999.

Shed ca. 1985 Northwest of the house is a frame, front-gambrelled shed with windows flanking the door. **Noncontributing Building**

House, 732 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with an applied stone surround. Immediately east of the entrance is a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further east are paired one-over-one windows. West of the entrance is a single one-over-one window. The gable ends are brick veneer with vinyl siding in the gable. The west elevation has paired windows and a door. The east elevation has two windows.

House, 733 Bunche Drive 1960

Contributing Building

Since before 1988, this one-story, side gabled, brick-veneered house has had a cross-gabled rear addition from which extends a one-and-a-half story ell at the east. The facade has a single-leaf entrance sheltered by a fixed metal awning on metal posts. West of the entrance is a Chicago-style window with a fixed metal awning. East of the entrance are two masonry openings. The one adjacent to the entrance has paired windows. The eastern one a single window. In both cases, the windows rest on wooden paneling above a rowlock sill and have fixed metal awnings. The west gable end has a door and a window. The east elevation has two windows in the gable end and a single window in the rear addition. The ell, which is a story-and-a-half, rises above the addition. It has a gabled dormer on its east elevation.

Shed ca. 1990 Northwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 736 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and grooved paneled siding. It has broad eaves. The facade has a single-leaf entrance door accessed by masonry steps and a stoop. The entrance and the paired six-over-six sash windows on either side of it are in the wood paneled section of the facade. To the east is a brick-veneered bay with a single six-over-six sash window with a wood panel below. The east and west elevations

Biltmore Hills

Wake, NC

Name of Property

County and State

are clad in brick veneer with wood paneling in the gables. The west elevation has a single six-over-six sash window and a single-leaf door. The east elevation has two windows.

Shed ca. 2015 Southwest of the house is a frame, gable-roofed shed **Noncontributing Building**

House, 737 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The entrance and west windows are sheltered by a cross-gabled porch with wooden posts and a Chippendale railing, built between 1988 and 1999. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has a one-over-one sash window and a door. There is a cross-gabled rear addition dating to before 1981.

House, 740 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest to the entrance are paired. East of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has paired sash windows and a three-light, three-panel door; the east has two sash windows.

Shed ca. 1985 Southeast of the house is a gable-roofed shed clad in corrugated metal. **Noncontributing Building**

House, 741 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in painted running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. West of the entrance are two sets of paired one-over-one sash windows each set with a shared rowlock sill. East of the entrance is a single one-over-one sash window with a rowlock sill. The west gable end has two one-over-one sash windows; the east has paired one-over-one sash windows. A nearly full-width, cross-gabled rear addition has been in place since at least 1981.

House, 744 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance are three six-over-six wooden sash windows, two paired, all with vinyl panels below and a rowlock sill. West of the entrance is a single such window. The entrance and west window are sheltered by cross-gabled porch supported by wooden posts, built ca. 2003. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two windows; the west a single window and a door.

Shed ca. 1980 Southwest of the house is a frame, front-gabled shed. **Noncontributing Building**

House, 745 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad partially in wooden siding with a single six-over-six window. West of the entrance is a bay with paired six-over-six windows also partially clad in wooden siding. The east and west gable ends are brick veneer with wooden paneling in the gables. The east elevation has two six-over-six windows. The west elevation has one six-over-six window and a door.

Shed ca. 1985 Northwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 748 Bunche Drive 1960

Contributing Building

This one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance is centered roughly under the gable. To its west are paired one-over-one windows. To its east are no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the east elevation. The west elevation was not

Biltmore Hills

Wake, NC

Name of Property

County and State

visible. The east elevation, clad in brick veneer, appears to have four windows and a door. Evident on this elevation is a cross-gabled wing that extends to the east near the south side of the house. The wing was built prior to 1981.

Shed ca. 1990 Southwest of the house is a gambrel-roofed frame shed. **Noncontributing Building**

House, 749 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately west of the entrance is a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further west are paired one-over-one windows. East of the entrance is a single one-over-one window. The east elevation has paired windows, a door, and vinyl siding in the gable. The west elevation has two windows and vinyl siding in the gable. A cross-gabled rear addition that aerial photos show to be nearly full-width was built prior to 1981.

Shed ca. 1985 Northwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 752 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an oval inset light. West of the entrance are two sets of paired replacement vinyl sash windows with simulated divided lights, each set with a shared rowlock sill. East of the entrance is a single six-over-six wooden sash window with a rowlock sill. The entrance and east windows are sheltered by a cross-gabled porch with exposed truss-work. The west gable end has two windows and vinyl siding in the gable. A telescoping, side-gabled carport on wooden posts has been added to the east elevation. The east end wall has paired windows and a door. The porch and carport were built between 1988 and 1999.

Garage ca. 2020 South of the house is a metal, gable-roofed, two-car garage **Noncontributing Building**

House, 753 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and stucco. Tax record photos suggest the stucco was applied between 2013 and 2019. The house has broad eaves. The facade has a single-leaf entrance door. The entrance and the paired one-over-one sash windows on either side of it are in the stuccoed section of the facade. To the west is a brick veneered bay with a single one-over-one sash window in a large masonry opening partially infilled with stucco. The entrance and east windows are sheltered by a cross-gabled porch with wooden posts and railing. The west elevation is clad in brick veneer. It has two windows and vinyl siding in the gable. The east elevation, also clad in brick veneer with vinyl siding in the gable, has a single window. Brick scarring suggests an infilled door. The porch and an open, cross-gabled rear ell were built between 1988 and 1999.

Shed ca. 1990 North of the house is a gable-roofed shed. **Noncontributing Building**

House, 756 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance in a gabled portico with wooden posts. East of the entrance are three one-over-one sash windows, two paired, all with vinyl panels below and a rowlock sill. West of the entrance is a single such window. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two windows; the west a single window and a door.

House, 757 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. Between 1981 and 1988 a sizable, cross-gabled rear wing and cross-gabled front porch were added. The facade has a single-leaf entrance door. East of the entrance are two sets of paired sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. These windows and the entrance are sheltered by the front porch which is supported by square posts. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two windows; the west has a single sliding glass window and a single-leaf door.

House, 760 Bunche Drive 1960

Contributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance is centered roughly under the gable. To its east are paired one-over-one windows. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately

Biltmore Hills

Wake, NC

Name of Property

County and State

two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The east elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade.

Shed ca. 2000 Southwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 761 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and beaded hardboard siding. It has broad eaves. The facade has a single-leaf entrance door. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in beaded siding with paired six-over-six windows. West of the entrance is a siding clad bay with paired six-over-six windows. The entrance and west windows are sheltered by a porch comprising a fixed metal awning, cast metal supports and a masonry deck. The east elevation is brick-veneered and has two six-over-six windows. The west elevation has one window and appears to have had a door. This elevation has grooved wooden siding in the gable.

House, 764 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the paired one-over-one sash windows on either side of it are in the vinyl sided section of the facade. To the north is a brick veneered bay with a single sash window with a vinyl panel below it. The entrance and south windows are sheltered by a porch comprising a fixed metal awning with wooden posts and railings on a masonry deck accessed by a ramp. The south elevation is clad in brick veneer. It has a single sash window, a single-leaf door, and vinyl siding in the gable. The north elevation has two one-over-one windows and vinyl siding in the gable.

Shed ca. 1955 West of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 765 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. West of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The entrance and west windows are sheltered by a cross-gabled porch with wooden posts and railings, constructed between 1988 and 1999. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has paired sliding glass windows and a door; the east has two windows.

House, 801 Bunche Drive 1960

Contributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance is centered roughly under the gable. To its west are paired one-over-one windows. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The entrance and windows are sheltered by a porch comprising a fixed metal awning and cast metal supports. The east elevation is clad in brick veneer and has four windows and a door that has a fixed metal awning. The west elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade.

House, 805 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and board-and-batten style aluminum siding. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the paired one-over-one sash windows on either side of it are in the aluminum-sided section of the facade. The entrance and west windows are sheltered by a cross-gabled porch with Doric columns and a ramp built between 1988 and 1999. To the east is a brick veneered bay with a single one-over-one sash window. The east elevation is clad in brick veneer. It has two one-over-one windows and grooved wooden paneling in the gable. The west elevation is clad in brick veneer. It has a single six-over-six sash window, a single-leaf door, and grooved wooden paneling in the gable. On this elevation is a partial view of a rear addition built by 1981 and expanded in the 1990s.

Biltmore Hills

Name of Property

House, 809 Bunche Drive 1960

Wake, NC

County and State

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. East of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The entrance and west windows are sheltered by a cross-gabled porch with cast metal supports, a masonry deck and an integrated planter. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has a single one-over-one, vinyl sash window and appears to have had a single-leaf door. The east gable end has two one-over-one, vinyl sash windows. On this elevation a rear addition is evident.

House, 810 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, four-panel, four-light door with a stoop, accessed by masonry steps. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a single six-over-six window. West of the entrance is a vinyl siding clad bay with paired six-over-six windows. The east elevation is brick-veneered and has two windows and siding in the gable. The west elevation, also clad in brick veneer with vinyl siding in the gable, has one window and a door.

Shed ca. 1985 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 812 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east are paired six-over-six windows. West of the entrance is a single six-over-six window. The west elevation has an open carport with a side-gabled roof supported by brick piers. The west end wall has paired six-over-six windows and a door. The east elevation has two windows and wooden paneling in the gable.

House, 813 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an oval glass inset. East of the entrance are three one-over-one sash windows, two paired, all with wooden panels below and a rowlock sill. A single such window is west of the entrance. The east and west elevations are brick veneer with siding in the gable. The east elevation has two windows; the west a single window and a door. Evident on the west elevation is a frame addition that appears to be clad in vinyl siding and which has in its west elevation a door.

Shed ca. 1990 Northwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 817 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are paired one-over-one sash windows and a sliding glass window, set between the eaves and a rowlock sill within a wooden panel set above brick veneer. The windows closest the entrance are paired. West of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has paired sash windows and a door; the east has two sliding glass windows. Evident on the east elevation is a frame rear addition.

Shed ca. 1990 Northwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 818 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has a single window and a single-leaf door. The east gable end has two windows. At its south a rear, brick-veneered addition is visible.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 821 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. East of the entrance are two sets of paired one-over-one sash windows each set with a shared rowlock sill. West of the entrance is a single one-over-one sash window with a rowlock sill. The east gable end was not visible. The west has paired one-over-one sash windows and a door. Between 1981 and 1988 a cross-gabled rear ell was added, the peak of which gable is visible above the ridgeline on the facade.

House, 822 Bunche Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. Between 1981 and 1988 a side-gabled east wing was added. Between 1988 and 1999 the east wing was expanded, and a cross-gabled front porch were added. Between 1999 and 2002 a rear ell was added and between 2012 and 2013 a carport was added to the west. The facade has a single-leaf entrance door. To its west is a large, fixed picture window. That window and the entrance are sheltered by the porch which has Doric columns and turned posts with wooden railings. East of the entrance are paired one-over-one windows. These three western bays are all clad in wooden paneling. To the east is a single brick veneered bay with a one-over-one window with a wooden panel below it. The east wing and its addition are both frame with wooden paneling. The facade wing has two windows on the facade, and the shed-roofed extension one. On the east elevation, two windows are visible on the extension of the east wing. The carport with brick piers obscures the west end wall, but it appears that it has a door and a window.

House, 824 Bunche Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and applied stone. It has broad eaves. If not original, the carport and rear ell date to before 1981. Like at least one other house in the neighborhood, it has a pattern of deeply struck mortar joints at approximately every fourth course creating a shadow line and providing visual texture to the exterior walls. The facade has a single-leaf, three-panel door. To its north in a stone-faced bay are two large one-over-one windows. The roof extends slightly over these two northern bays. South of the entrance, the facade is clad in brick and contains two one-over-one windows with rowlock sills. The south elevation has two one-over-one windows in the gable end and a two-over-two, horizontal-pane sash window in the rear ell. An exterior brick chimney is visible on the west elevation. The north elevation has a gabled carport with cast metal supports. The end wall within has a door and a window. To the west, a frame extension of the rear ell is visible.

House, 825 Bunche Drive 1962

Contributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. It is unclear if this house is similar to the majority of the front-gabled houses and has been altered, or if it constitutes a new model. The single-leaf entrance is roughly centered under the gable. To its west brick veneer is roughly eighteen inches high with grooved paneling above with a large one-over-one window to the far west. East of the entrance, the veneer is roughly three feet tall and a small one-over-one window is on the framed section above. The gable is uneven with a longer slope to the east. A gable-roofed porch on metal posts shelters the entrance and eastern window, which is centered under the porch gable. The east elevation was not visible. The west elevation was largely obscured however its brick veneer could be seen as well as four masonry openings; the southernmost appear to be paired windows.

House, 829 Bunche Drive 1961

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door at a masonry deck. East of the entrance are one-over-one sash windows, two paired, all with grooved wooden panels below and a rowlock sill. West of the entrance is a single such window. Each masonry opening on the facade is sheltered by a fixed metal awning. The east and west elevations are brick veneer with grooved wooden panels in the gable. The east elevation has two windows; the west, a single window and a door.

House, 833 Bunche Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integrated fan light, accessed by masonry steps to a stoop. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave,

Biltmore Hills

Wake, NC

Name of Property

County and State

sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a single one-over-one window. West of the entrance is a vinyl siding clad bay with paired six-over-six windows. The east elevation is brick-veneered and has two windows and vinyl siding in the gable. The west elevation is brick-veneered and has one window, a door and vinyl siding in the gable.

Shed ca. 1980 Northwest of the house, glimpsed beyond a high privacy fence is a gable-roofed metal shed

Noncontributing Building

Shed ca. 2000 Northwest of the house, barely seen over a privacy fence is a gambrel-roofed, frame shed

Noncontributing Building

House, 837 Bunche Drive 1964

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. To its east the exterior wall is clad in brick veneer to about two-thirds of its height and is topped with a rowlock sill and a vinyl sided strip. Within the strip are two two-over-two horizontal-pane windows. West of the entrance the facade is clad in brick veneer and has a metal Chicago style window. An open, side-gabled carport at the west has existed since 1981. It is supported by posts and has a framed, enclosed closet at the north.

House, 903 Bunche Drive 1964

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf, six-light, two-panel entrance door. The facade is clad in common bond brick veneer up to the sill level of the windows with a single rowlock course. East of the entrance is a metal, Chicago-style window. West of the entrance are two large one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with wooden siding in the gables and each has two one-over-one, vinyl sash windows.

Mailbox ca. 1965 South of the house is a brick masonry pier enclosing a mailbox. **Noncontributing Object**

House, 904 Bunche Drive 1963

Contributing Building

This two-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The first floor is clad in brick veneer and has a central single leaf entrance door with an integrated fan light. Flanking the entrance door are one-over-one sash windows. The second floor is clad in vinyl siding, and its facade is cantilevered slightly forward of the wall plane of the first floor. The facade has three one-over-one windows aligned above the windows and door below. The east and west elevations appear to have no windows or doors. An open metal carport has been added to the east elevation.

Shed ca. 1985 Southwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 905 Bunche Drive 1965

Contributing Building

This one-story, side-gabled frame house is clad in vinyl siding. Exposed rowlock windowsills suggest there may be brick veneer beneath the later siding. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance is a large one-over-one window. West of the entrance are two two-over-two horizontal pane sash windows. The gable ends are clad in brick veneer. The west gable end has wooden siding in the gable and two two-over-two horizontal pane sash windows. The east gable end is obscured by a side-gabled carport that has existed since at least 1981 and may be original. One window can be seen in the end wall.

House, 1000 Bunche Drive 1964

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance is a metal, Chicago-style window. One of the window flankers is a metal two-over-two, the other appears to be a one-over-one vinyl replacement. West of the entrance are two large one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with vinyl siding in the gables. Each has two windows; the east has two-over-two horizontal pane windows, the west one-over-one vinyl replacement sash.

House, 1003 Bunche Drive 1964

Contributing Building

Built into a slope, this side-gabled house has two exposed stories on the south and one on the north. The lower level is brick veneered and the upper is clad in vinyl siding. On the west side of the lower level of the facade is an inset

Biltmore Hills

Wake, NC

Name of Property

County and State

porch supported by square posts. It shelters a single-leaf door and a one-over-one window at its west. East of the inset porch is a framed, slightly projecting bay with a shed roof housing three one-over-one windows. There are three one-over-one windows on the upper level of the facade. The west elevation has a door at grade in the lower level and two windows above it in the upper level. A brick retaining wall extends west from this elevation. The east elevation has two windows in the upper level and may have one in the lower level. A retaining wall extends south from this elevation.

Shed ca. 2022 Slightly visible northwest of the house is a frame, one story outbuilding with exposed rafter tails. **Noncontributing Building**

House, 1004 Bunche Drive

1964

Contributing Building

This one-story, side-gabled frame house is clad in common bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. North of the entrance is a large one-over-one window. South of the entrance are two two-over-two horizontal pane sash windows. The south and north gable ends have wooden siding in the gable and two two-over-two horizontal pane sash windows.

House, 1008 Bunche Drive

1964

Contributing Building

This cross-gabled, frame, split-level house is clad in common bond brick veneer and vinyl siding. It has broad eaves. The northern half of the house is side-gabled and the southern front-gabled. The lower half of the facade is clad in brick veneer with a top rowlock course. Above the brick is vinyl siding. In the northern half is a single-leaf entrance door sheltered by a fixed metal awning. To its north is a metal Chicago-style window. In the southern half of the facade are two one-over-one windows. The north and south elevations are clad in vinyl siding. The north has a door and the south two one-over-one windows.

Shed ca. 1985 Northwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 1100 Bunche Drive

1960

Contributing Building

This one-story, side-gabled, split-level frame house is clad in running bond brick veneer and aluminum siding. It has broad eaves. The southern half of the house is taller than the northern half. Both halves of the facade are clad in brick veneer on lower half and aluminum siding on the upper. The northern half of the facade has at the juncture with the southern half, a single-leaf entrance door. North of the entrance is a Chicago-style window. The southern half of the facade has two sets of paired sliding glass windows on the upper level. The south elevation was not visible. The north elevation has a single-leaf door.

House, 1103 Bunche Drive

1964

Contributing Building

Built into a slope, this side-gabled house has two exposed stories on the west and one on the east. The lower level is brick veneered and the upper is clad in brick and in aluminum siding. On the southside of the lower level of the facade is an inset porch supported by square posts. It shelters a single-leaf door and a one-over-one window at its south. North of the inset porch are two one-over-one windows. On the upper level of the facade, the northern half is brick and contains two one-over-one windows. The southern is clad in aluminum and has paired one-over-one windows. The south elevation has a door at grade in the lower level and one window above it in the upper level. A brick retaining wall extends south from this elevation. The north elevation has two windows on each level. What appears to be a covered deck can be found at the southeast of the house.

House, 1104 Bunche Drive

1964

Contributing Building

This side-gabled, frame split level house has a taller section at the south and a shorter, smaller section at the north. On the facade, the north section has a single-leaf entrance door at the juncture with the south wing. North of the entrance is a metal Chicago-style window. The south side of the facade has two sets of paired two-over-two, horizontal pane windows. The entire facade is clad in brick veneer. The south elevation was not visible. The exterior wall between the two wings is clad in vinyl siding. The north end wall is clad in brick veneer with vinyl siding in the gable. It has a single door at the west.

House, 1203 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately south of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further south are paired

Biltmore Hills

Wake, NC

Name of Property

County and State

one-over-one windows. North of the entrance is a single one-over-one window. The south elevation has two windows and vinyl siding in the gable. The west elevation has vinyl siding in the gable, paired windows, and a door with a fixed metal awning.

Shed ca. 1990 Southeast of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

House, 1204 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the paired one-over-one sash windows on either side of it are in the vinyl siding-clad section of the facade. To the north is a brick-veneered bay with a single one-over-one sash window. The gable ends are clad in brick veneer with vinyl siding the gables. The south elevation has a single sash window and a single-leaf door. The north elevation has two one-over-one windows.

House, 1207 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf entrance door sheltered by a shed-roofed portico with wooden posts. Immediately north of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further north is a bay clad in wooden siding with a single one-over-one window. South of the entrance is a wooden siding clad bay with paired one-over-one windows. The north elevation is brick-veneered and has two windows and wooden siding in the gable. The south elevation has one window and a door.

House, 1208 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. North of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. South of the entrance are large paired one-over-one, vinyl sash windows in a vinyl-sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The north gable end has two one-over-one, vinyl sash windows; the south has a single one-over-one, vinyl sash window and a single-leaf door.

Shed ca. 2003 Southwest of the house is a frame, front-gabled shed. **Noncontributing Building**

House, 1211 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. North of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. South of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The south gable end has paired sash windows and a door; the north has two sash windows. By 1981 a full-width, cross-gabled addition was added to the rear.

Shed ca. 2020 Northeast of the house is a frame, front-gabled shed with a metal roof. **Noncontributing Building**

House, 1212 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance at a masonry stoop. North of the entrance are three six-over-six wooden sash windows, two paired, all with wooden panels below and a rowlock sill. South of the entrance is a single window. The north and south elevations were obscured. They are brick veneer with what appears to be wooden paneling in the gable. They each appear to have two masonry openings, likely windows.

House, 1215 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance sheltered by a portico comprising a fixed metal awning and cast metal supports. South of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill and fixed metal awning. North of the entrance is a single six-over-six wooden sash window with a rowlock sill and fixed metal awning. The south gable end has two sash windows with fixed metal awnings and vinyl siding in the gable above.

Biltmore Hills

Wake, NC

Name of Property

County and State

The north has a paired six-over-six wooden sash windows with a fixed metal awning, a door, and vinyl siding in the gable above.

Chicken coop ca. 2020 Southeast of the house is a chicken coop. **Noncontributing Structure**

House, 1216 Bunche Drive

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately north of the entrance is a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further north are paired one-over-one windows. South of the entrance is a single one-over-one window. The south elevation has paired windows and vinyl siding in the gable. The north elevation has two windows and an exterior, gabled shed addition.

Campanella Lane

House, 800 Campanella Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in vertical wooden siding and running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance with a 10-panel door. North of the entrance are paired one-over-one, vinyl sash windows set in a wood-clad bay; south of the entrance are three one-over-one, vinyl sash windows with a shared rowlock sill, and south of these a single one-over-one, vinyl sash window in a wood-clad bay. The gable ends are clad in brick veneer with aluminum siding in the gables. The south gable end has two one-over-one, vinyl sash windows; the north has a single one-over-one, vinyl sash window and a single-leaf door.

Shed ca. 1980 South of the house is a side-gabled frame shed with a double door. **Noncontributing Building**

House, 801 Campanella Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. West of the entrance are three one-over-one, vinyl sash windows, two paired and one single, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows with a shared rowlock sill. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two one-over-one, vinyl sash windows; the east has paired one-over-one, vinyl sash windows and a single-leaf door.

Shed ca. 1975 In the rear yard is a frame, gable-fronted shed. **Noncontributing Building**

House, 804 Campanella Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. East of the entrance are two sets of paired one-over-one, vinyl sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two one-over-one, vinyl sash windows; the east has a single one-over-one, vinyl sash window and a single-leaf door. A frame, vinyl sided, cross gabled rear ell appears to be an addition and dates from at least 1981 per aerial photos.

Shed ca. 2003 A frame, front-gabled shed stands south of the house. **Noncontributing Building**

House, 805 Campanella Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer with aluminum siding in the gables. It has broad eaves. The facade has a single-leaf entrance door with an oval inset light. West of the entrance are two sets of paired one-over-one, vinyl sash windows, each set with a shared rowlock sill. East of the entrance is a single one-over-one, vinyl sash window with a rowlock sill. The west gable end has two one-over-one, vinyl sash windows; the east has a paired one-over-one, vinyl sash windows. Partially visible is a brick-veneered, cross-gabled rear ell at the west side of the rear elevation. It has a single one-over-one, vinyl sash window on its west elevation. Per aerial photos, the ell has existed since at least 1981.

Shed ca. 1985 Partially visible northeast of the house is a gambrel-roofed shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 808 Campanella Lane 1960

Noncontributing Building

This one-story house has evolved over time. Aerial photos from the 1980s show a front-gabled house with a cross-gabled ell on the east elevation, which may have been a carport. In the 1990s it was expanded to the east and south with a widening of the gabled slope and a shed roofed full-width rear addition respectively and a carport function in the east ell. The facade has a two-bay gabled porch set to the east side of the facade. It has wooden posts and railings. The porch shelters a single-leaf entrance to the east and paired one-over-one, vinyl sash windows to the west. The facade is largely clad in vinyl siding but has brick veneer west of the entrance up to approximately three feet with a rowlock cap course. A small one-over-one window breaks the top course of the west side of the facade. The porch is accessed by steps that ascend to the east. The visible portion of the east elevation is clad in vinyl siding. The west elevation has a single-leaf door and four one-over-one, vinyl sash windows, two of which are paired. The earlier portion of this elevation is brick veneer. The later rear addition is clad in vinyl siding and also houses a single one-over-one, vinyl sash window.

House, 809 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has brick veneer in the western bay, else is vinyl sided. A metal awning at the east side of the facade has been enclosed with screening to form a porch sheltering a single leaf-door and paired windows. West of the porch are three sash windows, two paired in a vinyl-clad bay and one in the brick bay with a vinyl panel below with a rowlock sill, suggesting a once larger window in the masonry frame. Windows have a six-over-six pattern. The east elevation is brick veneer with a window, a single-leaf door and vinyl siding in the gable. The west elevation was not visible.

House, 812 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three six-over-six sash windows, two paired, all with vinyl panels below and a rowlock sill. West of the entrance is a single six-over-six sash window. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two windows; the west a single window and a door. Visible at the east is a rear, cross-gabled addition that existed as early as 1981.

Shed ca. 2020 Southwest of the house and barely visible is a frame, gable-roofed shed. **Noncontributing Building**

House, 813 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with vinyl siding in the gables. It has broad eaves. The facade has a single-leaf entrance with a six-panel door. East of the entrance is a one-over-one, vinyl sash window. West of the entrance is a bank of three, small, one-over-one, vinyl sash windows with a shared rowlock sill, and west of these are paired one-over-one, vinyl sash windows also with a shared rowlock sill. The east elevation is sheltered by a side-gabled carport supported by what appear to be wooden posts. The elevation has a single-leaf door and three one-over-one, vinyl sash windows, the southern two being paired. The west elevation has two windows in the gable end and a third in a rear addition. Aerial photos suggest a cross-gabled rear ell roughly centered and a shed-roofed infill section at the northwest. Per aerial photos, the infill section was added between 1988 and 1999. The brick exterior was painted between 2014 and 2022.

Shed ca. 1990 Northeast of the house is a prefabricated, metal, front-gabled shed. **Noncontributing Building**

House, 816 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. West of the entrance are two sets of paired six-over-six sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two one-over-one, vinyl sash windows; the east has a single one-over-one, vinyl sash window and a single-leaf door. A brick veneered rear ell is partially visible on the east elevation. Per aerial photos it was added between 1981 and 1988.

Shed ca. 1980 A frame, gable-roofed shed stands southwest of the house. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 817 Campanella Lane 1960

Contributing Building

This front-gabled, one-story house is clad in brick veneer and faux board and batten siding with more traditional aluminum siding in the gable. The facade has a single-leaf entrance roughly centered. West of the entrance are paired one-over-one, vinyl sash windows and they and the entrance are sheltered by a fixed metal awning. East of the entrance the lower portion of the facade is brick veneer with metal siding above. This brick veneer extends to form a short, free-standing wall. A shed-roofed carport has been added to the east elevation. The elevation is clad in brick veneer and has at least one visible window. The west elevation is clad in brick veneer. It has a three-pane, three-light door at grade. There are four windows on this elevation, set high under the eaves. The window pattern is obscured on each by a fixed metal awning.

House, 820 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and metal faux board and batten siding. It has broad eaves. The facade has a single-leaf door, flanked by paired one-over-one, vinyl sash windows, those to the east being slightly smaller than those to the west. The easternmost bay of the facade is obscured by vegetation but appears to be brick veneer, as is the east elevation, which has two windows and vinyl siding in the gable.

House, 821 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. Aerial photos from 1981 show a side-gabled house with a cross-gabled rear ell. By 1988 a western telescoping gabled carport has been added as well as infill at the northwest. By 1999 that infill had been expanded further north. By 2000 there is infill to the east of the ell as well. The facade has a single-leaf door with a stoop, accessed by masonry steps and a ramp that ascend to the east and then west. Immediately east of the entrance is a brick-clad bay with a bank of three windows set high at the eave, obscured by a fixed metal awning but sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a window obscured by a fixed metal awning. West of the entrance is a vinyl-clad bay with paired one-over-one vinyl windows. These windows and the entrance share a fixed metal awning. The east elevation is brick-veneered and has two windows and wooden siding in the gable. The west elevation is obscured by the carport but has one window in the original brick veneered portion.

Shed ca. 1980 Northeast of the house is a prefabricated gable-roofed shed. **Noncontributing Building**

House, 824 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two one-over-one, vinyl sash windows; the west has a single one-over-one, vinyl sash window and a single-leaf door.

House, 825 Campanella Lane 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with vertically grooved wooden paneling in the gables. It has broad eaves. The facade has a single-leaf door with an integral fan light. East of the entrance are two sets of paired, two-light sliding windows, set just below the eaves. Each pair shares a rowlock sill. West of the entrance are large paired one-over-one, sash windows. The east gable end has two two-light sliding windows and the west has one.

House, 828 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. Aerial photos suggest it was enlarged with a full width rear addition between 1988 and 1999. The facade has a single-leaf entrance door with an inset oval light sheltered by a fixed wooden awning. West of the entrance are two windows, a Chicago -style window with six-light flankers and a six-over-six window, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows with simulated divided lights. The gable ends are clad in brick veneer with vinyl siding in the gables which extends to cover the rear addition. The east gable end contains at least one window and door, obscured by a carport. The west elevation has two vinyl sash windows in the original portion of the building. A wooden deck

Biltmore Hills

Wake, NC

Name of Property

County and State

has been added at the facade stretching from the entrance east to the east corner of the house. The deck has wooden railings and access steps that ascend to the south and west.

Carport ca. 1990 East of the house is an open, metal, gable-roofed carport. **Noncontributing Building**

House, 829 Campanella Lane 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are paired, two-over-two horizontal pane windows. East of the entrance are at least two, two-over-two horizontal pane windows—a large shrub obscures the facade. The east elevation is clad in brick veneer with vinyl siding in the gable and has two two-over-two horizontal pane sash windows. The west elevation was partially visible. It is clad in brick veneer with vinyl siding in the gable and has at least one window.

House, 832 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with shingles in the gables. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three one-over-one vinyl sash windows, the two closest to the entrance are paired. All have rowlock sills as does the single, one-over-one vinyl sash window west of the entrance. The west elevation has a one-over-one vinyl sash window and an exterior door.

House, 833 Campanella Lane 1965

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. By 1981 it already had a cross-gabled rear ell and a small infill addition to its east, per aerial photos. The ell was expanded to the west between 1981 and 1988. Between 1988 and 1999 a cross-gabled frame addition was added to the east side of the facade. In 2010 a deck was added at the northeast corner of the house and in 2019 the deck appears to have been roofed. The facade has a single-leaf entrance door. West of the entrance are two large two-light windows in a bay that is largely vinyl clad but brick veneered from the sill to grade. East of the entrance is the projecting addition, which has on its west elevation paired glazed doors. The gable front has four large, square, evenly spaced windows. The east elevation has a sliding glass window in the front addition and two windows in the original core of the house. The frame, gable-roofed infill addition off the ell is partially visible and is clad in vinyl siding. The deck and the addition both have a corrugated metal roof, though the deck is shed-roofed. The gable ends at east and west of the house both have vinyl siding in the gables. The west elevation has a shed-roofed carport addition.

House, 836 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in vertical wooden siding and running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are paired six-over-six, sash windows set in a wood-clad bay; west of the entrance are three six-over-six sash windows with a shared rowlock sill, and west of these a single six-over-six sash window in a wood-clad bay. The west elevation was not visible. The east gable end is clad in brick veneer with vertically grooved wooden siding in the gable. It has a single window and a three-light, three-panel door.

House, 837 Campanella Lane 1965

Contributing Building

This one-story, side-gabled frame house is clad running bond brick veneer with aluminum siding in the gables. It has broad eaves. The facade has a single-leaf glazed entrance door. East of the entrance are two sets of paired one-over-one, vinyl sash windows; west of the entrance is a single one-over-one, vinyl sash window. The east elevation has two one-over-one, vinyl sash windows. The west elevation has paired one-over-one, vinyl sash windows and a single-leaf door. The house has solar panels on the west side of the roof.

House, 840 Campanella Lane 1960

Contributing Building

This single dwelling has a side-gabled, one-story portion at the west and a two-story, cross-gabled section at the east. It is unclear if the second story was a later addition. Aerial photos suggest it was there in the early 1980s. The single-leaf entrance is in the one-story portion at the juncture with the two-story portion. West of the entrance are three, large two-light windows with a square light above a smaller rectangular one. The west elevation is clad in vinyl siding and has an exterior end chimney. The facade is clad in what appears to be hard board. Windows in the east wing on the facade are two light sliders, two sets of pairs on each floor with the first-floor windows being

Biltmore Hills

Wake, NC

Name of Property

County and State

slightly larger than those above. There is brick veneer on the facade to the level of the first-floor windows. The east elevation has brick veneer on the first floor with hard board above. There are two sliding glass windows on the second floor and a single window on the first as well as what appears to be a door. A large wooden ramp has been added at the facade.

House, 841 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and faux stone veneer. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired two-light sliding windows, set between the eaves and a rowlock sill and brick veneer. West of the entrance are large paired one-over-one, windows in a faux stone bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has windows with fixed metal awnings. Aerial photos indicate a cross-gabled rear ell in existence since the early 1980s.

House, 844 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with hardboard siding in the gables. It has broad eaves. The facade has a single-leaf, six-panel entrance door. East of the entrance are two sets of paired six-over-six windows greatly obscured by vegetation. West of the entrance is a single six-over-six sash window with a rowlock sill. The east gable end has two sash windows; the west has a paired windows and a door. A cross-gabled rear ell per aerial photos has existed since at least 1981.

House, 845 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance in a portico formed by a fixed metal awning and cast metal supports at a masonry stoop. East of the entrance are three six-over-six wooden sash windows, two paired, all with vinyl panels below and a rowlock sill, suggesting a once larger window in the masonry frame. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two windows with fixed metal awnings; the west a single window and a door.

House, 848 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. West of the entrance are two sets of paired one-over-one, vinyl sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two one-over-one, vinyl sash windows; the west has a single one-over-one, vinyl sash window and a single-leaf door. A cross gabled rear ell appears to date from at least 1981 per aerial photos.

Shed ca. 1980 South of the house is a gable-fronted shed. **Noncontributing Building**

House, 849 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are paired one-over-one, vinyl sash windows. East of the entrance are three one-over-one, vinyl sash windows; the two closest to the entrance are paired and the third is in a brick veneered bay, the rest of the facade being vinyl sided. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two one-over-one, vinyl sash windows; the west has a single one-over-one, vinyl sash window and a single-leaf door.

House, 852 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in wooden siding with a single six-over-six window. West of the entrance is a wooden siding-clad bay with paired six-over-six windows. The east elevation is brick-veneered and has two windows and wooden siding in the gable. The west elevation has one window and a door.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 853 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a bank of three vinyl sash windows set high at the eave, sharing a common rowlock sill. Further east are larger, paired vinyl sash windows. West of the entrance is a single vinyl sash window. The east elevation is brick-veneered and has two windows and vinyl siding in the gable. A portion of a cross-gabled frame ell that appears to be clad in vinyl siding is visible. The west elevation, also clad in brick veneer, has paired windows and a door.

Carport ca. 1975 West of the house is a free-standing, prefabricated, open, gable-roofed, metal carport.

Noncontributing Structure

Shed ca. 1980 Northeast of the house is a prefabricated, metal, gambrel-roofed shed. **Noncontributing Building**

House, 856 Campanella Lane 1960

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. Per aerial photos a cross-gabled, two-bay porch was added between 1981 and 1988. The porch has vinyl balusters and railings, turned posts and steps that descend to the west. It shelters two vinyl-clad bays containing a single-leaf entrance, and large, paired one-over-one vinyl windows at the west. East of the porch the facade is clad in brick veneer up to the sill level of two sets of paired one-over-one windows. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two one-over-one, vinyl sash windows; the west has a single one-over-one, vinyl sash window and a single-leaf door.

Shed ca. 2010 Southwest of the house is a prefabricated gambrel-roofed shed. **Noncontributing Building**

House, 857 Campanella Lane 1960

Contributing Building

The one-story, front-gabled house is clad in brick veneer and grooved wooden siding. The facade is largely clad in grooved wooden siding. A single-leaf entrance is centered under the gable with an arched fixed canopy above it. To its east are paired one-over-one windows. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The east elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade. The west elevation is also clad in brick veneer.

House, 860 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden paneling. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three sliding glass windows, the eastern two of which are paired. All are set between the eaves and a rowlock sill within wooden paneling a set above brick veneer. West of the entrance are large paired one-over-one windows. The gable ends are clad in brick veneer with wooden paneling in the gables. The east gable end has two windows; the east has a bank of windows and a single-leaf door. A two-bay porch on the west side of the facade with a flat roof, cast metal supports and masonry base has existed since 1988.

House, 861 Campanella Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The three western bays of the facade are clad in vinyl siding and the eastern bay in brick veneer. In the vinyl portion, a single-leaf entrance door is flanked by paired one-over-one vinyl sash windows. The entrance and the western windows share a fixed metal awning and the pair to the east has its own awning. The brick bay houses a single window that is obscured by a fixed metal awning. A vinyl sided panel sits between the window and a rowlock sill. The east elevation is clad in brick veneer with vinyl siding in the gable. It has two one-over-one vinyl sash windows. The west elevation is also clad in brick veneer with vinyl siding in the gable.

Carport ca. 1990 West of the house is a free-standing, prefabricated, metal, gable-roofed carport

Noncontributing Structure

Shed ca. 2005 Northwest of the house is a frame, side-gabled shed with double doors. **Noncontributing Building**

House, 864 Campanella Lane 1962

Noncontributing Building

Biltmore Hills

Name of Property

Wake, NC

County and State

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. A cross-gabled, one bay porch with synthetic shingles in the gable has been added to the east side of the facade. It appears to have recently replaced a smaller, shed-roofed porch that was erected between 1988 and 1999 per aerial photos. The porch shelters a single-leaf door with an integrated fan light, and a picture window to its east. West of the porch, the facade has two, rectangular, tall, sliding glass windows. The west elevation has two windows in the original gable end with vinyl siding in the gable above. Partially visible is a rear, cross-gabled ell built between 1988 and 1999. The east elevation has two windows in the original gable end with vinyl siding in the gable above.

Shed ca. 1985 Southwest of the house is a frame, side-gabled storage shed with a saltbox profile.

Noncontributing Building

House, 865 Campanella Lane 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. East of the entrance are three six-over-six wooden sash windows, two paired, all with vinyl panels below and a rowlock sill, suggesting a once larger window in the masonry frame. A fourth such window is west of the entrance. Between 1996 and 2014 a cross-gabled porch was added to the facade, sheltering the entrance and western bay. It has turned posts and balusters. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two windows; the west, a single window and a door.

Shed ca. 2010 Northwest of the house is a frame, prefabricated, gambrel-roofed shed. **Noncontributing Building**

Dandridge Drive

House, 2101 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. North of the entrance is a single, brick-clad bay with a one-over-one sash window. South of the entrance, the facade is clad in brick veneer at the bottom and vinyl siding above. The continuous rowlock top course is interrupted by large, paired windows adjacent to the entrance. Farther south is a third smaller one-over-one window that sits within a cased-in opening in the vinyl clad section. The north elevation is clad in brick veneer and has vinyl siding in the gable. It has two one-over-one vinyl sash windows. The south elevation has a side-gabled, open carport. On the facade, the brick veneer portion of the front wall extends slightly beyond the south wall with a decorative wooden trellis above, screening a portion of the carport. The south end wall has a single-leaf door and two one-over-one windows. The east elevation has four windows and door.

House, 2106 Dandridge Drive 1962

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. A large court carport addition at the northeast corner of the house has been in place since at least 1981. The carport addition has a gabled roof and is supported by brick piers infilled with pierced brickwork walls. Within the carport on the facade is a single-leaf entrance and to its north paired small windows set high at the eaves. South of the entrance on the facade are two one-over-one windows with simulated divided lights each set within a bay with vinyl siding framed by brick veneer. The south elevation is clad in brick veneer and has two one-over-one windows with simulated divided lights. There is vinyl siding in the gable. A western edition, frame and clad in vinyl siding is partially visible. A small rear addition on the north side has been in existence since at least 1981. It was expanded in 2014 and again in 2016.

Mailbox ca. 1965 East of the house at the curb is a brick encased mailbox. **Contributing Object**

House, 2107 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden paneling. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are two sets of sliding glass windows, set between the eaves and a rowlock sill within a wooden paneled section set above brick veneer. North of the entrance are large paired two-light windows in a wooden-sided bay. The gable ends are clad in brick veneer with wooden siding in the gables. The south gable end has two sliding glass windows; the east has a single window and a single-leaf door. An open, shed-roofed deck is partially visible at the northside of the rear elevation.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 2111 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the sliding glass windows on either side of it are in the vinyl sided section of the facade. To the south is a brick veneered bay with a single one-over-one sash window with a vinyl sided panel below. A flat-roofed metal combination carport and porch wraps the northwest corner of the house. It has cast metal supports and has been in place since at least 1981. The south elevation is clad in brick veneer with vinyl siding the gable and has two one-over-one vinyl sash windows.

Shed ca. 1980 Northeast of the house is a prefabricated, gambrel-roofed metal shed. **Noncontributing Building**

House, 2114 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are two sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. North of the entrance are large paired two-light windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The south gable end has two sliding glass windows. The north gable end has a semi-open, side-gabled carport with storage closets at the west end. The end wall has a large window at the east and appears to have a window within the carport.

Shed ca. 1980 West of the house is a prefabricated, metal, gable-roofed shed. **Noncontributing Building**

House, 2115 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. North of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest to the entrance are paired. South of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The south gable end has paired sash windows and a door; the north has two sash windows.

House, 2118 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade is clad in vinyl siding. A tall, cross-gabled porch shelters a single-leaf entrance door with three rectangular horizontal lights that is centered under its gable. Within the porch there are vertical sections of brick veneer that alternate with vinyl siding, set vertically. Within the porch the vinyl clad bays house the entrance and flanking windows. The porch is supported on either side by breeze block walls on brick bases. South of the porch is a single sliding glass window. The south gable end is clad in brick veneer and has vinyl siding in the gable; it houses two windows. The north gable end is obscured by a carport. Per county tax records, the carport was shed-roofed in 1996 but had been expanded by 2015 to be side-gabled with an open shed roofed addition to the east. The carport is supported by brick piers at the north with low breeze block infill walls.

Fence ca. 1970 East of the house along the right-of-way is metal fencing interspersed between brick piers. **Noncontributing Structure**

House, 2119 Dandridge Drive 1960

Contributing Building

Survey was conducted from the right-of-way. This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately north of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further north are paired six-over-six windows. South of the entrance is a single six-over-six window. The north gable end has two windows and vinyl siding in the gable. The south gable end has paired windows and a door. Between 1981 and 1988 a full width, cross-gabled rear wing was added. The peak of that gable, with a louvered vent, is visible above the ridgeline of the original portion of the house.

House, 2122 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. The bay that houses the door and the bay to its south appear to be clad in hardboard siding. The southern bay has two large two-light windows. North of the entrance, the house is clad in brick veneer

Biltmore Hills

Wake, NC

Name of Property

County and State

and has two bays: one with a sliding glass window and one with a one-over-one vinyl sash window. The north elevation is clad in brick veneer with vinyl siding in the gable. It has two windows. The south elevation is clad in brick linear with vinyl siding in the gable. Since at least 1981 it has had a small, side-gabled wing that projects to the south. Its facade has a multi-light door and is clad in wooden paneling. Its south elevation has a bank of windows that suggests that perhaps this addition was once a porch that was later enclosed.

Shed ca. 1980 Southwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 2123 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an inset oval light. North of the entrance are three six-over-six sash windows, two paired, all with "board and batten" style aluminum siding below and a rowlock sill. South of the entrance is a single such window. The north and south elevations are brick veneer with vinyl siding in the gable. The north elevation has two windows. The south elevation has a side-gabled open carport wing. At least one window is visible on the end wall of the house within the carport.

House, 2126 Dandridge Drive 1962

Noncontributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The single-leaf entrance door with an integrated fan light is roughly centered under the gable. To its south brick veneer is roughly eighteen inches high with vinyl siding above with a large one-over one window to the far south. North of the entrance the veneer is roughly three feet tall, and a small one-over-one window is on the framed section above. The gable is uneven, with a longer slope to the north engaging an exterior storage closet. A gable-roofed porch on metal posts shelters the entrance and northern window, which is centered under the porch gable. The south elevation is clad in brick veneer and has two large and two smaller one-over-one windows. Between 1988 and 1999 a two-story, front-gabled, frame camelback addition, clad in vinyl siding was built at the west end of the house. It has two one-over-one windows on the second floor of the east elevation. Its south elevation has a door and windows on the first floor and two windows on the second.

House, 2127 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and aluminum siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately north of the entrance is a brick-clad bay with a bank of three one-over-one vinyl sash windows set high at the eave, sharing a common rowlock sill. Further north is a bay clad in aluminum siding with a single one-over-one window. South of the entrance is an aluminum siding clad bay with paired one-over-one windows. The north elevation is brick veneered and has two windows and aluminum siding in the gable. The south elevation has one window and a door. A flat-roofed metal carport has been added to this elevation. It is supported by metal posts and has a low breeze block wall along its southern side.

Shed ca. 2005 Northeast of the house is a gable-roofed shed. **Noncontributing Building**

House, 2131 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an accessed by masonry steps to a masonry deck that extends from the entrance north. The entrance is flanked by paired one-over-one sash windows. The eastern bay of the facade houses a single one-over-one sash window. The north and south elevations have vinyl siding in the gable. The south elevation has two one-over-one windows. The north elevation has a single sash window and a single-leaf door. The house has had a small rear addition since 1981. Between 1981 and 1988 a small side gabled wing was added to the north elevation, set back towards the east. The addition is largely a carport but has one framed bay with a single-leaf door on its west elevation.

House, 2135 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance sheltered by a portico comprising a fixed metal awning and cast metal supports. South of the entrance are two sets of paired one-over-one sash windows, each set with a shared rowlock sill and fixed metal awning. North of the entrance is a single one-over-one sash window with a rowlock sill and fixed metal awning. The

Biltmore Hills

Wake, NC

Name of Property

County and State

south gable end has two sash windows and wooden paneling in the gable. A frame rear addition is partially visible. A side-gabled carport obscures the north elevation though it appears to have a door and paired windows.

Shed ca. 1985 Northeast of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 2201 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade is clad in vinyl siding. A tall, cross-gabled porch shelters a single-leaf entrance door that is centered under its gable. Within the porch there are vertical sections of brick veneer that alternate with vinyl siding. Within the porch the vinyl clad bays house the entrance and flanking windows. The porch is supported on either side by turned posts. South of the porch is a single sliding glass window. The south gable end is clad in brick veneer and has vinyl siding in the gable; it houses two windows. The north gable end has a side-gabled wing that is set back to the east and projects to the north. The wing has two windows on its west elevation and a single-leaf door on its north elevation. The wing has been in place since at least 1981.

House, 2300 Dandridge Drive 1962

Noncontributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. The house has evolved over time. From aerial photos we can see that in 1981 it was rectangular in footprint save for a small, cross-gabled rear wing at the north end of the rear elevation. Between 1981 and 1988 a cross-gabled wing was added at the north side of the facade. Between 1988 and 1999 the rear wing was expanded, and dormers added on the facade. Thus it appears that the bulk of the original building is now a two-bay carport wing and the later additions now house the bulk of the enclosed living area. Within the original side-gabled portion of the house, the east elevation has at its south two carport bays with gabled dormers above them, and a third enclosed bay, faced with stone veneer and housing paired windows and a single-leaf door. This door is sheltered within an inset porch formed by the overhanging eaves of the northeast wing. The porch is supported by cast metal supports and has a low pierced brick wall at its east end. The porch shelters a second single-leaf door on the south side of the gable-fronted wing. The front-facing gable contains two sets of paired one-over-one windows. The north elevation has a gable with wings to the east and the west. East of the gable is an exterior end brick chimney flanked by single-light rectangular windows that appear to be casements. To the west are three sash windows that appear to be one-over-one windows with simulated divided lights. The south elevation has at the east, the end wall of the carport, part of which is a pierced brick wall. Set back to the north is the west wing, which has on its south elevation a multi-light window that appears to be fixed.

Shed ca. 2010 West of the house is a concrete block, gable-roofed shed. **Noncontributing Building**

Shed ca. 2015 North of the house is a gable-roofed metal shed. **Noncontributing Building**

House, 2304 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and aluminum siding. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are two sash windows with simulated divided lights, set between the eaves and a rowlock sill within an aluminum siding panel set above brick veneer. North of the entrance is a Chicago-style window in an aluminum sided bay. The gable ends are clad in aluminum siding and each house two sash windows with simulated divided lights.

House, 2305 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves and a metal roof. The facade has a single-leaf door with a stoop, accessed by masonry steps with vinyl railings. Immediately north of the entrance is a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further north are paired one-over-one windows. South of the entrance is a single one-over-one window. The south elevation has paired windows, a single-leaf door and vinyl siding in the gable. A frame rear addition is partially visible on this side.

House, 2308 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. North of the entrance is a metal, Chicago-style window. South of the entrance are two sliding glass windows. The south gable end has two sliding glass windows. A side-gabled

Biltmore Hills

Wake, NC

Name of Property

County and State

open carport is added at the north elevation. The end wall has two masonry openings with either windows, doors, or a combination thereof.

House, 2309 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an oval inset light, accessed by steps to a wooden deck that extends north from the entrance. The entrance and the paired one-over-one sash windows with simulated lights on either side of it are in the vinyl sided section of the facade. To the south is a brick veneered bay with a single one-over-one sash window with simulated lights. The north and south elevations are clad in brick veneer with grooved wooden paneling in the gables. The north elevation has one window and a single-leaf door. The south elevation has two windows.

House, 2313 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, entrance door. South of the entrance, the facade is clad in common bond brick veneer up to the skill level of the windows with a single rowlock course and vinyl siding above. North of the entrance that facade is clad entirely in vinyl siding. North of the entrance is a metal, Chicago-style window. South of the entrance are two large one-over-one sash windows. The gable ends are clad in vinyl siding and each has two windows.

House, 2314 Dandridge Drive 1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. East of the entrance are large paired one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two sash windows of differing sizes. The east gable end has a sash window and a single-leaf door.

Shed ca. 1990 Northwest of the house is a gable-roofed metal shed. **Noncontributing Building**

House, 2400 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with a fixed metal awning. South of the entrance are paired sash windows with a fixed metal awning. North of the entrance are two sash windows each with a fixed metal awning. The gable ends are clad in brick veneer with hardboard siding in the gables. The north gable end has two sash windows with fixed metal awnings. The south gable end has two one-over-one sash windows. The west elevation is partially visible. It has a door with a fixed metal awning and three windows.

Shed ca. 2000 West of the house is a frame shed with a gable roof and a double-leaf door.

Noncontributing Building

House, 2404 Dandridge Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, entrance door. North of the entrance, the facade is clad in common bond brick veneer up to the skill level of the windows with a single rowlock course and vinyl siding above. South of the entrance that facade is clad entirely in vinyl siding. South of the entrance are large, paired one-over-one windows. North of the entrance are two large one-over-one sash windows. The gable ends are clad in vinyl siding and each has two windows. The west elevation is partially visible and has a door and three windows.

Shed ca. 2000 West of the house is a frame, gable-roofed shed **Noncontributing Building**

House, 2405 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with an integrated fan light accessed by masonry steps to a stoop. Immediately south of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further south are paired six-over-six windows. North of the entrance is a single six-over-six window. The north and south elevations are clad

Biltmore Hills

Wake, NC

Name of Property

County and State

in brick veneer with grooved paneled siding in the gables. The south elevation has two six-over-six windows. The north elevation has paired windows and a door.

House, 2500 Dandridge Drive 1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. North of the entrance are two sets of paired one-over-one sash windows each set with a shared rowlock sill. South of the entrance is a single fixed window with a framed panel below. The north gable end has two one-over-one sash windows and vinyl siding in the gable. The south elevation has a side-gabled carport supported by wooden posts with framed storage closets at its west end. The brick end wall has paired windows.

House, 2501 Dandridge Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately south of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further south is a bay clad in wooden siding with a single six-over-six window. West of the entrance is a wooden siding clad bay with paired six-over-six windows. The south elevation is brick-veneered and has two windows and wooden siding in the gable. The north elevation has one window and a door.

Fitzgerald Drive

House, 701 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light, accessed by masonry steps and a stoop. Immediately west of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single six-over-six window. East of the entrance is a vinyl siding clad bay with paired six-over-six windows. The west elevation is brick veneered and has two windows and vinyl siding in the gable. The west elevation has one window and vinyl siding in the gable.

House, 705 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three windows, obscured by fixed metal awnings, set between the eaves and a rowlock sill within a vinyl siding panel set above the brick veneer. The two windows closest to the entrance are paired. West of the entrance are large paired one-over-one, sash windows with a common rowlock sill. A fixed metal awning shelters these windows and the entrance door. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end contains paired windows beneath the wrap-around metal awning from the facade, and a single-leaf door; the east has two windows with fixed metal awnings.

Shed ca. 1990 Northeast of the house is a prefabricated, gable-roofed shed. **Noncontributing Building**

House, 706 Fitzgerald Drive 1959

Noncontributing Building

This one-story, side-gabled frame house is clad in brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. To its east is one set of paired six-over-six windows. These windows and the door are sheltered by a cross-gabled porch supported by fluted columns. West of the porch is a second set of paired six-over-six windows. The westernmost bay is clad in brick veneer and houses a single six-over-six window. The west elevation is clad in brick veneer and has vinyl siding in the gable. It has two six-over-six windows. A side gabled wing has been added to the south side of the east elevation. The original end wall is clad in brick veneer with vinyl siding in the gable and has a single exposed window. The addition has on its north elevation a single-leaf door and paired one-over-one windows. Its east elevation has a single one-over-one window.

Shed ca. 1985 Southeast of the house is a frame, front-gabled shed. **Noncontributing Building**

House, 709 Fitzgerald Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. A two-bay, cross-gabled front porch with cast metal supports and a fixed metal awning on three sides shelters a single-leaf entrance door with an integrated fan light and a six-over-six wooden sash window to its east. West of the porch are two sets

Biltmore Hills

Wake, NC

Name of Property

County and State

of paired six-over-six, wooden sash windows, each pair sharing a common rowlock sill. The west elevation has two six-over-six, wooden sash windows. The east elevation is obscured by a single bay carport beneath the gable roof.

House, 713 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with simulated, multi-pane divided lights. West of the entrance are two sets of paired sash windows with a simulated six-over-six divided light pattern, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows with simulated divided lights in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two sash windows; the east has a single window and a single-leaf door.

House, 714 Fitzgerald Drive 1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately west of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single six-over-six window. East of the entrance is a vinyl siding clad bay with paired six-over-six windows. The west elevation is brick-veneered and has two windows and wooden siding in the gable. The east elevation has one window and a door.

House, 717 Fitzgerald Drive 1959

Contributing Building

This one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance is roughly centered under the gable. To its west are large paired one-over-one windows. To its east is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the east elevation. The east elevation, clad in brick veneer, has four windows and a door. The west elevation, also clad in brick veneer, has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade.

Shed ca. 1985 Northeast of the house is prefabricated, gambrel-roofed shed with a double-leaf door.

Noncontributing Building

House, 720 Fitzgerald Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer with some grooved wooden siding. It has broad eaves. A two-bay, cross-gabled front porch with cast metal supports shelters a single-leaf entrance door and a pair of large one-over-one, vinyl sash windows to its east. The porch, built between 1988 and 1999, replaces an earlier smaller porch. West of the porch are three one-over-one horizontal pane, sash windows, set between the eaves and a rowlock sill within a wooden panel set above brick veneer. The two windows adjacent to the porch are paired. The west gable end has two one-over-one, vinyl sash windows and wood paneling in the gable. The east elevation is obscured by a semi-enclosed carport beneath a telescoping gable roof. Between 1988 and 1999 a cross-gabled rear ell was added at the west. The peak of its gable extends above the ridge of the side gable.

House, 721 Fitzgerald Drive 1959

Noncontributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. Between 1981 and 1988 a two-bay, cross-gabled front porch with cast metal supports was added. It shelters a single-leaf entrance door and a six-over-six sash window at its east. West of the porch is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west is a single six-over-six window. The west elevation is brick-veneered and has two windows and vinyl siding in the gable. The east elevation has paired six-over-six windows and a door sheltered by a shed-roofed open carport addition. Aerial photos suggest a cross-gabled central rear ell built between 1988 and 1999.

Shed ca. 1975 Northeast of the house is a side-gabled metal shed **Noncontributing Building**

House, 724 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three six-over-six wooden sash windows, two paired, all with wooden panels below and a rowlock sill. West of the entrance is a single such window. The west elevation was not

Biltmore Hills

Wake, NC

Name of Property

County and State

visible. The east elevation is brick veneer with vinyl siding in the gable. It has a single six-over-six wooden sash window and a door.

House, 725 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and hardboard weatherboard. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light, accessed by masonry steps and a stoop. The entrance and the paired six-over-six sash windows on either side of it are in the weatherboarded section of the facade. To the east is a brick veneered bay with a single six-over-six sash window. The West elevation is clad in brick veneer. It has a single six-over-six sash window, a single-leaf door, and weatherboard in the gable. The east elevation has two one-over-one windows and weatherboard in the gable.

House, 728 Fitzgerald Drive 1960

Contributing Building

This house was particularly hard to document given the landscaping. This one-story, side-gabled frame house is clad in running bond brick veneer. It has a single-leaf entrance door. west of the door is an oversized Chicago-style window. East of the entrance is a bank of three sash windows with simulated divided lights sharing a common rowlock sill. East of these is an additional window. The west elevation has an exterior end chimney. The rest of that elevation is obscured by a metal, shed-roofed carport addition. The east elevation appears to have two windows and vinyl siding in the gable.

House, 729 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with grooved wooden paneling in the gables. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired six-over-six, wooden, double-hung sash windows each set with a shared rowlock sill. West of the entrance is a single six-over-six, wooden, double-hung sash window with a rowlock sill. The east gable end has two six-over-six, wooden, double-hung sash windows; the west has a paired set of windows and a door. A metal ramp has been added to access the primary entrance.

Shed ca. 1975 Northeast of the house is a prefabricated, gable-roofed metal shed. **Noncontributing Building**

House, 732 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door sheltered by a fixed metal awning. West of the entrance are two large, paired, one-over-one windows in a vinyl-clad bay, sheltered by a fixed metal awning. East of the entrance are two sets of paired sliding glass windows in a vinyl-clad panel, each pair sheltered by a fixed metal awning and resting on a continuous rowlock sill with brick veneer below it. The east elevation is clad in brick veneer with vinyl siding in the gable. It has two windows; the northern one has a fixed metal awning. A shed-roofed metal carport has been added to the west elevation; however, a window and a door are visible in the brick veneered gable end.

House, 733 Fitzgerald Drive 1960

Noncontributing Building

This one-story, frame house has been highly altered. It appears to have originally been a front-gabled house with a brick extension wall. A cross-gabled wing has been added to the west. There are two single-leaf doors with integrated fan lights on the facade; the original entrance is roughly centered under the front gable and the second is in the west wing. East of the primary entrance are two large one-over-one windows in a vinyl-clad bay. West of the primary entrance, a small projecting bay window sits on the rowlock course of a brick veneered section, with vinyl siding above it. The vinyl siding continues in the addition wing and west of the second entrance there is a one-over-one vinyl sash window with simulated divided lights. A fixed metal awning shelters the west window and door. The east elevation has four one-over-one windows, the central two of which are paired. It also has a single-leaf door. A flat roofed open carport has been added on this elevation. The west elevation has three windows and what appears to be a door. There is also an interior end brick chimney.

Shed ca. 1985 Northwest of the house is a frame, gable-roofed shed **Noncontributing Building**

House, 736 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door. Flanking the door in vinyl-sided bays are paired six-over-six wooden sash

Biltmore Hills

Wake, NC

Name of Property

County and State

windows. The easternmost bay of the facade is clad in brick veneer and houses a single six-over-six wooden sash window. A hipped roof porch with cast metal supports shelters the entrance and western windows. The porch has a fixed metal awning on three sides and the remaining windows on the facade also have fixed metal awnings. The east elevation has two windows with fixed metal awnings. Above them there is vinyl siding on the gable. The west elevation has a semi open carport under the gable roof. It has a fixed metal awning on the north. The west side of the house, within the carport, has a door and a single window.

House, 737 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. There are four six-over-six, wooden, double-hung, sash windows on the facade, all of which stand above grooved wooden panels. Those immediately east of the entrance are paired. The entrance and western window are sheltered by a porch with a metal roof and cast metal supports. The east elevation is clad in brick veneer and has two windows, however there is vinyl siding in the gable. Also visible on this elevation is a frame, cross-gabled rear ell added circa 2004. The west elevation likewise is clad in brick veneer with vinyl siding in the gable. It has a window and a door and attached to it is a metal carport supported by cast metal supports.

House, 740 Fitzgerald Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. A cross-gabled, one-bay, porch with turned posts shelters the single-leaf entrance on the facade. East of the porch are two sets of paired one-over-one vinyl sash windows. West of the porch is a single one-over-one vinyl sash window. An open, telescoping gabled carport has been added to the west elevation, however the brick veneered exterior wall with grooved wooden paneling in the gable above is visible. There are two windows and a door on this elevation. The east elevation has two windows in a brick veneered end wall with wooden paneling in the gable above. Partially visible is a frame rear addition that aerial photos suggest is cross-gabled and full width. Aerial photos suggest it was built between 1988 and 1999.

Shed ca. 1990 Partially visible at the southwest of the house is a frame, gable-roofed shed.

Noncontributing Building

House, 741 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. East of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables.

Shed ca. 2020 South of the house is a frame, gable-roofed shed. **Noncontributing Building**

Carport ca. 2022 West of the house is a prefabricated, open, gable-roofed carport. **Noncontributing Structure**

House, 744 Fitzgerald Drive 1960

Contributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. A single-leaf entrance is centered roughly under the gable. To its east are paired one-over-one windows in a vinyl-clad bay. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The east elevation is clad in brick veneer and has at least three windows set high under the eaves and a single-leaf door at grade. Per aerial photos, a full-width frame addition was added circa 2000.

Shed ca. 1990 A prefabricated, gable-roofed shed is southwest of the house **Noncontributing Building**

Shed ca. 1990 Barely visible at the southeast of the house is gambrel-roofed shed **Noncontributing Building**

House, 745 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east are paired six-over-six windows. West of the entrance is a single six-over-six window. The east elevation is brick-veneered and has two six-over-six

Biltmore Hills

Wake, NC

Name of Property

County and State

windows and grooved wooden siding in the gable. The west elevation is brick-veneered with grooved wooden siding in the gable; has paired windows and a door.

Shed ca. 1980 Northwest of the house and barely visible is a shed **Noncontributing Building**

House, 748 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. There are four six-over-six, wooden, double-hung, sash windows on the facade, all of which stand above vinyl-sided wooden panels. Those immediately west of the entrance are paired. The east elevation is clad in brick veneer with vinyl siding in the gable. It has a window and a door. The west elevation likewise is clad in brick veneer with vinyl siding in the gable. It has two six-over-six, wooden, double-hung, sash windows.

House, 749 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with vinyl siding in the gables. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance is a single six-over-six, wooden sash window with a rowlock sill. North of the entrance are two sets of paired six-over-six, wooden sash windows each set with a shared rowlock sill. The entrance and south window are sheltered by a porch with a metal roof and cast metal supports. The north gable end has two six-over-six, wooden sash windows; the south has paired six-over-six, wooden sash windows and a door. There is vinyl siding in the gables.

Carport ca. 1980 South of the house is an open, metal carport that has been in place since at least 1981 per aerials. **Noncontributing Structure**

House, 752 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a single six-over-six window. West of the entrance is a vinyl siding clad bay with paired six-over-six windows. The entrance and west windows are sheltered by a gable-roofed porch with cast metal supports that has been in place since at least 1981. The east elevation is brick-veneered with vinyl siding in the gable and has two windows. The west elevation is brick-veneered with vinyl siding in the gable and has one window and a door.

House, 756 Fitzgerald Drive 1961

Contributing Building

Although built contemporaneously with most of the houses in the neighborhood, this house has been highly altered. Aerial photographs from 1980 show a side-gabled house with a cross-gabled porch. Between 1988 and 1999 a cross-gabled rear edition was added with a roofline taller than the original side-gabled ridgeline, thus the peak of its gable extends above and is visible from the right of way. The facade is clad in vinyl siding. Within the porch there are vertical sections of brick veneer that alternate with vinyl siding, set vertically. Within the porch the vinyl clad bays house a single-leaf entrance and flanking windows. The porch is supported on either side by framed end walls that are not clad and are constructed in a decorative pattern. The east gable end is clad in brick veneer and has vinyl siding in the gable; it houses two windows. The west gable end is clad in vinyl siding at the north that wraps from the facade and brick veneer on its southern half.

House, 800 Fitzgerald Drive 1960

Noncontributing Building

This house was originally a front-gabled frame house similar to other houses in the neighborhood built to this model. Between 2002 and 2004, a large cross-gabled wing was added to the west. The house is clad in brick veneer and vinyl siding. A single-leaf entrance is centered roughly under the gable. To its east are large, paired single pane windows. To its west is a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane, above which is vinyl siding. The north elevation of the wing houses a garage bay and a sash window. The east elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired, and a single-leaf door at grade. The west elevation has two doors set at opposite ends of the elevation and paired sash windows at the far southern end.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 804 Fitzgerald Drive 1960

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. A partial-width, shed-roofed screened porch has been added to the facade replacing an earlier smaller porch that was likely not original. The facade has a single-leaf entrance door. Immediately east of the entrance are paired windows within the screened porch. East of the porch are paired one-over-one vinyl sash windows and west of the porch is single such window. The west elevation is brick-veneered with vinyl siding in the gable and has paired windows and a door. The east elevation is brick-veneered with vinyl siding in the gable and has two windows. A framed rear addition, clad in vinyl siding, was added circa 2018. Per aerial photos, it is full width.

House, 805 Fitzgerald Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. A partial-width, shed-roofed front porch supported by square posts extends east from the entrance beyond the wall plane of the east elevation. It shelters both the single-leaf entrance door with an integrated fan light, and two sets of small rectangular sliding glass windows set at the eaves with common rowlock sill to the east. West of the entrance and the porch are two sets of sliding glass windows that sit above grooved wooden panels. The west elevation has two sliding glass windows with rowlock sills and grooved wooden paneling in the gable above. The east elevation has a sliding glass door and a sliding glass window.

House, 808 Fitzgerald Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade is clad in vinyl siding. A tall, cross-gabled porch shelters a single-leaf entrance centered under its gable. Within the porch there are vertical sections of brick veneer that alternate with vinyl siding. Within the porch the vinyl clad bays house the entrance and flanking one-over-one windows. The porch is supported on either side by frame partition screens on brick bases. North of the porch is a single one-over-one window. The north gable end is clad in brick veneer and has vinyl siding in the gable; it houses two windows. The south gable end is clad in vinyl at the west and east and in brick veneer in the center. It has an exterior end brick chimney and a single window.

House, 809 Fitzgerald Drive 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. North of the entrance are paired sash windows in a bay clad in Roman brick. South of the entrance are two sliding glass windows in a vinyl panel that sits above a brick veneered base. The gable ends are clad in brick veneer with vinyl siding in the gables. A small, side-gabled frame wing clad in vinyl siding has been added on the north elevation. The south gable end has two windows.

House, 2306 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are three six-over-six sash windows. Two are paired and all have grooved wooden panels below and a rowlock sill, suggesting a once larger window in the masonry frame. North of the entrance is a fourth such window. The north and south elevations are brick veneer with vinyl siding in the gable. The south elevation has two windows; the north a single window and a door. A carport addition on the north elevation is open to the north and east with a frame. Vinyl-sided wall on the west. Per aerial photos, the carport has existed since at least 1988.

House, 2404 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with grooved wooden paneling in the gables. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are two sets of paired sash windows obscured by security grills and fixed metal awnings. Each set has a shared rowlock sill. North of the entrance is a single one-over-one, vinyl sash window with a rowlock sill. The south gable end has two one-over-one, sash windows; the north has paired one-over-one, vinyl sash windows and a single-leaf door. A two-bay, flat roofed porch with cast metal supports and a masonry base shelters the entrance and north bay of the facade.

House, 2408 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a four-light, single-leaf entrance door. South of the entrance are three six-over-six sash. Those closer

Biltmore Hills

Wake, NC

Name of Property

County and State

to the entrance are paired. The third sits on a brick bay and has a vinyl siding panel below it. North of the entrance are paired six-over-six sash windows. Save for the southernmost bay, the facade is clad in vinyl siding. The north elevation has brick veneer with vinyl siding in the gable. There is a single window on this elevation and a six-light, single-leaf door.

House, 2412 Fitzgerald Drive 1965

Noncontributing Building

Per county tax record photos, this one-story, side-gabled frame house had a front cross gable to the north and a shed-roofed porch to the south. The cross gable has been retained but the porch reworked to have a front-facing gable. The house is largely clad in hardboard, but some faux stone veneer remains in the north bay of the facade and beneath the window south of the entrance. The porch is open on two sides but engages a projecting volume of the house to the south. The porch has a single turned post. It shelters a single-leaf door with a sliding glass window to its south. South of the porch is a bay with a single six-over-six vinyl sash window.

House, 2500 Fitzgerald Drive 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are two large, paired, one-over-one windows. North of the entrance are two sets of paired one-over-one sash windows, each pair sharing a rowlock sill. The north elevation has no masonry openings and vinyl siding in the gable.

Shed ca. 1980 Northwest of the house is a prefabricated, metal, gable-roofed shed. **Noncontributing Building**

House, 2504 Fitzgerald Drive 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade is clad in brick veneer up to the level of windows where the top rowlock course serves as a sill. Above that point, the facade is clad in vinyl siding. South of the single-leaf entrance door is a Chicago-style window and a carport that is open to the east and south. The north elevation has no masonry openings and vinyl siding in the gable.

House, 2508 Fitzgerald Drive 1965

Noncontributing Building

This one-story, front gabled house has a cross-gabled carport wing to the north. The wing roof extends to the east and south creating a shed-roofed porch. The porch and carport are supported by Doric columns. The carport is open to the north and east with a framed wall at the west. The six-light, single-leaf entrance door is centered under the front gable. To the north the facade has a brick veneer to a rowlock top course which serves as a sill to the sliding glass window north of the entrance. South of the entrance, the brick veneer covers roughly a foot of the exterior wall with vinyl siding above. There is a large sliding glass window south of the entrance. The south elevation has five sliding glass windows, the western four of which are paired.

House, 2509 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with an integral fan light. North of the entrance are two one-over-one sash windows, set between the eaves and a rowlock sill within a panel that appears to be Hardie Plank, set above brick veneer. South of the entrance are large paired one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with vertically grooved wooden siding in the gables. The north gable end was not visible; the south has paired one-over-one, vinyl sash windows and a single-leaf door. There is a retaining wall at the southwest corner of the house with steps from the driveway to the level of the entrance of the house.

House, 2512 Fitzgerald Drive 1965

Contributing Building

This one-story, side-gabled frame house is clad in faux stone veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, six-panel entrance door. South of the entrance are two sets of paired one-over-one, horizontal pane sash windows, set within a vinyl-sided panel set above faux stone veneer. North of the entrance is a metal Chicago-style window with one-over-one, horizontal pane sash window flankers. The gable ends are clad in vinyl siding with no cased openings. The north end of the house has an integrated carport beneath the gable. It is open to the north and east with a framed wall at the west.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 2513 Fitzgerald Drive 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, two-panel, six-light entrance door. South of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. North of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with siding in the gables. The south gable end is screened by a privacy fence; the north has a single window and a single-leaf door.

House, 2516 Fitzgerald Drive 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. South of the doors are two sets of paired one-over-one vinyl sash windows, each set sharing a common rowlock sill. North of the entrance is a single set of similar windows. The north and south gable ends have no masonry openings and have vinyl siding in the gables. Aerial photos suggest it has existed since at least 1981.

House, 2519 Fitzgerald Drive 1960

Contributing Building

The parcel has a masonry retaining wall at the north, south, and west sides. This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a single light. Flanking the door in vinyl-sided bays are paired one-over-one vinyl sash windows. The southernmost bay of the facade is clad in brick veneer and houses a single one-over-one vinyl sash window. The north and south elevations were difficult to view. The north and south elevations are clad in brick veneer and have vinyl siding in the gables.

House, 2520 Fitzgerald Drive 1965

Noncontributing Building

This one-story house, clad in vinyl siding, appears to have been altered considerably over time. It may have originally been a front-gabled house. However now it is a cross-gabled house with a wing that extends to the south. A large porch has been added to the north side of the facade, covering the front gable. The porch is enclosed with glass panels on three sides. South of the porch is a Chicago-style window with one-over-one vinyl sash flankers. The south gable end has a sliding glass doors sheltered by a one-bay, gabled portico.

Shed ca. 1999 Southwest of the house is a gable-roofed shed built between 1988 and 1999 per aerials.

Noncontributing Building

Carport ca. 2016 Southeast of the house is a prefabricated, metal, gable-roofed, open carport.

Noncontributing Structure

Gilliam Lane

House, 2000 Gilliam Lane 1963

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door accessed by a stoop with stone veneer and an integrated planter. West of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired single-light windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end was not entirely visible but appears to have at least one window on the main level and a door at an exposed basement. The east elevation has a side-gabled carport, but one window can be seen on the brick endwall.

House, 2004 Gilliam Lane 1963

Contributing Building

The split-level house has at its north a side-gabled portion clad in brick veneer with vinyl siding above. This section has a large window with a fixed metal awning at the north and a single-leaf entrance at the south. The south section of the house is front-gabled. Its lower level is clad in brick and the upper level that cantilevers over the lower level on the facade, is clad in vinyl siding. Shrubs obscure the lower level of the facade that appears to have two masonry openings housing windows. On the main level there are two sets of paired windows, each pair sharing a fixed metal awning. The north elevation has a single-leaf entrance sheltered by a fixed metal awning. The south elevation has a door and a window in the lower level. In the upper level are two windows each with a fixed metal awning.

Biltmore Hills

Wake, NC

Name of Property

County and State

House, 2008 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. North of the entrance is a modified Chicago-style window. South of the entrance are two one-over-one, sash windows with wooden panels below them. The gable ends are clad in brick veneer with vinyl siding in the gables. Each has two windows.

House, 2009 Gilliam Lane

1962

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. Built on a slope, the southeast corner of the house has an exposed basement of concrete block. The north half of the facade is clad in brick veneer and has a Chicago-style window to the north, and a single-leaf entrance east of the window. Both are sheltered by a cross-gabled porch with fluted columns. The south side of the elevation is clad in vinyl siding above and brick at the windowsill level and below. This half has two sliding glass windows, each with fixed metal awnings above, and a brick panel in a basket weave pattern below. Along the south side of the facade is a series of terraced planting beds with concrete block and brick retaining walls. The north elevation is clad in vinyl siding and has two sliding glass windows. The south elevation has two sliding glass windows on the main level with fixed metal awnings and two sliding glass windows in the basement. All four have fixed metal awnings. The upper level is clad vinyl siding, the lower level is concrete block, however the windows have brick sills. The east elevation was only partially visible, however numerous metal awnings mark windows on the upper level. A concrete block retaining wall protects a basement entrance at grade.

Shed ca. 1985 Northeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 2010 Gilliam Lane

1962

Contributing Building

This one-story, side-gabled frame house is clad in vinyl siding. It has broad eaves. Built on a sloping lot the basement is exposed on the south side. It is constructed of concrete block. The facade has a single-leaf entrance door with an integrated fan light, sheltered by a portico comprising a fixed metal awning and cast metal supports. North of the entrance are paired one-over-one windows, and south of the entrance are two one-over-one windows. one-over-one the south elevation has two windows on each level. The north elevation is obscured by an open carport, but it appears to have a single-leaf door. The west elevation was partially visible. It has four windows on the main level, and a single-leaf door in the exposed basement.

House, 2100 Gilliam Lane

1963

Contributing Building

This two-story, side-gabled frame house is clad in running bond brick veneer and wood composite siding. It has broad eaves. The first floor is clad in brick veneer and has a central, single-leaf entrance door. Flanking the entrance door are six-over-six, wooden sash windows. The second floor facade is cantilevered slightly forward of the wall plane of the first floor and supported by a four Tuscan columns. The facade has three six-over-six, wooden sash windows aligned above the windows and door below. The west elevation has two windows on the lower level. The east elevation has a window and a door on the lower level.

House, 2104 Gilliam Lane

1963

Contributing Building

This two-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The first floor is clad in brick veneer and has a central, single-leaf entrance door. Flanking the entrance door are sliding glass windows. The second floor is clad in vinyl siding. Its facade is cantilevered slightly forward of the wall plane of the first floor. It has three windows with fixed metal awnings aligned above the windows and door below. The north elevation has two windows on the lower level. The south elevation has a window and a door on the lower level, sheltered by a one-story, shed-roofed porch.

House, 2105 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The house has three telescoping sections with a garage at the far north that has been in place since at least 1981, if not original. The garage bay is clad in vinyl siding on the facade and has a single vehicular roll-up door. The central section is clad in brick veneer on the lower half and vinyl siding on the upper. At its north side is a modified Chicago-style window and at its south is a single-leaf entrance door. The southern third of the house is clad in brick

Biltmore Hills

Wake, NC

Name of Property

County and State

veneer and has two sets of paired one-over-one windows. The south elevation is clad in vinyl siding and shows a shed-roofed rear addition. It has three windows. The north elevation was not visible.

House, 2108 Gilliam Lane

1963

Contributing Building

This one-story, telescoping, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door and to its east what appears to be a triple casement window all in a brick-faced section of the elevation. The southern half of the elevation is slightly taller and is clad in brick veneer with a vinyl-sided panel housing two sets of paired one-over-one windows. The south elevation is clad in vinyl siding and has two one-over-one windows. The north elevation is also clad in vinyl siding. A rear addition is slightly visible. There is a single door in the original gable end wall.

House, 2109 Gilliam Lane

1963

Contributing Building

The split-level house is clad in running bond brick veneer. At its north is a side-gabled portion with a picture window with a fixed metal awning at the north and a single-leaf entrance with a fixed metal awning at the south. The south section of the house is front-gabled. It has two sets of paired sash glass windows, each pair sharing a fixed metal awning. The north elevation, clad in what appears to be hardboard siding, has a single-leaf entrance sheltered by a fixed metal awning. The south elevation, also clad in what appears to be hardboard siding, has two windows.

House, 2112 Gilliam Lane

1963

Contributing Building

This one-story, telescoping, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade is clad in brick veneer in the lower half and vinyl siding above. The house has a single-leaf entrance door and to its north paired one-over-one windows. A small, shed-roofed porch with turned columns shelters the door and most of these windows. The southern half of the elevation is slightly taller and is clad in brick veneer with a vinyl-sided panel housing two sets of paired one-over-one windows. The south elevation is clad in vinyl siding. The north elevation is also clad in vinyl siding. A rear addition is slightly visible. There is a single door in the original gable end wall. And open carport was added to this elevation between 1981 and 1988.

Shed ca. 2000 Southwest of the house is a frame shed with a saltbox roof. **Noncontributing Building**

House, 2115 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. While not a true split-level house, the southern half of the house is taller than the northern. The northern half of the facade is clad in brick veneer; the southern has brick veneer on its lower half and vinyl siding on the upper. The northern half of the facade has at the juncture with the southern half, a single-leaf entrance door. North of the entrance is a multi-pane picture window. The southern half of the facade has two three-part sliding glass windows. The north and south elevations were not visible.

House, 2116 Gilliam Lane

1963

Contributing Building

This one-story, cross-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The northern side of the facade is side-gabled and is clad in brick veneer on the lower half and vinyl siding on the upper. At its north side are paired one-over-one windows with simulated divided lights and to its south, adjacent to the front-gabled portion of the facade, is a single-leaf door that is accessed by a wooden ramp. The south side of the facade is clad in running bond brick veneer with vinyl siding in the gable. This front-gabled section has two sets of paired one-over-one windows with simulated divided lights. The north elevation is clad in vinyl siding and has a single door. The south elevation is also clad in vinyl siding and has two one-over-one windows.

House, 2120 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It is one of at least four houses in the neighborhood where every 4th course of brick mortar joints is struck deeply giving the wall a certain texture. The house has broad eaves. The facade has a single-leaf entrance door. North of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. South of the entrance are large paired single-light windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables.

Shed ca. 2010 Southwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

Biltmore Hills

Wake, NC

Name of Property

County and State

House, 2121 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. The house has broad eaves. The facade has a single-leaf entrance door. North of the entrance are two sets of paired sliding glass windows. South of the entrance is a masonry opening infilled with vinyl siding and housing two two-over-two horizontal pane sash windows. At the north and south corners of the facade, the brickwork is such that there is a recurring pattern of recessed brickwork that simulates corner quoins. The gable ends are clad in brick veneer with wooden siding in the gables. The south elevation has a window and a door. The north elevation has two windows.

House, 2124 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. North of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. South of the entrance is a single six-over-six wooden sash window with a rowlock sill. The door and windows all have fixed metal awnings. A wooden ramp has been added to access the entrance. The north gable end has two windows; the south has paired windows and a door.

House, 2127 Gilliam Lane

1963

Noncontributing Building

Between 1981 and 1988, this one-story, side-gabled ranch was expanded considerably. A full-width, cross-gabled rear wing has been added. A shed-roofed front porch which has been enclosed extends to the south to form part of a carport on the south elevation. Visible to the north of the enclosed porch is a brick veneered section of the facade that houses a vinyl siding clad panel flanked by one-over-one windows. The north gable end wall has two one-over-one windows that flank what appears to be a masonry flue. The frame rear addition clad in vinyl siding can be seen at the east, and a single window is visible on the north elevation of the rear addition. Within the carport one can see two windows on the original south brick end wall of the house.

Garage ca. 1990 East of the house appears to be a gable-roofed garage. **Noncontributing Building**

House, 2128 Gilliam Lane

1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. South of the entrance is a Chicago-style window. North of the entrance are two one-over-one windows. An open carport has been added to the south elevation, and within it two windows can be seen on the brick end wall. The north elevation has two windows set east of center.

House, 2131 Gilliam Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. North of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The windows south of the entrance have fixed metal awnings, the paired windows sharing a larger one. The entrance and windows to its north share a large, fixed metal awning. The gable ends are clad in brick veneer with vinyl siding in the gables. The north gable end has paired sash windows with a fixed metal awning, and a door; the south has two sash windows. Since at least 1981 the house has had a cross-gabled rear ell, clad in brick veneer.

Shed ca. 1980 East of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 2200 Gilliam Lane

1960

Contributing Building

Survey was conducted from the right-of-way. This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two one-over-one, vinyl sash windows; the east has a single one-over-one, vinyl sash window and a single-leaf, six-light (painted over), six-panel door.

Shed ca. 2015 West of the house is a frame, gable-roofed shed with a double-leaf door. **Noncontributing Building**

Biltmore Hills

Wake, NC

Name of Property

County and State

House, 2203 Gilliam Lane

1960

Noncontributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. Between 1988 and 1999 the house was enlarged considerably with a cross-gabled rear wing, south elevation carport, and a now fully enclosed cross-gabled front porch. The porch is located at the north side of the facade and is fully glazed. To its south is a single one-over-one sash window in the exposed original facade. The original gable end walls at the north and south are clad in brick veneer with vinyl siding in the gables, and house two windows.

House, 2204 Gilliam Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. North of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. South of the entrance is a single six-over-six wooden sash window with a rowlock sill. The north gable end has two six-over-six wooden sash windows; the south has a paired six-over-six wooden sash windows and a single-leaf door with a shed-roofed portico.

House, 2205 Gilliam Lane

1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. The entrance and the paired six-over-six sash windows on either side of it are in the vinyl sided section of the facade. To the south is a brick veneered bay with a single six-over-six sash window. A cross-gabled porch supported by Doric columns sheltered the entrance and northern windows. The north gable end is clad in brick veneer. It has a single six-over-six sash window, a single-leaf door, and weatherboard in the gable. The south gable end has six-over-six windows. The porch was added between 1981 and 1988 which may be when the house was expanded at the east with a frame addition clad in vinyl siding.

Garage ca. 1985 East of the house is a frame, gable-roofed garage. **Noncontributing Building**

House, 2207 Gilliam Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. Between 1988 and 1999 a side-gabled frame addition clad in vinyl siding was added at the south. The facade has a two-panel single-leaf door with a rectangular leaded glass light. South of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The south addition has a single window on the facade. North of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The south elevation was not visible. The north gable end is clad in brick veneer with vinyl siding in the gable. It has a single one-over-one, vinyl sash window and a single-leaf door.

Shed ca. 2020 Northeast of the house is a frame, side-gabled shed **Noncontributing Building**

House, 2208 Gilliam Lane

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and wooden siding. It has broad eaves. The facade has a two-panel, six-light, single-leaf entrance door. South of the entrance are three sliding glass windows, set between the eaves and a rowlock sill within a wood panel set above brick veneer. The windows closest to the entrance are paired. North of the entrance are paired one-over-one, vinyl sash windows with wooden panels below them, in a brick veneered bay. The gable ends are clad in brick veneer with wooden siding in the gables. The north gable end has paired windows and a door; the south has two windows.

Shed ca. 1990 Northwest of the house is a side-gabled, frame shed. **Noncontributing Building**

Hadley Road

House, 600 Hadley Road

1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. North of the entrance are two sets of paired six-over-six wooden sash windows each set within a shared rowlock sill. South of the entrance is a single six-over-six wooden sash window with a rowlock sill. The north gable end has two six-over-six wooden sash windows; the south has paired six-over-six wooden sash windows.

Biltmore Hills

Wake, NC

Name of Property

County and State

House, 601 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf, six-light, two-panel entrance door. North of the entrance are three one-over-one sash windows, two paired, all with grooved wooden panels below and a rowlock sill. There is one such window to the south of the entrance. The north elevation is partially visible. It is clad in brick veneer and has at least one window. The south elevation has a side-gabled carport and the south end wall within it has at least one window.

House, 604 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and what appears to be Hardie Plank. It has broad eaves. The facade has a single-leaf, two-panel, six-light door with a stoop. Immediately south of the entrance is a brick-clad bay with a bank of three one-over-one vinyl replacement windows set high at the eave, sharing a common rowlock sill. Further south is a bay clad in hardiplank with a single one-over-one window. North of the entrance is a hardiplank clad bay with paired one-over-one windows. The south elevation is brick-veneered and has two windows and wooden siding in the gable. The north elevation has at least one masonry opening.

House, 607 Hadley Road 1959

Noncontributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. A single-leaf entrance door with an oval inset light is centered roughly under the gable. To its east are paired one-over-one windows with simulated divided lights. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane with vinyl siding above. This house was a standard design that has been altered. Between 1996 and 2005 the facade windows were replaced, and the north wall extended to fully incorporate the brick wall at the facade. Between 2005 and 2013 an entrance portico and a ramp were added. By 2022 the portico was extended to the south to create a three-bay porch replacing the earlier ramp. The north elevation is not visible due to a privacy fence. The south elevation is clad in brick veneer. The east elevation is clad in brick veneer and has four sash windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade.

Garage ca. 1985 East of the house is a side-gabled, one-car garage. **Noncontributing Building**

House, 608 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately south of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further south are paired six-over-six windows. The southern windows have fixed metal awnings. North of the entrance is a single six-over-six window. The south elevation is brick-veneered with vinyl siding in the gable and has two windows. The north elevation is brick veneered with vinyl siding in the gable and has one window and a door.

Shed ca. 1980 Barely visible west of the house is a gable-roofed metal shed. **Noncontributing Building**

House, 612 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The lower half of the facade is clad in running bond brick veneer on the upper half and vinyl siding. Continuous rowlock top course is interrupted on the south end of the facade by paired windows that may be replacements of a different size than the originals. The entrance door is a single-leaf door. To its north are two sets of paired one-over-one horizontal pane windows sitting on the rowlock course. One of these windows is currently boarded. The north elevation is obscured by a privacy fence. It has brick veneer and grooved wooden paneling in the gable. There is a window and a second masonry opening on this elevation. The south elevation has brick veneer and grooved wooden paneling in the gable. There is at least one window on this gable end. In 1996 a rear, cross-gabled addition was constructed. Its roofline is higher than that on the original portion of the building. Aerial photos suggest it is full-width.

House, 616 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame building is clad in running bond brick veneer and has broad eaves. A cross-gabled rear ell has been added to the north. The facade has a single-leaf entrance door. To its south is a one-over-one sash window. Both the door and window are sheltered by a fixed metal awning that also covers a wooden ramp that

Biltmore Hills

Wake, NC

Name of Property

County and State

ascends from the south to the entrance. To the north of the entrance are paired sliding glass windows and a single one-over one window. All facade windows are set above a frame panel clad in vinyl siding. The north and south elevations are clad in brick veneer with vinyl siding in the gables. The north elevation has five windows and a door. The south gable end has a window and a door.

Shed ca. 2000 West of the building is a frame, gable-roofed shed. **Noncontributing Building**

House, 620 Hadley Road

1959

Noncontributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. A single-leaf entrance is centered roughly under the gable. To its north are paired one-over-one windows. To its south is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. A three-bay, shed-roofed porch has been added to the facade, built between 1981 and 1988 per aerial photos. During the same period a substantial, shed-roofed carport addition was built on the south elevation at a brick retaining wall with several breeze block courses. Four windows and a door can be seen on this elevation in a brick veneered wall. Additional windows can be seen in a full-width, frame, rear addition that was built, per aerial photos, between 1988 and 1990. The north elevation has at least three windows in the brick portion and a fourth in the framed addition, all with fixed metal awnings.

Shed ca. 1990 Northwest of the house is a frame, gable-roofed shed with a double-leaf door.

Noncontributing Building

House, 700 Hadley Road

1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. Immediately north of the entrance is a bank of three vinyl sash windows set high at the eave, sharing a common rowlock sill. Further north are larger, paired vinyl sash windows. South of the entrance is a single vinyl sash window. A porch comprising a fixed metal awning and cast metal supports on a masonry base shelters the entrance and southern window. The north elevation is brick-veneered and has two windows and vinyl siding in the gable. A portion of a cross-gabled ell is visible at the north. The south elevation, also clad in brick veneer, has paired windows and a door. Per aerial photos, the rear addition was constructed between 1981 and 1988.

Shed ca. 1975 Southwest of the house is a prefabricated metal, gable-roofed shed. **Noncontributing**

Building

House, 701 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. Flanking the door are paired one-over-one windows in vinyl-sided wall sections resting on a brick veneered base. North of them is an additional single one-over-one window with a vinyl panel below in a brick veneered bay. The entrance and south windows are sheltered by a cross-gabled porch with cast metal supports added between 1996 and 1999. The north elevation is clad in brick veneer with vinyl siding in the gable and has two one-over-one windows. The south elevation is clad in brick veneer with vinyl siding in the gable and has one one-over-one window and a door.

House, 704 Hadley Road

1959

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. North of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. South of the entrance is a single six-over-six wooden sash window with a rowlock sill. Between 1981 and 1988 a cross-gabled front porch with square posts was built. It shelters the entrance and the window to its south. Between 1988 and 1999 the roof was extended to the south to create an open carport addition. The north gable end has two six-over-six wooden sash windows and vinyl siding on the gable. A small, cross-gabled rear ell at the north was built between 1988 and 1999. It appears to be frame.

Shed ca. 1980 There appears to be a frame shed west of the house. **Noncontributing Building**

House, 707 Hadley Road

1959

Contributing Building

The one-story, front-gabled house is clad in brick veneer and grooved wooden siding. The facade is largely clad in grooved wooden siding. A single-leaf entrance is centered roughly under the gable. To its west are large, paired, single-light windows. To its east is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the east

Biltmore Hills

Wake, NC

Name of Property

County and State

elevation. A full-width front porch comprising a fixed metal awning with cast metal supports on a masonry base has been in place since at least 1996. The east elevation was not visible. The west elevation is clad in brick veneer and has four sliding glass windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade.

House, 708 Hadley Road

1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. North of the entrance are two sets of paired one-over-one, horizontal pane sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. South of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with wooden siding in the gables. The north gable end has two one-over-one, vinyl sash windows with simulated divided lights; the south has a single one-over-one, vinyl sash window and a single-leaf door.

Shed ca. 1985 Southwest of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

House, 712 Hadley Road

1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The house has a single-leaf entrance door. To the north of the door are paired one-over-one vinyl sash windows. The entrance and these windows are sheltered by a two-bay, shed-roofed porch. South of the porch is the second set of paired one-over-one windows, also in a vinyl clad bay. South of that bay is a brick veneered bay housing a single one-over-one window above a vinyl clad panel. The gable ends are clad in brick veneer and have vinyl siding in the gable. The north elevation has a single window and a single-leaf door. The south elevation has two one-over-one windows. Also visible on this elevation is a frame rear ell which has a single window in the south elevation.

House, 800 Hadley Road

1961

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. At some point before 1981 an additional side-gabled bay was added to the east elevation. This was later extended with a shed-roofed addition to the south. Between 1988 and 1999 a cross-gabled front porch was added to this eastern addition. The original entrance is by a single-leaf door. West of this door is a brick veneered bay that houses a one-over-one window with a fixed metal awning. East of the entrance the exterior wall is laid in brick veneer with a top rowlock course for the bottom half of the wall plane. Above this there's vinyl siding. In the vinyl siding area are paired windows adjacent to the door and further east a single window. These windows also have fixed metal awnings. The porch which has squared posts houses a one-over-one window at the west and a single-leaf door at the east. The west elevation is clad in brick veneer with vinyl siding in the gable and has two windows. The east elevation is clad in vinyl siding. The gable end has two windows with fixed metal awnings. There are additional windows in the shed roofed addition at the rear. An interior brick chimney is partially visible from the right-of-way.

Carport ca. 1980 South of the house is a prefabricated, open metal carport. **Noncontributing Structure**

Shed ca. 2020 This is one of two gable-roofed sheds, similar in appearance that are south of the house and carport. **Noncontributing Building**

Shed ca. 2020 This is one of two gable-roofed sheds, similar in appearance that are south of the house and carport. **Noncontributing Building**

House, 801 Hadley Road

1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance at a masonry stoop. East of the entrance are three one-over-one sash windows, two paired, all with vinyl panels below and a rowlock sill. West of the entrance is a single such window. As early as 1981, a side-gabled, brick-veneered garage bay had been added to the east elevation. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has no masonry openings; the west a single window and a door.

House, 804 Hadley Road

1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and hardboard siding. It has broad eaves. The facade has a single-leaf entrance door with a stoop and a fixed metal awning. West of the entrance

Biltmore Hills

Wake, NC

Name of Property

County and State

the wall is brick veneer at the bottom half, topped by a rowlock course. Above, in a paneled section, is a single one-over-one horizontal pane, sash window with a fixed metal awning. East of the entrance the exterior wall is entirely brick veneered. Adjacent to the door are paired one-over-one windows with a common rowlock sill and a fixed metal awning; east of the paired windows is a single window also with a fixed metal awning. A telescoping gabled bay has been added at the east elevation housing an enclosed carport. The east exterior wall is frame and clad in vinyl siding. South of this carport bay, a shed-roofed addition and a second rear addition are partially visible. The west gable end is clad in brick veneer with vinyl siding in the gable. The original portion of the house has two windows with fixed metal awnings and the rear addition has a third window visible from the right of way. Aerial photos suggest that the carport was in place by 1981 and between 1981 and 1988 a rear addition was expanded with a cross hipped section at the south.

House, 807 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. West of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. East of the entrance is a single six-over-six wooden sash window with a rowlock sill. The east and west gable ends are clad in brick veneer with wooden paneling the gable. The west elevation has two six-over-six wooden sash windows; the east has a paired six-over-six wooden sash windows and a door.

House, 808 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with a stoop. West of the entrance is a single one-over-one sash window. East of the entrance is a Chicago style window in a masonry opening with a rowlock sill and infill paneling at the east and west. East of this window is a single one-over-one window. A partial width gabled bay has been added at the east elevation housing an open carport supported by posts on a low brick base wall. The east exterior wall has two windows and a door. The west gable end is clad in brick veneer with vinyl siding in the gable and has two windows.

Shed ca. 1980 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 812 Hadley Road 1961

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with a stoop. West of the entrance is a single six-over-six, wooden, double-hung sash window. East of the entrance is a bank of three six-over-six, wooden, double-hung, sash windows in a masonry opening with a rowlock sill and infill vinyl siding at the east and west. East of this window is a single six-over-six, wooden, double-hung, sash window. A partial -width gabled bay has been at the east elevation since at least 1981. Between 1988 and 1999 a cross-gabled, one bay porch was added. The porch has square posts and shelters a single-leaf door with sidelights in a vinyl-sided bay. The west gable end is clad in brick veneer with vinyl siding in the gable and has two windows. The frame, vinyl-sided, east elevation has two sash windows. An uncovered wooden deck can be seen behind it.

Shed ca. 1985 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 813 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an oval inset light. West of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with wood paneling the gables. An open carport was added to the east elevation circa 1985. Within the carport the end wall contains one window and a door. The west gable end has two one-over-one, vinyl sash windows.

Shed ca. 1985 Northwest of the house is a gambrel-roofed shed. **Noncontributing Building**

Shed ca. 2015 Northeast of the house is a gable-roofed shed with a shed-roofed addition. **Noncontributing Building**

House, 816 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. The facade has a single-leaf entrance door with a stoop. The entrance and its two flanking bays are clad

Biltmore Hills

Wake, NC

Name of Property

County and State

in wooden paneling. The flanking bays each contain paired six-over-six wooden sash windows. The westernmost bay on the facade is clad in brick veneer and houses a single six-over-six wooden sash window. The easternmost bay is an open carport beneath the gabled roof, which may be original. Within the carport the eastern wall of the house is clad in brick veneer and has a single-leaf door and a window. The west elevation is clad in brick veneer with grooved wooden paneling in the gable. The elevation has two six-over-six windows.

House, 819 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately west of the entrance is a bank of three six-over-six wooden windows set high at the eave, sharing a common rowlock sill. Further west are paired six-over-six windows. East of the entrance is a single six-over-six window. The east and west elevations are clad in brick veneer with vinyl siding the gables. The east elevation has paired six-over-six wooden windows and a single-leaf door. The west elevation has two windows.

Shed ca. 1992 Northeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 820 Hadley Road 1960

Contributing Building

This one-story, front-gabled house is clad in brick veneer and grooved wooden siding. The facade is largely clad in grooved wooden siding. A single-leaf entrance is centered roughly under the gable. To its east are paired one-over-one windows. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The east elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade. The west elevation, also clad in brick veneer, has four windows and a door.

Shed ca. 1980 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 823 Hadley Road 1959

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a two-panel, six-light, single-leaf entrance door. Immediately west of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single one-over-one window. East of the entrance is a vinyl siding clad bay with paired one-over-one windows. The east and west elevations are brick-veneered with vinyl siding on the gables. The west elevation has two windows. The east elevation has one window and a door.

House, 824 Hadley Road 1965

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden paneling. It has broad eaves. The facade has a single-leaf door. West of the entrance are three sliding glass windows, the eastern two of which are paired. The windows are set between the eaves and a rowlock sill within a wooden panel set above brick veneer. East of the entrance are large paired one-over-one windows in a brick-veneered bay. The central paired windows are sheltered by a porch comprising a large metal awning and cast metal supports, the remaining window and door on the facade are sheltered by smaller fixed metal awnings. The gable ends are clad in brick veneer. The west gable end was not entirely visible but has at least one window with a fixed metal awning. The east elevation has wooden paneling in the gable. It has paired windows and a single-leaf door.

House, 827 Hadley Road 1959

Contributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance is centered roughly under the gable. To its west are paired one-over-one windows. To its east is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the west elevation. The west elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade. The east elevation, also clad in brick veneer, has a door, three one-over-one windows, and a sliding glass window.

Shed ca. 2000 Northeast of the house, barely visible, is a gable-roofed shed. **Noncontributing Building**

Shed ca. 2015 Northwest of the house is a front-gabled metal shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 828 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. West of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill and fixed metal awning. East of the entrance is a single six-over-six wooden sash window with a rowlock sill. The entrance and east window are sheltered by a porch comprising a fixed metal awning and cast metal supports. The west gable end appears to have two six-over-six wooden sash windows and vinyl siding in the gable. The east gable end has paired six-over-six wooden sash windows, a single-leaf door and vinyl siding in the gable.

House, 831 Hadley Road 1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. The entrance and the bay to its west are clad in vinyl siding. The west bay contains paired, large, vinyl sash windows with simulated divided lights. They sit on a low brick veneered section of the wall topped with a rowlock course that creates a sill. East of the entrance, the facade is clad in brick and contains two one-over-one windows. The east and west elevations are brick-veneered with vinyl siding on the gables. The west elevation has one window and the east elevation two.

House, 832 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with an inset light, accessed by a stoop with masonry steps. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east are paired six-over-six windows. West of the entrance is a single six-over-six window. The east elevation is brick-veneered and has two windows and vinyl siding in the gable. The west elevation has paired windows and a door.

Shed ca. 1900 Southeast of the house is a frame, side gabled shed. **Noncontributing Building**

House, 835 Hadley Road 1961

Noncontributing Building

This side-gabled frame house is clad largely in running bond brick veneer. A cross-gabled front porch and two-story, side-gabled rear addition have been present since 1981. The facade has a single-leaf door flanked by large one-over-one windows. These are sheltered by the cross-gabled front porch with cast metal supports, two of which rest on brick piers. Of note are wooden side panels in a geometric pattern on low brick walls. East of the porch on the facade is a window with a fixed metal awning. The east elevation of the one-story section is clad in brick veneer with vinyl siding the gable and has two windows with fixed metal awnings. The east elevation of the two-story addition is clad in brick veneer on the lower level and vinyl siding above. Each level has a single window, set toward the south, and each with a fixed metal awning. The south elevation of the addition has two windows with fixed metal awnings. The west elevation is similarly clad to the east. The south section has a window and what appears to be a door; the north section has a door and window on the lower level and a single window above. All of these western openings have fixed metal awnings.

Shed ca. 1980 Northwest of the house is frame, gable-roofed shed **Noncontributing Building**

House, 836 Hadley Road 1960

Noncontributing Building

Between 1981 and 1988 a large, frame, side-gabled addition was built at the south. The original portion is a one-story, side-gabled frame house clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door sheltered by a shed-roofed, one-bay porch. East of the entrance the facade is clad in grooved wooden siding. To the west the facade is clad in brick veneer below and wooden siding above. Fenestration is obscured by shrubbery. The facade appears to have paired windows west of the entrance and three windows to the east. The gable ends are clad in brick veneer with wooden panels in the gable. The east gable end has two windows and the west a window and a door. The rear addition is frame and two stories. Its north elevation can't be seen from the right of way. Its east elevation has four windows, two on each floor; the west a door at grade and two windows above.

House, 839 Hadley Road 1961

Contributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. The single-leaf entrance is roughly centered under the gable. To its west brick veneer is roughly eighteen inches high with grooved paneling above with a large one-over-one window to the far west. East of the entrance the veneer is roughly three feet tall and a small one-over-one window is on the framed section above. The gable is uneven with a longer slope to the east that incorporates a wooden shed at the southeast corner of the house.

Biltmore Hills

Name of Property

Wake, NC

County and State

A gable-roofed porch on metal posts shelters the entrance and eastern window, which is centered under the porch gable. The east elevation was not visible. The west elevation is clad in brick veneer and has large, paired windows at the south and two additional smaller sash windows toward the north.

House, 840 Hadley Road

1960

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and aluminum "board and batten" siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three sliding glass windows, set between the eaves and a rowlock sill within an aluminum siding panel set above brick veneer. The windows closest the entrance are paired. West of the entrance are large paired one-over-one, vinyl sash windows in a brick-veneered bay. The entrance and west windows are sheltered by a cross-gabled porch supported by turned posts. The gable ends are clad in brick veneer with aluminum siding in the gables. The west gable end has paired sliding glass windows and a door; the east has two windows with fixed metal awnings. Between 1981 and 1988 a full-width, cross-gabled addition was added to the rear. It is partially visible from the right of way. It appears to be frame and clad in vinyl siding. It appears to contain sliding glass windows. Its west elevation appears to have a single-leaf door.

House, 843 Hadley Road

1961

Contributing Building

Survey was conducted from the right-of-way. This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the bay to its east are clad in wooden siding. The east bay contains paired, large, one-over-one windows. They sit on a low brick veneered section of the wall topped with a rowlock course that creates a sill. The entrance and eastern windows are sheltered by a fixed metal awning. West of the entrance, the facade is clad in brick and contains two windows with fixed metal awnings. The east and west elevations are brick-veneered. An open carport has been added to the east elevation. At the west elevation, a rear addition with exterior end chimney is barely visible.

Mailbox ca. 1975 A brick masonry pier and mailbox are located south of the house at the curb.

Noncontributing Object

House, 844 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. West of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has paired sash windows and a door; the east has two sash windows. Between 1981 and 1988 a full-width, cross-gabled addition was added to the rear. It is partially visible from the right of way. It appears to be frame and clad in vinyl siding. Its east elevation has two windows and its west a window and a door.

House, 847 Hadley Road

1961

Contributing Building

This one story, side-gabled house is clad variously in brick veneer and what appears to be board and batten siding. The facade is largely wooden siding save for four vertical stripes of brick veneer within the cross-gabled porch that frame the single-leaf entrance and flanking one-over-one windows. The porch is supported on the east and west sides by turned posts on low brick walls. To the east of the porch is a single one-over-one window. The east elevation is largely brick veneer and contains two one-over-one windows. The west elevation has an open carport addition built between 1988 and 1999.

Shed ca. 1990 Northwest of the house is a frame, gable-roofed shed **Noncontributing Building**

House, 848 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two sets of paired one-over-one sash windows, each pair sharing a common rowlock sill. West of the entrance is a single one-over-one window. An open, gable-roofed carport is at the west elevation though the brick end wall is visible with a single-leaf door and paired windows. The east gable end is clad in brick veneer and has two sash windows.

Biltmore Hills

Name of Property

Wake, NC

County and State

Shed ca. 1990 Southeast of the house is what appears to be a gable-roofed frame shed **Noncontributing Building**

House, 851 Hadley Road 1961

Contributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. The single-leaf entrance is roughly centered under the gable. To its east brick veneer is roughly eighteen inches high with grooved paneling above with a large one-over one window to the far east. West of the entrance the veneer reaches the gable. It is one of a handful of buildings where the pattern of deeply struck mortar joints at regular course give the wall plane additional texture. This west bay has a small one-over-one window. The gable is uneven with a longer slope to the west that incorporates a wooden shed at the southwest corner of the house. A shed-roofed porch on metal posts shelters the entrance and eastern window then extends to the east elevation forming an open carport. The east elevation has three windows, the west elevation was not visible.

House, 852 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east are paired six-over-six windows. West of the entrance is a single six-over-six window. The west elevation has an open carport with a telescoping gabled roof with cast metal supports on a low brick base wall. The east elevation has two windows and vinyl siding in the gable.

House, 855 Hadley Road 1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. The entrance and the bay to its west are clad in vinyl siding. The west bay contains paired, large, one-over-one windows. They sit on a low brick veneered section of the wall topped with a rowlock course that creates a sill. East of the entrance, the facade is clad in brick and contains two one-over-one windows. The east and west elevations are brick-veneered with vinyl siding on the gables. The west elevation has one window and the east elevation two. What appears to be a small frame addition can be seen at the northwest corner of the house.

House, 856 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integrated fan light, accessed by masonry steps to a stoop. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a vinyl clad bay housing a single six-over-six window. West of the entrance is a vinyl clad bay housing a picture window. The west elevation is clad in brick veneer with vinyl siding in the gable. It has a single-leaf door and a window. The east elevation also is clad in brick veneer with vinyl siding in the gable. It has two windows.

House, 859 Hadley Road 1961

Contributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The single-leaf entrance is roughly centered under the gable. To its east brick veneer is roughly eighteen inches high with vinyl siding above with a large one-over one window to the far east. West of the entrance the veneer is roughly three feet tall and a small sliding glass window is on the framed section above. The gable is uneven with a longer slope to the west that incorporates a wooden shed at the southwest corner of the house. A gable-roofed porch on metal posts shelters the entrance and western window, which is centered under the porch gable. The east elevation was not visible. The west elevation is partially visible. It is clad in brick veneer and has at least one window.

House, 860 Hadley Road 1961

Noncontributing Building

By 1981 a two-story addition was added at the east end of this one-story side-gabled ranch style house. The original portion of the house is clad in brick veneer. It has a partial-width, shed-roofed front porch supported by square posts sheltering both the single-leaf entrance door with an integrated fan light, and two sets of small rectangular sliding glass windows set at the eaves with common rowlock sill to the east. West of the entrance and the porch are two one-over-one windows that sit above vinyl-clad panels. The west elevation has two windows with rowlock sills and

Biltmore Hills

Wake, NC

Name of Property

County and State

paneling in the gable above. The two-story addition to the east is front gabled. The lower level has two vehicular bays that have been infilled partially with vinyl siding. The east bay has two six-over-six windows, and the west bay has sliding glass doors. On the second floor, centered under the gable, is a Chicago-style window. The east elevation was not visible.

House, 863 Hadley Road

1961

Contributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. The gable is uneven with a longer slope to the west that incorporates a wooden shed at the southwest corner of the house. The single-leaf entrance is roughly centered under the gable. To its east is a large one-over one window. A gable-roofed porch on metal posts shelters the entrance and a western, sliding glass window, which is centered under the porch gable. The east elevation and east corner of the facade are clad in brick veneer. The east elevation has large, paired windows at the south and two additional windows at the north. The west elevation was partially visible. It is also clad in brick veneer and has at least two windows.

House, 867 Hadley Road

1962

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. It has been altered considerably from its original form. A carport on the west elevation has existed since 1981 but was enlarged between 1981 and 1988. A cross-gabled front wing and porch, and cross-gabled rear ell were added between 1999 and 2002. The front-gabled facade wing is clad in vinyl siding and has three windows and a single-leaf door. The door and two windows at its west are within the front gabled porch, which is supported by brick piers with pierced brick wall sections between them. East of the wing is another vinyl sash window with simulated divided light at the east. The main portion of the house is clad in running bond brick veneer, as is the rear ell. Windows tend to be in larger masonry openings with some vinyl siding infill. The side-gabled carport at the west has two garage bays and is supported by brick piers.

Shed ca. 1990 North of the house is a side-gabled frame shed. **Noncontributing Building**

House, 900 Hadley Road

1960

Noncontributing Building

This one-story, side-gabled frame house is clad largely in uncoursed stone veneer. It has broad eaves. According to county real estate photos and aerial photos, as early as 1996 the house had two carport bays. At one point it was clad in brick veneer and had a shed-roofed, screened front porch. It appears that the current cross-gabled porch was added around 2003 which may be the same time that the stone was applied to the exterior. The cross-gabled glazed porch has a pierced brick foundation and stone in the pediment. West of the porch are two pairs of one-over-one sash windows. The windows sit on an applied stone base in a brick panel. East of the porch are two garage bays. The west gable end is clad in brick veneer and has vinyl siding in the gable. It has two windows. The east gable end has a low brick wall and brick piers with breeze block infill supporting the end gable clad in vinyl siding.

Shed ca. 1985 Southeast of the house is a gambrel-roofed metal shed. **Noncontributing Building**

Mailbox ca. 2003 A stone masonry mailbox stands at the north side of the parcel. **Noncontributing Object**

House, 901 Hadley Road

1962

Noncontributing Building

Aerial photos suggest that this one, one story, side-gabled ranch house was expanded between 1981 and 1988 with a two-story wing built to the west of the existing house, creating a T-shaped footprint. Between 1988 and 1999 a two-story addition was built east of the two-story wing and north of the original core. This addition has a gabled roof that intersects with the first-two story section and is parallel to the original one-story section. The one-story, side-gabled portion of the facade is clad variously in brick veneer and vinyl siding. The single-leaf entrance door is in a vinyl-clad bay with a vinyl bay to its east housing a single one-over-one window. To its west the original core is clad in brick veneer and houses two windows in larger masonry openings with vinyl infill. The south gable end of the two-story wing is clad in brick veneer on the first floor and vinyl above, each houses a single window. The northern addition also has two windows on the second floor of the facade, set above the house's original roof line. What is visible of the east elevation is entirely clad in vinyl siding with no fenestration. The west elevation is clad in brick on the first level and vinyl on the second. At the north end of this elevation the house has a broader footprint than at the south. Each level has two windows.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 903 Hadley Road 1962

Contributing Building

Additions at the east and west sides of this house were built before 1999. Cars and extensive landscaping obscure most of this house. This one-story, front-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The gable is uneven with a longer slope to the west that incorporates a wooden shed at the southwest corner of the house. The single-leaf entrance is roughly centered under the gable. To its east is a large window. A gable-roofed porch on metal posts shelters the entrance and a western, sliding glass window, which is centered under the porch gable. The porch has since been extended with a flat roofed addition to the east. The east elevation is clad in brick veneer. An open carport has been added to the east elevation beyond which can be seen a frame rear addition with French doors. The southwest corner is clad in vinyl siding, but the bulk of the west elevation is not visible.

House, 904 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door sheltered by a fixed metal awning supported by cast metal posts. East of the entrance are three sash windows, those closest to the door paired, all with grooved wooden panels below, fixed metal awnings, and a rowlock sill. West of the entrance is a single similar window. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two windows. The west elevation has a single window and single-leaf door.

Shed ca. 1995 Southeast of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

House, 907 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately west of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west are paired six-over-six windows. East of the entrance is a single six-over-six window. The east and west elevations are clad in brick veneer with hardboard siding in the gables. The west elevation has two windows. The east elevation has paired windows and a door.

House, 908 Hadley Road 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an oval inset light. East of the entrance is a Chicago-style window. West of the entrance are two sliding glass windows. The east and west elevations are brick veneer with vinyl siding in the gable and have two windows.

Shed ca. 2010 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 911 Hadley Road 1962

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer, stone veneer, and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a stone-clad panel set above brick veneer. The windows closest the entrance are paired. East of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two sash windows. The east appears to have one. Partially visible is a rear addition. As early as 1981 the house had a partial-width, shed-roofed addition. Circa 2019 it was expanded or replaced with a cross-gabled rear addition.

House, 912 Hadley Road 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and aluminum siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance the lower half of the facade is clad in running bond brick veneer with siding above. Resting on the top rowlock course are two windows that appear to be sliding glass, each with a fixed metal awning. West of the entrance the facade is clad in aluminum siding and has a Chicago-style window. The east and west elevations are clad in siding. The east elevation has two windows. The west has two windows and a frame, cross-gabled rear addition with a door is partially visible at the south.

Shed ca. 1985 Southwest of the house is a metal gambrel-roofed shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 916 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with vinyl siding in the gables. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance is wooden six-over-six sash window. West of the entrance is a bank of three, small, six-over-six, wooden sash windows with a shared rowlock sill, and west of these are paired six-over-six, wooden sash windows also with a shared rowlock sill. The west elevation has two six-over-six, wooden sash windows and the east has paired six-over-six, wooden sash windows and a single-leaf door.

House, 919 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately west of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single six-over-six window. East of the entrance is a vinyl siding clad bay with paired six-over-six windows. The east and west elevations are brick-veneered with vinyl siding in the gables. The east elevation has two windows; the west has one window and a door.

House, 920 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door accessed by masonry steps and a stoop. The entrance and the paired one-over-one sash windows on either side of it are in the vinyl sided section of the facade. To the west is a brick veneered bay with a single one-over-one sash window. The east and west elevations are clad in brick veneer with vinyl siding on the gables. The west elevation has two one-over-one windows. The east has a door and a window.

House, 923 Hadley Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. West of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. East of the entrance is a single six-over-six wooden sash window with a rowlock sill. The west gable end has two six-over-six wooden sash windows; the east has a paired six-over-six wooden sash windows and a door.

Shed ca. 2000 North of the house is a prefabricated, gable-roofed metal shed **Noncontributing Building**

House, 1000 Hadley Road 1960

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and stone veneer. It has broad eaves. It has evolved over time. Before 1981 a side-gabled wing was added on the east elevation. Between 1988 and 1999 a small, central, cross-gabled wing and a shed-roofed addition were built on the rear elevation. In 2007 a prominent, cross-gabled entrance portico was added to the facade, and a front-gabled carport added to the earlier east wing. The facade is dominated by the entrance portico which is faced with stone veneer. It has an arched entrance outlined by three rowlock courses. The recessed entrance within the arch comprises a single-leaf door with full-height sidelights topped by a monumental fanlight. An octagonal light is located east of the arched entrance but within the portico. East of the portico are two sets of paired sash windows. The windows appear to be vinyl with simulated divided lights, four-over-four adjacent to the portico and six-over-six to the east. West of the portico and obscured by shrubs is a Palladian window. The carport has a front-facing gable clad in stone veneer supported by brick piers. The west elevation has a series of three staggered gable ends clad in stone veneer. The forward gable is a side porch sheltering a single-leaf door and two windows. The east elevation has a single sash window.

Shed ca. 2000 Though obscured by a tall privacy fence, there appears to be a frame, gabled shed southeast of the house. **Noncontributing Building**

Mailbox ca. 2007 North of the house, at the curb, is an arched brick enclosure for the mailbox flanked by brick planters. **Noncontributing Object**

House, 1003 Hadley Road 1963

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a six-light, single-leaf entrance door. West of the entrance is a vinyl, Chicago-style window. East of the entrance are two large one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with what appears to be board and batten aluminum siding in the gables. Each has two windows.

Biltmore Hills
Name of Property

Wake, NC
County and State

House, 1004 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance are three six wooden sash windows, two paired, all with vinyl panels below and a rowlock sill. West of the entrance is a single such window. The entrance and east windows are sheltered by a porch formed by a fixed metal awning and cast metal supports at a masonry stoop. The east elevation was not visible. The west elevation is brick veneer with vinyl siding in the gable. It has a single window with a fixed metal awning, and a door.

Shed ca. 1985 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 1007 Hadley Road

1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and stucco. It has broad eaves. The facade has a single-leaf entrance door with a single light, accessed by masonry steps and a stoop. The entrance and the paired one-over-one sash windows with simulated divided lights on either side of it are in the stuccoed section of the facade. To the east is a brick veneered bay with a one -over-one sash window with simulated divided lights. The gable ends are clad in brick veneer with stucco in the gables. The west elevation has a window and a single-leaf door. The east elevation has two windows.

Garage ca. 2003 North of the house is a tall, gable-roofed, frame, two-car garage. **Noncontributing Building**

House, 1008 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a single six-over-six window. West of the entrance is a vinyl siding clad bay with paired six-over-six windows. The east and west elevations are brick-veneered with vinyl siding in the gable. The east elevation has two windows, and the west elevation has one window and a door.

House, 1011 Hadley Road

1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door accessed by wooden steps to a small wooden deck. East of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two one-over-one, vinyl sash windows; the east has a single one-over-one, vinyl sash window and a single-leaf door.

House, 1012 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door sheltered by fixed metal awning. East of the entrance are two sets of paired what appear to be six-over-one sash windows each set with a shared rowlock sill and fixed metal awning. West of the entrance is a single six-over-one sash window with a rowlock sill and fixed metal awning. The gable ends are clad in brick veneer with wooden paneling in the gables. The east gable end has two sash windows; the west has paired sash windows and a door.

Shed ca. 2020 Southwest of the house is a prefabricated, frame, gable-roofed shed. **Noncontributing Building**

House, 1100 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door sheltered by a portico comprising a fixed metal awning and cast metal supports. South of the entrance are three sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The two closest to the entrance are paired. North of the entrance are large paired one-over-one, vinyl sash windows in a brick-clad bay. The windows on the facade have fixed metal awnings. The gable ends are clad in brick veneer with vinyl siding in the gables. The south gable end has two sliding glass windows with fixed metal awnings; the north has paired sliding glass windows and a single-leaf door. The

Biltmore Hills

Wake, NC

Name of Property

County and State

north elevation has a large open carport attached, with metal supports, fixed metal awnings on three sides, and a flat roof with a balustrade. A shed-roofed rear addition is partially visible from the north side. Both the carport and rear addition were added before 1981.

Shed ca. 1980 East of the house is a flat-roofed, concrete block shed. **Noncontributing Building**

House, 1101 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. It appears to be a standard design for the neighborhood with an additional bay added to the north. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately north of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further north is a bay clad in vinyl siding with a single one-over-one window and a brick veneer bay with a one-over-one window. South of the entrance is a vinyl siding clad bay with paired one-over-one windows. The north elevation is brick veneered and has two windows and vinyl siding in the gable. The south elevation has one window and an open carport with a flat roof and metal supports. The east elevation has two doors and four windows.

House, 1103 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a paneled, single-leaf entrance door, accessed by masonry steps and a stoop. The entrance and the paired one-over-one windows with simulated divided lights on either side of it are in the vinyl-sided section of the facade. To the west is a brick veneered bay with a single matching window. The east elevation is clad in brick veneer. It has a single window, a single-leaf door, and vinyl siding in the gable. The west elevation has two windows and siding in the gable.

Shed ca. 1980 Northeast of the house is a metal, gable-roofed shed **Noncontributing Building**

House, 1104 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door at a masonry stoop. West of the entrance are three six-over-six wooden sash windows, two paired, all with vinyl panels below and a rowlock sill. To the east there is a single such window. The east and west elevations are brick veneer with vinyl siding in the gable. The west elevation has two windows and the east a single window and a door.

House, 1107 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps and sheltered by a portico comprising a fixed metal awning and cast metal supports. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east are paired six-over-six windows. West of the entrance is a single six-over-six window. The west elevation has at least one window. The east elevation has a side-gabled addition enclosed with wooden lattice.

Shed ca. 1980 Northwest of the house is a brick shed with a gable roof. **Noncontributing Building**

House, 1108 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an integral fan light. East of the entrance are two sets of paired sash windows with simulated divided lights, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows with simulated divided lights, in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two windows; the west has a single window and a single-leaf door.

Shed ca. 2000 Southwest of the house is a prefabricated, gable-roofed shed. **Noncontributing Building**

House, 1111 Hadley Road

1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and hardboard siding. It has broad eaves. The facade has a single-leaf entrance door. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. One window is original and two are vinyl replacements. Further east is a bay clad in hardboard siding with a single one-over-one window. West

Biltmore Hills

Wake, NC

Name of Property

County and State

of the entrance is a hardboard-clad bay with paired windows. The entrance and western windows are sheltered by a shed-roofed porch with squared posts. The east elevation is brick-veneered and has two windows and wooden siding in the gable. The west elevation has one window and a door.

Kitt Place

House, 1100 Kitt Place

1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light sheltered by a fixed metal awning. West of the entrance is a Chicago-style window. East of the entrance are two large one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with vinyl siding in the gables and each has two one-over-one, vinyl sash windows on the main level. As the house is built on a slope, the basement is exposed on the west elevation, and it has a window and a door.

Shed ca. 1990 South of the house is a gable-roofed shed on a concrete block foundation. **Noncontributing Building**

House, 1101 Kitt Place

1963

Contributing Building

The split-level house has at its east a side-gabled portion clad in vinyl siding. This section has a Chicago-style window with a fixed metal awning at the east and a single-leaf entrance at the west. The west section of the house is front-gabled. Its lower level is clad in brick and the upper level that cantilevers over the lower level on the facade, is clad in vinyl siding. Boxwoods obscure the lower level of the facade that appears to have two masonry openings housing windows. On the main level are two sets of paired sliding glass windows, each pair sharing a fixed metal awning. The east elevation has a single-leaf entrance sheltered by a fixed metal awning. The west elevation has a door and a window in the lower level. In the upper level are two windows each with a fixed metal awning.

House, 1103 Kitt Place

1964

Contributing Building

The split-level house has at its east a side-gabled portion clad in vinyl siding over brick veneer. This section has a Chicago-style window sitting on the brick veneered sill at the east and a single-leaf entrance at the west. The west section of the house is front-gabled. Its lower level is clad in brick and the upper level is clad in vinyl siding. An exterior brick chimney is centered on the front gable. The lower level of the facade has two masonry openings housing paired windows. Paired windows aligned above them are on the upper level. The east elevation has two windows and an open carport. The west elevation has a door and a window in the lower level. In the upper level are two windows.

House, 1104 Kitt Place

1963

Noncontributing Building

This one-story, side-gabled frame house is clad variously in uncoursed stone veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are two sets of paired sliding glass windows, set between the eaves and a stone sill within a vinyl siding panel set above stone veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay with a low stone veneered base. A stone clad deck with wooden rails is set at the entrance and eastern windows. The gable ends are clad in brick veneer with vinyl siding in the gables. The east gable end has two windows; the west has two windows on the main level and one in the exposed basement below.

Shed ca. 2000 Southeast of the house is a gable-roofed metal shed. **Noncontributing Building**

House, 1107 Kitt Place

1966

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door sheltered by a portico comprising a fixed metal awning and cast metal supports. East of the entrance is a metal, Chicago-style window and a second window obscured by a shrub. Both have fixed metal awnings. West of the entrance is a one-over-one sash window with a fixed metal awning. The gable ends are clad in brick veneer with vinyl siding in the gables. The east elevation has paired one-over-one windows with a shared metal awning, and a single-leaf door with a portico as on the facade. The west elevation has two windows, each with a fixed metal awning, on the main level. The basement is exposed. It has a window with a fixed metal awning. It also has a single-leaf door with a flat-roofed portico supported by metal supports.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 1108 Kitt Place 1964

Contributing Building

This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a single, vertical, rectangular light. East of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill with a wooden panel between them. West of the entrance are large paired one-over-one, vinyl sash windows. The gable ends are clad in brick veneer with grooved wooden paneling in the gables. The east gable end has single door, the west gable end has two windows on the main level and at least one in the exposed basement below.

House, 1111 Kitt Place 1966

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, entrance door in a recessed entrance bay with wooden canted sides. The facade is clad in running bond brick veneer. East of the entrance is a metal, Chicago-style window. West of the entrance are two large one-over-one, sash windows. The gable ends are clad in vinyl siding. Each appears to have two windows.

Shed ca. 1985 Northwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 1112 Kitt Place 1964

Contributing Building

This one-story, cross-gabled frame house is clad variously in running bond brick veneer and vertically grooved wooden siding. It has broad eaves. The western half of the house is side-gabled and is clad in wooden paneling above and brick veneer below. It has paired one-over-one windows at the west, resting on a rowlock sill, and a single-leaf entrance at the east. The front-gabled portion of the house to the east is clad in brick veneer with wooden paneling in the gable. The facade has two sets of paired one-over-one windows. The east end west elevations are clad in wood; the east elevation has a door and the west two windows.

House, 1115 Kitt Place 1966

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, entrance door in a recessed entrance bay with vinyl-sided, canted sides. The facade is clad in running bond brick veneer. East of the entrance is a Chicago-style window with a vinyl sided panel below it. West of the entrance are two one-over-one, sash windows with vinyl-sided panels below them. The gable ends are clad in vinyl siding. Each has two windows.

House, 1116 Kitt Place 1964

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade is clad in vinyl siding above brick veneer. The veneer is higher east of the entrance than west. The facade has a single-leaf door with three square panels. East of the entrance are two sets of paired sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one windows. The east gable end was not visible. The west elevation has a side-gabled carport addition with a low brick wall, vertical supports and horizontal board siding on the west elevation. The carport has existed since at least 1981.

House, 1119 Kitt Place 1964

Contributing Building

This one-story, front-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. It is one of a handful of buildings where the pattern of deeply struck mortar joints at regular course gives the wall plane additional texture. The single-leaf entrance is roughly centered under the gable. To its west brick veneer is roughly eighteen inches high with grooved paneling above with a large one-over one window to the far west. East of the entrance the veneer is roughly three feet tall and a small one-over-one window is on the framed section above. The gable is uneven with a longer slope to the east. A gable-roofed porch on metal posts shelters the entrance and eastern window, which is centered under the porch gable. The east elevation was partially visible. It is clad in wood to the south and brick to the north. It has a door and at least two windows. The west elevation was obscured by a carport however its brick veneer could be seen as well as two masonry openings.

Carport ca. 1985 West of the house is a free-standing carport with a flat roof and metal supports.

Noncontributing Structure

Biltmore Hills

Wake, NC

Name of Property

County and State

House, 1121 Kitt Place 1964

Contributing Building

This one-story, cross-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The eastern half of the house is side-gabled and is clad in vinyl above and brick veneer below. It has two one-over-one windows resting on a rowlock sill. The front-gabled portion of the house to the west is clad in brick veneer with vinyl siding above. It has a single-leaf door with a two-over-two, horizontal-light sash window at its east resting on a rowlock sill. West of the entrance are large, paired windows. The west elevation is clad in brick veneer. It has a single-leaf door and four windows, the central two being paired. On the east elevation, a cross-gabled rear ell is visible. On the gable end is a single, vehicular, roll-up door. The east elevation of the ell has sliding glass doors and at least two two-over-two horizontal light sash windows resting on a rowlock sill. An exterior end chimney is visible on the north elevation.

Newcombe Road

House, 701 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are two large, paired, one-over-one windows and a semi-enclosed carport bay under the gable. West of the entrance are two sets of paired one-over-one sash windows set in a grooved wooden panel above a rowlock brick course that serves as a sill. Beneath the rowlock course, this section of the facade is clad in brick veneer. West of the windows, the house is clad in vinyl siding above the brick. The west elevation has a window centered under the gable and the elevation is clad in vinyl siding. The east elevation has a single window on the gable end within the carport. The rear section of the carport serves as an addition, giving the roof a saltbox profile on that east elevation.

House, 705 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with siding in the gables. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance is a Chicago-style window. Both this window and entrance are sheltered by a porch comprising a fixed metal awning with cast metal supports. West of the entrance are two one-over-one windows each with a fixed metal awning. The west elevation has two windows; the east elevation was not entirely visible.

Shed ca. 2004 Northwest of the house is a substantial, side-gabled, frame shed. **Noncontributing Building**

House, 706 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with siding in the gables. It has broad eaves. The facade has a single-leaf entrance door and three Chicago-style windows, two to the west of the entrance and one to the east. The west gable end has no masonry openings. The east elevation has a semi-enclosed carport at the south of which is a door that appears to provide access to the house and a cross-gabled rear ell evident in aerial photos.

Shed ca. 1980 Southeast of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

House, 709 Newcombe Road 1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with siding in the gables. It has broad eaves. Like at least one other house in the neighborhood, there is a pattern of deeply struck mortar joints at approximately every fourth course creating a shadow line and providing visual texture to the exterior walls. The facade has a single-leaf entrance door. To its east is a Chicago-style window. Both are sheltered by a porch comprising a fixed metal awning and cast metal supports. West of the entrance are two sets of paired sliding glass windows. The west elevation was obscured by vegetation. The east elevation has no masonry openings.

House, 710 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. To its east is a Chicago-style window in a brick-clad bay. To its west the bottom half of the facade is clad in brick veneer and the upper half in vinyl siding. The brick veneer has a rowlock top course on which sit two wooden sash eight-over-eight windows. The east elevation is clad in brick veneer with vinyl siding in the gable. It has two windows. The west elevation is similar; however, to the south one can see a

Biltmore Hills

Wake, NC

Name of Property

County and State

frame rear addition with a door and a window on its west elevation. Per aerial photos, this rear ell has existed since at least 1981.

Shed ca. 1980 This is one of three, frame, gable-roofed sheds in the rear yard. **Noncontributing Building**

Shed ca. 1980 This is one of three, frame, gable-roofed sheds in the rear yard. **Noncontributing Building**

Shed ca. 1980 This is one of three, frame, gable-roofed sheds in the rear yard. **Noncontributing Building**

House, 713 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad in uncoursed stone veneer and vinyl siding. It has broad eaves. The lower half of the facade is clad in stone and the upper in vinyl siding. The house has a single-leaf entrance door. To its east is a metal Chicago-style window with two-over-two, horizontal light metal flankers. To its west are two sets of paired two-over-two, horizontal light, metal sash windows. The far eastern bay of the house is a carport integrated beneath the gable. The east end wall of the house is visible, clad in vinyl siding with no cased openings. The west elevation was not visible.

House, 714 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad in brick veneer with weatherboard in the gables. It has broad eaves. The facade has a single-leaf entrance door. To its west are two sets of paired one-over-one windows. To its east are a pair of slightly larger one-over-one windows. The east and west elevations have no masonry openings. Slightly visible at the southeast is a metal canopy adjacent to the house.

House, 717 Newcombe Road 1964

Noncontributing Building

This one-story, side-gabled frame house is clad in brick veneer and vinyl siding. It has broad eaves. Since at least 1981 it has had a cross-gabled rear ell at the west. It was infilled between 1988 and 1999. By 2002 the cross-gabled front porch had been added. The eastern half of this front gable covers an open space which may serve as a carport. The western half shelters a single-leaf entrance with paired, large, one-over one-windows at its east. The porch has turned posts and a partial-width fixed metal awning at the south. West of the porch are two sets of paired one-over-one sash windows. The east elevation was not visible. The west elevation is clad in vinyl siding and has three windows, two in the original core of the house and one in the addition. An interior brick chimney is visible.

Shed ca. 1990 Northwest of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

Shed ca. 1990 Northwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 718 Newcombe Road 1965

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. West of the entrance are two sets of paired sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has sliding glass windows; the east has a single sliding glass window and a single-leaf door.

Shed ca. 1980 South of the house is a prefabricated, metal, gambrel-roofed shed. **Noncontributing Building**

House, 722 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and hardiplank. It has broad eaves. The facade has a single-leaf glazed door with simulated divided lights. The bay immediately west of the entrance is clad in brick veneer. Within this bay is a masonry opening with a rowlock sill housing two vinyl sash windows with hardiplank between them. The exterior bays of the facade are clad in Hardie Plank. The western bay houses a single window and the eastern paired windows, all vinyl with simulated divided lights. The east elevation has a single window and a single-leaf door. The west elevation has two windows. The gable ends are clad in brick veneer with Hardie Plank in the gables.

House, 800 Newcombe Road 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. Between 1988 and 1999 a cross-gabled addition was added at the east end of the facade creating a front porch and a carport. The facade has a single-leaf entrance door with an integrated fan light. Windows are generally one-over-one vinyl sash replacements. West

Biltmore Hills

Wake, NC

Name of Property

County and State

of the entrance is a bank of three small windows set near the eaves and farther west is a set of paired windows. Each grouping has a fixed metal awning. The east elevation has two windows with fixed metal awnings. The south elevation has at least three masonry openings. The west elevation has paired windows and a door within the carport addition.

Garage ca. 2000 South of the house is a prefabricated, metal, gable-roofed garage. **Noncontributing Building**

House, 801 Newcombe Road 1961

Contributing Building

This one-story, cross-gabled frame house has been T-shaped in footprint since at least 1981. It is clad in running bond brick veneer with some hardboard siding. The facade has a single-leaf entrance door. East of the entrance, the facade is clad in hardboard and has three windows obscured by shrubbery and fixed metal awnings. West of the entrance the facade is clad in brick veneer and has a single two-over-two, horizontal pane sash window. The west elevation has two two-over-two horizontal pane sash windows in the gable end and no masonry openings on the rear ell. The east elevation has a partial-width gabled carport. The brick veneered end wall has a door and two two-over-two horizontal pane sash windows in the gable end. It appears to have a door in the rear ell. The north elevation was only partially visible. There appear to be three windows on the gable end and one on the west wing.

House, 804 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and hardboard weatherboard. It has broad eaves. The facade has a single-leaf entrance door, accessed by a ramp that ascends from the east. The entrance and the paired six-over-six sash windows on either side of it are in the weatherboarded section of the facade. The door and each windows grouping has a fixed metal awning. The west elevation has two windows with fixed metal awnings. An open metal carport has been added to the east elevation.

Shed ca. 1990 Southwest of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 805 Newcombe Road 1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf door with a stoop. West of the entrance, the facade is clad in brick and has a single six-over-six sash window. In the two bays east of the entrance, the lower portion of the facade is clad in brick and the upper in grooved wooden paneling. Adjacent to the door is a Chicago-style window with six-over-six sash flankers. Further east is a single six-over-six sash window. The easternmost bay of the facade is beneath partial-width gable suggesting that it was a carport, now enclosed. The bay is clad in brick and has a nine-light fixed window and a brick chimney. The east elevation was not visible. The west elevation is clad in brick with wooden paneling in the gable. It has two six-over-six sash windows.

House, 808 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a single six-over-six window. West of the entrance is a vinyl siding clad bay with paired six-over-six windows. The east elevation is brick-veneered and has two windows and vinyl siding in the gable. The west elevation was not visible.

Shed ca. 1990 Southeast of the house is a metal, gable-roofed shed. **Noncontributing Building**

House, 809 Newcombe Road 1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. West of the entrance is a single window with a fixed metal awning. To the east are paired, large one-over-one windows. East of these windows, the facade is clad in brick only in the lower half with vinyl siding above. A single window with a fixed metal awning sits on the rowlock top course. The entrance and paired adjacent windows are sheltered by a large, fixed metal awning. At the east elevation is a partial-width, open, gabled carport. In the brick end wall of the house are two windows and a door. The west elevation has two windows.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 812 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and aluminum board and batten siding. It has broad eaves. A fixed metal awning spans the facade. The single-leaf entrance door has six lights and two panels. East of the entrance are two large, paired, one-over-one windows. West of the entrance are two sets of paired one-over-one sash windows, each pair sharing a rowlock sill course above which is aluminum siding. The gable ends were not visible from the right of way.

House, 813 Newcombe Road 1961

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is projecting vinyl clad bay housing a metal Chicago-style window with two-over-two metal flankers. This bay and the entrance are sheltered by a large, fixed metal awning. The exterior bays are clad in brick and each houses a single window with a fixed metal awning. On the east elevation is a partial-width, open, gable-roofed carport. There are wooden louvers on a low brick wall at the southwestern corner of the carport. On the east brick end wall of the house are two windows and a door. The west elevation has two windows. It is clad in brick with wooden paneling in the gable.

House, 816 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. East of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. West of the entrance is a single six-over-six wooden sash window with a rowlock sill. The entrance and windows all have fixed metal awnings. The west elevation was not visible. The east elevation is clad in brick veneer with vinyl siding on the gable. It has two windows with fixed metal awnings.

House, 817 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. The facade has a single-leaf entrance door, accessed by masonry steps and a broad stoop. The entrance and the paired six-over-six sash windows on either side of it are in the wood-clad section of the facade. To the east is a brick veneered bay with a single six-over-six sash window. The central and eastern windows have fixed metal awnings. The west elevation is clad in brick veneer. It has a single six-over-six sash window, a single-leaf door, and siding in the gable. The east elevation has two one-over-one windows and siding in the gable.

House, 820 Newcombe Road 1960

Contributing Building

This one-story, front-gabled house is clad in brick veneer and grooved wooden siding. The facade is largely clad in grooved wooden siding. A single-leaf entrance is centered roughly under the gable. To its east are paired one-over-one windows with simulated divided lights. To its west is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that wall plane. The brick wall extends beyond the west elevation. The east elevation is clad in brick veneer and has four one-over-one windows set high under the eaves, the central two of which are paired. The elevation also has a single-leaf door at grade. The west elevation was not visible.

House, 821 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with vinyl siding in its gables. It has broad eaves. The facade has a single-leaf entrance. West of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. East of the entrance is a single six-over-six wooden sash window with a rowlock sill. The west gable end has two six-over-six wooden sash windows; the east has a paired six-over-six wooden sash window and a door.

Shed ca. 1990 Northwest of the house is a metal, gable-roofed shed **Noncontributing Building**

House, 824 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. East of the entrance are a set of paired six-over-six sash windows and a sliding glass window, set between the eaves and a rowlock sill within a wooden panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a brick clad bay.

Biltmore Hills

Wake, NC

Name of Property

County and State

The west elevation was not visible. The east elevation was partially visible. It is clad in brick veneer with wooden paneling in the gable.

House, 825 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two one-over-one sash windows; the east has a single one-over-one sash window and a single-leaf door.

Shed ca. 1985 Northwest of the house is a gable-roofed metal shed. **Noncontributing Building**

House, 828 Newcombe Road 1963

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are two sets of paired sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance are large paired one-over-one, windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two sliding glass windows; the east has a single window and a single-leaf door.

Shed ca. 1990 Southwest of the house is a concrete block, gable-roofed shed **Noncontributing Building**

House, 829 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately west of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single six-over-six window. East of the entrance is a vinyl siding-clad bay with paired six-over-six windows. The east and west elevations are clad in brick veneer with vinyl siding in the gables. The west elevation has two windows. The east elevation has one window and a door.

House, 832 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance is Chicago-style window in a canted bay. The exterior bays of the facade each house a one-over-one vinyl sash window. All three windows have vinyl panels below and a rowlock sill. The east and west elevations are brick veneer with vinyl siding in the gable. The west elevation has two windows; the east, a single window and a door.

Shed ca. 1990 Southwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 833 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and hardiplank siding. It has broad eaves. The facade has a glazed, single-leaf entrance door with simulated divided lights. West of the entrance are three vinyl sash windows, the two closest the door are paired, set between the eaves and a rowlock sill within a hardiplank panel set above brick veneer. East of the entrance are large, paired vinyl sash windows with simulated divided lights in a brick-clad bay. The gable ends are clad in brick veneer with hardiplank in the gables. The west gable end has two vinyl sash windows; the east has paired windows and a single-leaf door. On the east elevation a rear ell is partially visible. Aerial photos show that the rear ell has existed since at least 1981.

House, 836 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and "board and batten" aluminum siding. It has broad eaves. The facade has a single-leaf entrance door, accessed by masonry steps and a stoop. The entrance and the paired six-over-six sash windows on either side of it are in the aluminum sided section of the facade. To the west is a brick veneered bay with a single six-over-six sash window. The west elevation is clad in brick veneer but was not entirely visible. The east elevation, also clad in brick veneer, has one six-over-six window and a single-leaf door. Partially visible is a cross-gabled rear ell built after 1988.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 837 Newcombe Road 1960

Contributing Building

The one-story, front-gabled house is clad in brick veneer and vinyl siding. The facade is largely clad in vinyl siding. A single-leaf entrance is roughly centered under the gable. To its west are paired one-over-one windows. To its east is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall extends beyond the east elevation. The west elevation was partially visible. It is clad in brick veneer and has at least three sliding glass windows set high under the eaves, and a single-leaf door at grade. The east elevation, also partially visible, is clad in brick veneer.

House, 840 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. West of the entrance are two sets of paired one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. East of the entrance is a large, fixed picture window in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has two one-over-one, vinyl sash windows; the east has a single one-over-one, vinyl sash window and a single-leaf door.

House, 841 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden panels. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light. East of the entrance are three one-over-one sash windows with simulated divided lights, set between the eaves and a rowlock sill within a wooden panel set above brick veneer. The windows closest the entrance are paired. West of the entrance are large paired one-over-one, vinyl sash windows with simulated divided lights and wooden panel below in a brick-veneered bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has paired sash windows and a door; the east has two sash windows.

Shed ca. 2014 Northwest of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

House, 844 Newcombe Road 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. East of the entrance are two sets of paired six-over-six wooden sash windows each set with a shared rowlock sill. West of the entrance is a single six-over-six wooden sash window with a rowlock sill. The cross-gabled front porch with squared posts sheltering the entrance and the west window was added ca. 2016. It replaces an earlier one that was a fixed metal awning with cast metal supports. The east gable end has two six-over-six wooden sash windows; the west was not visible. A rear addition has been in place since 1988.

Shed ca. 2017 Southeast of the house is a frame, front-gabled shed. **Noncontributing Building**

House, 845 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and hardboard weatherboard. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light, accessed by masonry steps and deck. The entrance and the paired six-over-six sash windows on either side of it are in the weatherboarded section of the facade. A pergola shades the entrance and west windows. To the east is a brick veneered bay with a single six-over-six sash window. The west elevation is clad in brick veneer. It has a single six-over-six sash window, a single-leaf door, and weatherboard in the gable.

House, 848 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door with an integrated fan light, accessed by masonry steps and a stoop. Immediately west of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further west is a bay clad in vinyl siding with a single one-over-one window. East of the entrance is a vinyl siding clad bay with paired one-over-one windows. The east elevation is brick veneered and has two windows and vinyl in the gable. The west elevation has one window and a door. It is also brick-veneered with vinyl in the gable.

Shed ca. 1985 Southeast of the house is a metal, gable-roofed shed. **Noncontributing Building**

Shed ca. 2004 Southwest of the house is a side-gabled frame shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 849 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps and a metal ramp. Immediately east of the entrance is a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further east are paired six-over-six windows. West of the entrance is a single six-over-six window. The west elevation was not visible. The east elevation has two windows and siding in the gable. Partially visible at the east is a full-width, cross-gabled addition built between 1981 and 1988.

House, 852 Newcombe Road 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance sheltered by a cross-gabled porch which was added between 1988 and 1999. The porch shelters the entrance door and a single six-over-six wooden sash window at its west. East of the porch are three six-over-six wooden sash windows, two paired, all with wooden panels below and a rowlock sill. The east elevation was not visible. The west elevation is brick veneer with siding in the gable. It has a single window and a door. A rear ell is partially visible on this elevation. Aerial photos show it was built before 1981.

House, 853 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door. East of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. West of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. The east elevation was not visible. The west gable end is clad in brick veneer with vinyl siding in the gable. It has paired sash windows and a door. Cast metal supports south of the house suggest they once supported a fixed metal awning to create a porch.

House, 856 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. East of the entrance are two sets of paired six-over-six wooden sash windows, each set with a shared rowlock sill. West of the entrance is a single six-over-six wooden sash window with a rowlock sill. The east gable end has two six-over-six wooden sash windows with fixed metal awnings. The west elevation was partially visible. It appears to have paired six-over-six wooden sash windows with a fixed metal awning.

House, 857 Newcombe Road 1960

Contributing Building

A full-width metal awning spanning the facade obscures some aspects of the house. This one-story, side-gabled frame house is clad largely in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. East of the entrance are paired windows in a bay clad in what appears to be "board and batten" aluminum siding. West of the entrance appears to be a bank of three windows in a brick clad bay and the westernmost bay, again in aluminum siding, appears to house a single window. The east elevation is clad in brick with aluminum siding in the gable and has a single window and a single-leaf door.

House, 860 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with a masonry deck with a fixed metal awning and cast metal supports forming a porch sheltering it and the west bay. It is accessed by a wooden ramp. Immediately east of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in vinyl siding with a single one-over-one window. West of the entrance is a vinyl siding clad bay with paired one-over-one windows. A side-gabled, open carport has been added to the west elevation. A door and window can be seen within it on the brick end wall. Also, a rear frame vinyl clad ell is partially visible. The west elevation is brick-veneered and has two windows and vinyl siding in the gable.

Shed ca. 1990 Southeast of the house is a metal, gambrel-roofed shed. **Noncontributing Building**

House, 861 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and hardboard siding. It has broad eaves. The facade has a single-leaf entrance. West of the entrance is a metal Chicago-style window. The entrance

Biltmore Hills

Wake, NC

Name of Property

County and State

and west bay are sheltered by a porch comprising a fixed metal awning and cast metal supports. East of the porch the lower half of the facade is clad in brick veneer with a rowlock top course. Resting on that course are two windows obscured by fixed metal awnings. The one closer to the door appears to be sliding glass and the other a fixed single pane window. The east and west gable ends both have two windows with fixed metal awnings.

House, 900 Newcombe Road 1960

Noncontributing Building

This one-story, side-gabled frame house has been altered considerably. A carport addition at the east was built by 1981. A west addition with a second story that encroaches east over a portion of the original house was built circa 1999 per aerial photos. The original portion of the house has a single-leaf entrance door with an integrated fan light. East of the entrance are large paired one-over-one, vinyl sash windows in a brick veneered bay. West of the entrance are three one-over-one sash windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. The windows closest the entrance are paired. The west addition is clad in vinyl siding. On the facade the first floor bay has paired windows with a cross-gable in the roof pent. The second floor, side-gabled, has two windows marked by cross gables on the facade. There is no fenestration on the east elevation of the second floor. The west elevation of the house has two windows on the first floor and one on the second. The pent roof repeats on the south elevation and there is no fenestration on the second floor. The carport has a breeze block eastern wall.

Shed, ca. 2005 Southeast of the carport is a frame shed. **Noncontributing Building**

House, 901 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. North of the entrance are two sliding glass windows with rowlock sills. South of the entrance is a single one-over-one sash window with a rowlock sill. The north gable end has two one-over-one sash windows and vinyl siding in the gable; the south has a sliding glass window, a single-leaf door and vinyl siding in the gable. There appears to be a small wooden deck at the east elevation.

House, 906 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance. The entrance and flanking picture windows are sheltered beneath a hipped roof porch with cast metal supports. East of the porch is a one-over-one window. The east gable end has two one-over-one sash windows and vinyl siding in the gable.

Shed, ca. 2015 South of the house is a shed-roofed frame shed. **Noncontributing Building**

House, 907 Newcombe Road 1960

Noncontributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. A cross-gabled porch with square posts shelters the single-leaf entrance and its flanking bays. The facade has a single-leaf door. East of the entrance are three six-over-six sash windows, two paired, all with wooden panels below and a rowlock sill. West of the entrance is a single six-over-six window. The east and west elevations are brick veneer with vinyl siding in the gable. The east elevation has two six-over-six windows; the west a single window and a door.

House, 910 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf door with an integral fan light. East of the entrance are two sets of paired sliding glass windows, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. West of the entrance are large paired one-over-one, vinyl sash windows in a vinyl sided bay. The gable ends are clad in brick veneer with vinyl siding in the gables. The west gable end has a window and a door; the east has two windows.

House, 913 Newcombe Road 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and wooden paneling. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a brick-clad bay with a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further east is a bay clad in wooden siding with a single one-over-one window. West of the entrance is a wooden siding clad bay with paired one-over-one windows. The east elevation is brick-veneered and has two windows and wooden siding in the gable. The west elevation has one window and a door.

Biltmore Hills

Name of Property

House, 914 Newcombe Road 1960

Wake, NC

County and State

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately east of the entrance is a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further east are paired one-over-one windows. West of the entrance is a single one-over-one window. The west elevation has brick veneer with vinyl siding in the gable, a single window, and a door. The east elevation has brick veneer with vinyl siding in the gable and two windows.

Owens Lane

House, 2101 Owens Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door. North of the entrance are three one-over-one sash windows, two paired, all with grooved wooden panels below and a rowlock sill. South of the entrance is a single such window. Since at least 1981 the house has had a small addition at the southeast that extends south of the original footprint of the house. In 2021 this was incorporated into a large addition that stretches north to the full width of the original core of the house. The south elevation of the original house is brick veneer with vinyl siding in the gable. It has a single window and appears to have had a door. The west elevation of the addition at the south side of the house has paired windows and a single-leaf door accessed by a ramp. The north elevation of the house is brick at the original gable end wall, and frame to the east. Both gables on this elevation have shingling that appears to be synthetic. The western half of the north elevation has two windows; the eastern half has paired windows.

Shed, ca. 1990 Southeast of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

House, 2105 Owens Lane 1960

Noncontributing Building

This one-story, evolved frame house is clad in brick veneer and vinyl siding. It has broad eaves. Between 1981 and 1988 this front-gabled house received a substantial cross-gabled addition to the south. In the original portion of the facade, a single-leaf entrance is centered roughly under the gable. To its south are paired one-over-one windows. To its north is no fenestration and a brick veneer wall section with a rowlock top course that rises to a height of approximately two-thirds of that of the wall plane. The brick wall originally extended beyond the north elevation, but a shed-roofed addition has enclosed it. The cross-gabled wing is clad in vinyl. Its west elevation has a single-leaf door and paired single-light windows its south elevation. also clad in vinyl, has three windows.

Shed, ca. 1980 Northeast of the house is a metal gable-roofed shed. **Noncontributing Building**

Shed, ca. 1980 Southeast of the house is a frame, gambrel-roofed shed. **Noncontributing Building**

Shed, ca. 1985 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

Shed, ca. 1990 Northeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 2106 Owens Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and simulated stone siding. It has broad eaves. The facade has a single-leaf door with a stoop, accessed by masonry steps. Immediately south of the entrance is a brick-clad bay with a bank of three six-over-six windows set high at the eave, sharing a common rowlock sill. Further south is a faux stone-clad bay with a single six-over-six window. North of the entrance is a faux stone-clad bay with paired six-over-six windows. The south and north elevations are brick-veneered. The south has two windows and the north a window and a door.

Shed, ca. 1990 Southwest of the house is a side-gabled frame shed. **Noncontributing Building**

House, 2109 Owens Lane 1960

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf, two-panel, six-light entrance door. Immediately south of the entrance is a bank of three one-over-one windows set high at the eave, sharing a common rowlock sill. Further south are paired one-over-one windows. North of the entrance is a single one-over-one window. A shed-roofed porch which is an extension of the main roof shelters the entrance the window to the north and part of the bank of windows to the south. The north and south elevations are brick veneered with grooved wooden siding in the gable. The north elevation has paired windows and door. The south elevation has two windows.

Shed, ca. 1985 Northeast of the house is a metal, gable-roofed shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 2113 Owens Lane 1962

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. A partial-width, shed-roofed front porch supported by square posts extends west from the facade and north of the wall plane of the north elevation. It shelters both the single-leaf entrance door and two sets of small rectangular sliding glass windows set at the eaves with common rowlock sill to the north. South of the entrance and the porch are two sets of sliding glass windows that sit above vinyl panels. The south elevation has two sliding glass windows with rowlock. The north elevation has a sliding glass door and a sliding glass window. Also on this elevation a small, frame, shed-roofed rear addition is partially visible. Since at least 1981 there has been a cross-gabled rear ell at the north side of the house. Between 1981 and 1988 a sunroom addition was built south of the ell.

Shed, ca. 1980 East of the house is a frame, gable-roofed shed. **Noncontributing Building**

Waters Drive

House, 1921 Waters Drive 1964

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf entrance door sheltered by a gabled portico with turned posts. North of the entrance are two sets of paired sash windows with simulated divided lights, set between the eaves and a rowlock sill within a vinyl siding panel set above brick veneer. South of the entrance are large paired windows with simulated divided lights, resting on a rowlock sill and brick veneer in a vinyl sided bay. The gable ends are clad in brick veneer with grooved wooden paneling in the gables. Given the slope of the lot, the north elevation has two stories exposed. The main level has two windows and the basement level has a window and a door at grade with a fixed metal awning above it.

House, 1925 Waters Drive 1965

Contributing Building

This one-story, cross-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a front gabled portion to the South that is clad in brick veneer with vinyl siding in the gable. It houses two sets of paired one-over-one vinyl sash windows. North of the front gable portion is the side gabled portion of the house which has a main section and a telescoping garage wing at the far north. Immediately adjacent to the front-gabled wing is the primary entrance by a single-leaf, multi-light door. South of the entrance is a pair of vinyl clad windows like those in the front gabled wing. The garage wing has a single bay with a vehicular door. The South elevation is clad in vinyl siding and has two one-over-one vinyl sash windows.

House, 2000 Waters Drive 1964

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with siding in the gables. It has broad eaves. The facade has a single-leaf entrance door. To its south is one set of paired one-over-one windows. To its north are five one-over-one windows, the four closest to the door are paired. On the north elevation the gable end is clad in brick veneer with siding in the gable. It has one window. The South elevation has a side-gabled tube open carport; however, the brick and wall are visible and clad in brick veneer.

House, 2001 Waters Drive 1965

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, entrance door in a recessed entrance bay with vinyl-sided, canted sides. The facade is clad in running bond brick veneer. North of the entrance is a modified Chicago-style window with a vinyl sided panel below it. South of the entrance are two one-over-one, sash windows with vinyl-sided panels below them. The gable ends are clad in vinyl siding. Each has two windows.

Shed, ca. 1980 Southeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 2003 Waters Drive 1964

Noncontributing Building

The house has at its north a side-gabled portion clad in vinyl siding. This section has a Chicago-style window and a single-leaf door sheltered by a front-gabled porch with square posts. The south section of the house is front-gabled. Its exposed basement level is clad in brick and the upper level that cantilevers over the lower level on the facade, is clad in vinyl siding. Shrubs obscure the lower level of the facade that appears to have two sets of paired two-over-two horizontal pane windows. On the main level are two sets of paired two-over-two horizontal pane windows each

Biltmore Hills

Wake, NC

Name of Property

County and State

pair sharing a fixed metal awning. The north elevation has a single-leaf entrance sheltered by a fixed metal awning. The south elevation has a door with a fixed metal awning and a window in the lower level. In the upper level are two windows.

House, 2005 Waters Drive

1964

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. The facade has a single-leaf entrance door accessed by masonry steps and a stoop. North of the entrance are pair of large composite windows. South of the entrance are two sets of paired sliding glass windows. The north elevation has two windows and vinyl siding in the gable. The south elevation, due to the topography of the parcel, has two levels exposed. As with the north elevation, it has vinyl siding in the gable and two windows on the main level. On the basement level are a window and a door.

House, 2006 Waters Drive

1964

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer. It has broad eaves. While not a true split-level house, the northern half of the house is taller than the southern. Both halves of the facade are clad with brick veneer on lower half and vinyl siding on the upper. The southern half of the facade has, at the juncture with the northern half, a single-leaf entrance door. South of the entrance is a Chicago-style window. The northern half of the facade has two sets of paired sliding glass windows. All windows and the door on the facade have fixed metal awnings. The north elevation is clad in vinyl siding and has two windows with fixed metal awnings. The south elevation has a single door with a portico comprising a fixed metal awning and cast metal supports.

House, 2009 Waters Drive

1964

Contributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and grooved wooden siding. It has broad eaves. The facade has a single-leaf entrance door. South of the entrance are two sets of paired two-over-two, horizontal pane sash windows, set between the eaves and a rowlock sill within a wooden panel set above brick veneer. North of the entrance are large paired single lights windows in a wooden sided bay with a brick veneer base. The gable ends are clad in brick veneer with wooden siding in the gables. The north gable end has two two-over-two, horizontal pane, sash windows. The south elevation has two levels exposed given the topography of the site. The upper level has two windows, and the lower level has two masonry openings that appear to be windows.

Shed, ca. 1990 Northeast of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 2011 Waters Drive

1964

Noncontributing Building

This one-story, side-gabled frame house is clad variously in running bond brick veneer and vinyl siding. It has broad eaves. The facade has a single-leaf, entrance door. To its north are paired one-over-one, vinyl sash windows in a vinyl clad bay with a brick veneered base. These windows and the door are sheltered by a cross-gabled front porch with square posts. South of the porch the house is clad in brick veneer on the facade. There are two masonry openings, each housing paired one-over-one vinyl sash windows with a vinyl sided panel below them. The south elevation has a side-gabled, partially enclosed carport. At least two windows and a door can be seen on the end wall within the carport. The north elevation is clad in brick veneer with vinyl siding in the gable. It has two windows.

Shed, ca. 1985 Northeast of the house is a prefabricated, gable-roofed metal shed. **Noncontributing Building**

House, 2012 Waters Drive

1964

Contributing Building

This one-story, side-gabled, split-level frame house is clad in running bond brick veneer and grooved wooden paneling. It has broad eaves. The western half of the house is taller than the eastern half. Both halves of the facade are clad in brick veneer on lower half and wooden siding on the upper. The eastern half of the facade has at the juncture with the western half, a single-leaf entrance door. East of the entrance is a Chicago-style window. It appears that additional bays have been added to the east-one with paired sliding glass windows and an open carport. The western half of the facade has two sets of paired sliding glass windows on the upper level. The lower level was obscured by shrubs but appears to have at least two windows. The north and south elevations were not visible. The house has a central interior brick chimney.

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 2013 Waters Drive

1964

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and aluminum siding. It has broad eaves. While not a true split-level house, the eastern half of the house is taller than the western. Both halves of the facade are clad in brick veneer on lower half and aluminum siding on the upper. The western half of the facade has at the juncture with the eastern half, a single-leaf entrance door. West of the entrance is a Chicago-style window with two-over-two, horizontal pane, sash flankers. The eastern half of the facade has two sets of paired two-over-two, horizontal pane, sash windows. The easternmost pair of windows has a fixed metal awning. A side-gabled, open carport extends to the west with a decorative wooden railing inset. East elevation is clad in aluminum siding and has two windows.

House, 2016 Waters Drive

1964

Contributing Building

The split-level house has at its east a side-gabled portion clad in vinyl siding. This section has a modified Chicago-style window at the east and a single-leaf entrance at the west. The west section of the house is front-gabled. Its lower level is clad in brick and the upper level that cantilevers over the lower level on the facade, is clad in vinyl siding. The lower level of the facade appears to have two masonry openings housing windows. On the main level are two sets of paired sliding glass windows. The east elevation has an added open carport.

House, 2017 Waters Drive

1964

Contributing Building

Built into a slope, this side-gabled house has two exposed stories on the north and one on the south. The lower level is brick veneered and the upper is clad in vinyl siding. On the east side of the lower level of the facade is an inset porch supported by square posts. It shelters a single-leaf door and a one-over-one window at its east. West of the inset porch is a framed masonry opening housing a modified Chicago-style window. There are three one-over-one windows on the upper level of the facade. The east elevation has a door at grade in the lower level. Above in the upper level are a single window and a single-leaf door that opens to an external wooden deck. The west elevation has two windows in the upper level and one in the lower level.

House, 2020 Waters Drive

1964

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer with siding in the gables. It has broad eaves. Like at least two other houses in the neighborhood, it has a pattern of deeply struck mortar joints at approximately every fourth course creating a shadow line and providing visual texture to the exterior walls. The facade has a single-leaf entrance door. To its west is one set of paired one-over-one windows, and to its east are two such pairs. On the east elevation, the gable end is clad in brick veneer with siding in the gable. It has two windows. Slightly visible is a frame addition at the rear. The west elevation has a side gabled open carport. The west end wall has a window and what appears to be a door.

Shed, ca. 1995 Northwest of the house is a frame, gable-roofed shed. **Noncontributing Building**

House, 2021 Waters Drive

1964

Contributing Building

Built into a slope, this side-gabled house has two exposed stories on the north and one on the south. The lower level is brick veneered and the upper is clad in vinyl siding. On the east side of the lower level of the facade is an inset porch supported by square posts. It shelters a single-leaf door and a one-over-one window at its east. West of the inset porch are two one-over-one windows. There are a Chicago-style window and two one-over-one windows on the upper level of the facade. The east elevation has a door at grade in the lower level and in the upper level is a single window.

House, 2024 Waters Drive

1963

Contributing Building

This one-story, side-gabled frame house is clad in running bond brick veneer and synthetic shingles. It has broad eaves. The facade has a single-leaf entrance door with an oval inset light. While the gable ends are brick veneered, the facade has brick veneer at various heights above which are synthetic shingles. East of the entrance the brick veneer is low and forms a sill for three, tall, single-light rectangular windows. West of the entrance the brick veneer is higher and its top course serves as the sill of two sets of paired sliding glass windows. A large temporary metal ramp serves the primary entrance. The west elevation has two sliding glass windows. The wall has a diamond shaped pattern of darker colored brick between them. The east end wall has a door and a window. A telescoping side gabled open carport has been added to this elevation.

Shed, ca. 2000 North of the house is a gambrel-roofed metal shed. **Noncontributing Building**

Biltmore Hills

Name of Property

Wake, NC

County and State

House, 2025 Waters Drive

1964

Contributing Building

Built into a slope, this side-gabled house has two exposed stories on the north and one on the south. The lower level is brick veneered and the upper is clad in vinyl siding and brick veneer. On the east side of the lower level of the facade is an inset porch supported by square posts. It shelters a single-leaf door and a one-over-one window at its east. West of the inset porch are two one-over-one windows in a framed, vertical bay with windows aligned above them on the upper level. There are two, large, one-over-one windows above the porch in a vinyl-sided bay. The east elevation has a door at grade in the lower level and one window above it in the upper level. A brick retaining wall extends east from this elevation. The west elevation has two windows in each level. The south elevation has a single-leaf door and four windows.

Shed, ca. 1980 South of the house is a gable-roofed metal shed. **Noncontributing Building**

Statement of Integrity

Of the 348 primary resources, only 55 are noncontributing. The remaining noncontributing buildings are small sheds and garages built outside the period of significance. Houses were considered noncontributing if they had large, obtrusive additions; had later porches with materials or are in styles that are incongruous with the house; have copious and visual exterior substitute materials that were not in or do not resemble the original palette of the community (e.g., stone veneer, synthetic shingles simulating wood). Biltmore Hills has not moved, thus it retains integrity of location. The overall plat design and street layout remain unchanged. Many houses have been altered to some degree, but most changes are modest. Overall, the design elements of the individual homes remain largely intact; thus, the neighborhood has a good level of integrity of design. Over time, new developments have grown up around the community. Despite that, the community's density suggests a suburban setting that has naturally extended to adjacent areas; thus, its integrity of setting is largely intact. There has been some substitution of materials, with occasional window or door replacement and the addition of new siding, usually over intact original siding. These exceptions are not egregious and do not harm the integrity of materials to the extent designation is not warranted. The district's workmanship remains intact, with several identifiable housing models represented. The combination of the intact street pattern, the lack of teardowns, the repetition of forms and styles of individual houses, the regulated setbacks, and the generally unobtrusive alterations to individual units gives the district a high level of integrity of feeling and association. And while ownership and occupancy are not factors to consider in evaluation, it is notable that many units are still owned by descendants of original purchasers, creating a strong sense of community that reinforces the integrity of association.

Biltmore Hills
Name of Property

Wake, NC
County and State

8. Statement of Significance

Applicable National Register Criteria

- ☒ A. Property is associated with events that have made a significant contribution to the broad patterns of our history.
- ☐ B. Property is associated with the lives of persons significant in our past.
- ☒ C. Property embodies the distinctive characteristics of a type, period, or method of construction or represents the work of a master, or possesses high artistic values, or represents a significant and distinguishable entity whose components lack individual distinction.
- ☐ D. Property has yielded, or is likely to yield, information important in prehistory or history.

Criteria Considerations

- ☐ A. Owned by a religious institution or used for religious purposes
- ☐ B. Removed from its original location
- ☐ C. A birthplace or grave
- ☐ D. A cemetery
- ☐ E. A reconstructed building, object, or structure
- ☐ F. A commemorative property
- ☐ G. Less than 50 years old or achieving significance within the past 50 years

Areas of Significance

COMMUNITY PLANNING AND DEVELOPMENT
ETHNIC HERITAGE:BLACK

Period of Significance

1959-1966

Biltmore Hills

Name of Property

Wake, NC

County and State

Significant Dates

N/A

Significant Person

N/A

Cultural Affiliation

N/A

Architect/Builder

Richards, Ed

Winters, John

Statement of Significance Summary Paragraph

The Biltmore Hills Historic District is significant at the local level under Criteria A and C in the areas of Community Planning & Development and Ethnic Heritage: Black. Biltmore Hills represents a significant and distinguishable entity whose components lack individual distinction but together represent the design and construction trends reflecting federal housing, urban renewal, and financial policies. Federal policies that impacted cities across the country shaped Biltmore Hills by providing financial incentives for homeownership tied to urban renewal's displacement, and efforts to replace substandard housing. The standards tied to federal programs influenced Biltmore Hills' design with long curvilinear blocks and "the arrangement of similarly designed houses in multiple variations to avoid monotony of tract housing."³ The standards also required covenants for quality, and favored the vertical integration of its purchase, subdivision, and construction, all seen in Biltmore Hills. Biltmore Hills is a largely intact example of a Post-World War II and Early Freeway Suburb (1945-1960).⁴ Biltmore Hills is significant in the area of Ethnic Heritage: Black not only as a community impacted by federally funded projects with a disproportionate negative impact on African American communities, but also as a purpose-built community for African Americans with significant participation by an African American developer in partnership with a white developer, and with naming conventions specifically designed to engender ethnic and community pride. A federally funded transportation project negatively impacted the community, locating an interstate in the largely Black community, which was not an uncommon practice in this era. Biltmore Hills was built exclusively for African American homebuyers of modest means in the waning days of Jim Crow, when their opportunities were still highly limited. Streets named for famous African Americans reinforce the identity of the neighborhood as an unapologetically historically Black community. The Period of Significance begins in 1959 with the construction of the first houses in the neighborhood and ends in 1966 with the completion of the final houses.

³ David L. Ames, Linda Flint McClelland and Sarah Dillard Pope. *Historic Residential Suburbs in the United States, 1830-1960*. National Register Multiple Property Documentation Form, 2004, 56-57.

⁴ David L. Ames, Linda Flint McClelland and Sarah Dillard Pope. *Historic Residential Suburbs in the United States, 1830-1960*. National Register Multiple Property Documentation Form, 2004, 56-57.

Biltmore Hills
Name of Property

Wake, NC
County and State

Narrative Statement of Significance

Biltmore Hills

Biltmore Hills was mapped in five separate plats all drawn and recorded between 1959 and 1961. They reflect ownership by three different development companies: Biltmore Hills Building Company, which owned and developed the first, fourth, and fifth sections; the Walnut Building Company, which owned and developed the second section; and the Lincoln Building Company, which owned and developed the third. All of these corporations were managed and largely owned by developer Ed Richards, as were several others that had minor roles in building out the subdivision, namely North Hills, Inc., Estates Building Company, Edgewater Building Company, Security Realty, and New River Homes.

In July 1959 a notice to bid in the newspaper sought contractors to install water, sewer, and storm drain infrastructure in Biltmore Hills with bids to be submitted to Wachovia Building Company, another Ed Richards company. According to an August 1959 article in *The News and Observer*, growth in the city overall was exceeding expectations, fueled by annexation made possible by the extension and growth in water and sewer infrastructure as at Biltmore Hills.⁵ The article noted several new developments under construction including Biltmore Hills, which was “for Negroes,” described as adjoining Rochester Heights with plans for a park and school nearby.⁶

During National Home Week in September of that year, *The News and Observer* ran a photo of a ranch-style house under construction in the neighborhood.⁷ An advertisement in the same issue highlighted developments by Ed Richards with brief descriptions of each. Biltmore Hills was said to be “for Raleigh’s colored families a modern subdivision of over 350 homes. The first group of 50 homes is completely sold out. For information about remaining homes (priced \$9,000 - \$10,000)—contact John W. Winters & Company.”⁸

The neighborhood had its official debut in November 1959 with much fanfare in the local media. *The Carolinian*, Raleigh’s African American newspaper, featured a large article on the neighborhood that quoted Ed Richards, who touted the homes’ affordability. “The ambitious development will offer Negro families a ‘real chance’ at homeownership,” the article noted.⁹ It described the neighborhood as a village with curbed and paved streets, landscaped lawns, and city services including regular bus service. Lots were to be at least 1/5 of an acre. And the homes were designed by a “nationally known team of architects and contractors.”¹⁰ Buyers had the opportunity to choose interior paint colors and vinyl flooring for the bathroom and kitchens. The

⁵ Jack Crosswell, “City Population Estimate: 90,400,” *The News and Observer*, August 22, 1959.

⁶ Crosswell, “City Population Estimate.”

⁷ Norman P. Mason, “A Salute to America’s Home Builders,” *The News and Observer*, September 13, 1959.

⁸ “Coming Very Soon” (advertisement), *The News and Observer*, September 13, 1959.

⁹ “Biltmore Hills Development Boasts New, Modern Homes,” *The Carolinian*, November 7, 1959.

¹⁰ “Biltmore Hills Development Boasts.”

Biltmore Hills

Name of Property

Wake, NC

County and State

article reported that Federal Housing Administration Section 221 financing would contribute to the affordability for families who had been dislocated because of federal projects.¹¹

The News and Observer covered the grand opening as well. It reported that 350 houses would be built and 150 were already under construction, of which 110 had been presold.¹² Rex Burnham, who worked with Ed Richards, explained that priority for home sales would go to purchasers displaced by government projects, those who currently lived in substandard housing, and those whose income was above the limit for public housing. Buyers in those categories did not have to make a down payment and could qualify for a 40-year FHA loan. Rex Burnham observed, "It's the first effort made to provide housing for Raleigh negro families of average income . . . The reception has been very good and we're well pleased."¹³

Both articles cite special FHA financing for which the City of Raleigh was approved in January 1959. The FHA provided mortgage insurance on 380 units of private, low-cost, workforce housing. This program was specifically intended to assist those displaced by road projects, public housing project construction, and other government projects. Under this program FHA could provide mortgage insurance up to 100% of the appraised value of a home with a maximum insured amount of \$9,000, and a maximum term of 40 years. While it is unclear how many buyers actually used this program, it was a large part of the marketing effort for Biltmore Hills.

The neighborhood was developed as partnership between a white developer, Ed Richards,¹⁴ and a Black builder, developer, and realtor, John Winters.¹⁵ The documentary record suggests that companies controlled by Richards were responsible for the subdivision, the infrastructure, and the building of the homes, and that John Winters was given the exclusive right to market and sell the units. Lately it has been suggested that Winters may have played a larger role in the community's development, but the details are unclear. His vision for the community, however, was well documented. He wanted to increase the availability of quality homes for purchase by moderate-income families. He was quoted as saying, "we wanted to take them out of Chavis Heights . . . These were people who were cab drivers, just ordinary working folks. The opportunity was there for them to buy and own."¹⁶

¹¹ "Biltmore Hills Development Boasts."

¹² "Housing Project for Negroes Going Up On Old Garner Road," *The News and Observer*, November 8, 1959.

¹³ "Housing Project for Negroes Going Up."

¹⁴ Ed Richards moved from New York in 1947 to work on a housing project in Winston-Salem and subsequently moved his operation to North Carolina. While a full study of his work has not been completed, he is known to have constructed seven shopping centers including Raleigh's North Hills, and Raleigh subdivisions including Ridgewood, North Hills Estates, Woodcrest, Pinecrest, and Biltmore Hills. Grady Jeffreys, "E.N. Richards: Passion for Work Leaves Mark on State," *The News and Observer*, November 17, 1963.

¹⁵ A Raleigh native descended from free people of color, John Winters founded a real estate concern, John W. Winters and Company, around 1956. In 1961, he was the first African American elected to the Raleigh City Council, and in 1974 he was elected to the State Senate. In addition to his involvement at Biltmore Hills and Madonna Acres, Winters developed the Cedarwoods Country Estates neighborhood; Wintershaven, a federally subsidized, 60-unit apartment complex; the Brown Birch apartments; and dozens of single-family houses throughout the City of Raleigh. Mary Ruffin Hanbury, *Raleigh's Black Heritage and Historic Places: 1945-1975*, 2023.

¹⁶ Chavis Heights was a public housing project. Lisa Bellamy, "A Stroll along these Streets is Trip through Time," *The News and Observer*, March 1, 1990.

Biltmore Hills

Name of Property

Community Planning and Development

Wake, NC

County and State

As with most of the country, after a lull in construction during World War II, growth in Raleigh exploded in the post-war period. Between 1949 and 1975 Raleigh expanded from roughly 6,920 acres to 33,192 acres, the result of 144 annexations. The population swelled as well through annexation and in-migration, with census data showing a population of 46,879 in 1940; 65,679 in 1950; 93,931 in 1960; and 122,830 in 1970. New development taxed existing infrastructure, which struggled to keep pace. Public policy changes allowed the extension of infrastructure to developing areas adjacent to, but not within the city limits. Between 1945-1955 an estimated 200 new residential subdivisions were established in Raleigh.¹⁷ The opening of Research Triangle Park in 1959 spurred further growth in Raleigh and the greater region.

In the late 1930s the Federal Housing Administration issued a series of publications providing guidance for residential development standards linked to both development financing and low-cost mortgages for homebuyers. Minimum requirements for subdivisions included building in a location where there was a demand for housing on a site with suitable physical characteristics accessible by transportation. Additionally, a site would need adequate utilities and must meet local planning and zoning regulations, incorporate deed restrictions for construction quality, and submit to an assessment of the financial capacity of the developers.¹⁸ Precatory standards included a master plan that conformed to natural features, flexible street widths and grades to match traffic requirements, long blocks, and generous and “well-shaped” house sites.¹⁹ Perhaps the most enduring aspect of the mid-century FHA residential development standards was the institutionalization through regulatory standards of the planned subdivision with curvilinear roads. This standard, adopted by the Urban Land Institute, became so universal in mid-20th century neighborhood design that its radical departure from other early American development patterns is often overlooked.²⁰ The FHA also favored turnkey developments where a builder bought the land, laid out the subdivision, and built the homes. This led to consistency in design and construction and economies of scale, which reinforced the financial capacity of the builder and contributed to economic success. All of these standards can be seen in Biltmore Hills.

Federal policies enacted in the GI Bill of 1944, the Veterans Emergency Housing Act of 1946, and the Housing Acts of 1948 and 1949, among others, helped create Veterans Administration loan guarantees on mortgages for returning service members, extended the Federal Housing Administration’s mortgage insurance capacity and liberalized mortgage terms, and provided assistance in blight removal and community development. The scope of the availability of federal aid for urban renewal and redevelopment, coupled with accompanying design and

¹⁷ Raymond Lowery, “Flight to Suburbia,” *The News & Observer*, September 25, 1955.

¹⁸ David L. Ames and Linda Flint McClelland, *Historic Residential Suburbs*, National Register Bulletin, NPS, 2002, 48.

¹⁹ Ames and McClelland, 48.

²⁰ One of the chief proponents of these principals was land planner Stewart Mott, who worked at the FHA and later the Urban Land Institute. Mott was familiar to the Raleigh development community, having drawn the master plan for the Cameron Village neighborhood and shopping center as well as at least one other property for Raleigh developer Willie York.

Biltmore Hills

Name of Property

Wake, NC

County and State

development standards, radically changed the landscape of many American cities at midcentury, including Raleigh.

In the late 1950s, bolstered by federal financial assistance, Raleigh looked south of downtown to demolish blight and to build segregated public housing that was known as Walnut Terrace. The project began in 1957 and displaced residents of 153 homes, 40% of which were owner-occupied and which were largely, if not completely, African American. Replacement public housing combined with two existing public housing projects, Halifax Court (for Whites) and Chavis Heights (for Blacks), did not begin to satisfy the demand for affordable and workforce housing. After the Walnut Terrace project, the city targeted a racially mixed area just north of downtown known as Smoky Hollow. When the Raleigh Redevelopment Commission was questioned about the demolition of housing units, concerns were countered with an explanation that there were now federal loan programs for people displaced by urban renewal projects. Biltmore Hills was specifically noted as a community where purchasers would be eligible.²¹

In addition to federal housing and urban renewal policies, transportation projects also had an impact on the city of Raleigh and its growth and development in the midcentury period. Land surveys for a ring road around the city known as the Beltline began as early as 1952. The Beltline was one of a number of federally funded transportation projects that were controversial. While some large road projects, like the one proposed to cut through the historic and largely White Oakwood neighborhood, were defeated, others, most of which impacted African American neighborhoods, were completed. The extension of Western Boulevard as Martin Luther King, Jr. Blvd. near the city's African American South Park neighborhood bisected a black community and created a barrier between the South Park neighborhood and downtown Raleigh. The expansion of Wilmington Street south of downtown also created barriers between African American neighborhoods and the resources that served them, namely a segregated school and cemetery. The final section of the Beltline was implemented with some minor mitigation efforts for environmental and noise concerns. However, comments at a public hearing observed that while northern sections of the Beltline were built in rural areas, the southern section cut between two African American communities, Biltmore Hills and Rochester Heights.²² These comments echoed the sentiments of the editorial board of *The Carolinian*, which anticipated construction in "Biltmore Hills, Garner, Caraleigh, or South and East Raleigh (largely Black communities), the stepchildren of Raleigh . . ."²³

Federally funded transportation and urban renewal programs in the 1950s and '60s had a significant impact on the growth, design, and development of cities. Blighted and sometimes historic areas were cleared for large-scale development near downtown, displacing large numbers of residents who were generally rehoused in public housing projects or new subdivisions. Raleigh's urban renewal programs amplified the already pressing needs for affordable and workforce housing, creating a market for new housing and spurring development of communities like Biltmore Hills. Federally funded transportation projects grew concurrently

²¹ "100 Housing Loans OK'd for Raleigh," *The News & Observer*, June 2, 1961.

²² Rob Christiansen, "Black Leaders Fear Effects of Beltline," *The News & Observer*, October 31, 1974.

²³ "The Last Fourth" (editorial), *The Carolinian*, June 11, 1966.

Biltmore Hills

Name of Property

Wake, NC

County and State

at a rapid pace. The disparate impact of highway construction on poor and minority communities has been well documented, and the construction of the Beltline between Biltmore Hills and Rochester Heights, two traditionally African American communities, reflects the common practice of transportation planning from that era. Design standards and requirements tied to federal financial incentives were clearly adopted in Biltmore Hills and are yet another example of federal influence on community planning and development at the local level.

Ethnic Heritage: Black

In the late nineteenth and early twentieth century, racial settlement patterns in greater Raleigh located African Americans either in historic Freedman's Villages such as Method and Oberlin, which were ultimately annexed into the city, or concentrated largely in the southeast portion of the city, where lots were easily subdivided into smaller parcels and where institutions such as Shaw and Saint Augustine's Universities attracted Black residents. Development in the city's southeastern section was an extension of racial housing patterns, which were the result of the sale and subdivision of large antebellum plantations that had bordered the city limits.²⁴ Further concentrating African American communities at the south and east of downtown was the rise in use of racial covenants. Beginning in 1906, this tool was used in Raleigh to restrict the purchase of residential real estate, excluding people of color from broad swaths of residential development.²⁵ Though government enforcement of racial covenants was found unconstitutional in the Supreme Court's 1948 decision in *Shelley v. Kraemer*, covenants could still be recorded. And there was no vehicle for federal enforcement against discriminatory housing practices until the passage of the Civil Rights Act of 1968. Regardless of legal progress, old patterns established racial divisions that were difficult to bridge and that maintained neighborhoods that were often entirely segregated for generations.

In the post World War II period, several communities were developed specifically for African Americans in Raleigh. They include Battery Heights, started in 1959; Rochester Heights, platted between 1957 and 1959 and developed by the Phillips Building Corporation and Key Homes; and Madonna Acres, developed by John Winters on land near Saint Augustine's University and built out between 1960 and 1965, with custom homes of modern design.²⁶

Another was Biltmore Hills, built between 1959 and 1966. It was the product of the partnership between a White developer, Ed Richards, and a Black realtor, John Winters. Biltmore Hills was developed as a subdivision exclusively for African Americans in south Raleigh during the waning Jim Crow era and provided much-needed affordable workforce housing for a market that had been excluded from opportunities in numerous Raleigh neighborhoods.

²⁴ Karl Larson, "A Separate Reality: The Development Of Racial Segregation In Raleigh, North Carolina, 1865-1915" (Master's thesis, University of North Carolina-Greensboro, 1983), 36.

²⁵ "Racially Restricted Covenants Project," <https://www.wake.gov/departments-government/register-deeds/racially-restrictive-covenants-project>.

²⁶ Carmen Cauthen, *Historic Black Neighborhoods of Raleigh* (The History Press, 2023), 210.

Biltmore Hills

Name of Property

Wake, NC

County and State

As in neighboring Rochester Heights, subdivision streets are named for prominent African Americans, all but one of whom have been identified.

Ralph Johnson Bunche (1904-1971) author, political scientist, diplomat, civil rights activist, awarded the Nobel Peace Prize

Roy Campanella (1921-1993) professional baseball player in the Negro and minor leagues prior to his 1948 season with the Brooklyn Dodgers, Baseball Hall of Fame inductee, considered among the greatest catchers in the game

Dorothy Dandridge (1922-1965) singer and actress in such films as *Carmen Jones* and *Island in the Sun*, first African American to be nominated for an Oscar in a leading role

Ella Fitzgerald (1917-1996) jazz vocalist, "First Lady of Song," civil rights activist, winner of 13 Grammy awards, the Kennedy Center for the Performing Arts Honor Award, and Presidential Medal of Freedom

Jim "Junior" Gilliam (1928-1978) second baseman and third baseman in the Negro leagues and with the Brooklyn and Los Angeles Dodgers, 1953 National League Rookie of the Year, one of the first African American coaches in Major League baseball

Hadley unknown

Eartha Kitt (1927-2008) singer and actress in film, television, and Broadway; recording artist with seventeen albums recorded from 1953-1994

Don "Newk" Newcombe (1926-2019) pitcher in the Negro Leagues and with the Brooklyn Dodgers, Cincinnati Reds, and the Cleveland Indians, winner of the 1956 National League MVP and Cy Young awards

James Cleveland "Jesse" Owens (1913-1980) track and field athlete regarded among the best; first athlete to win four gold medals at a single Olympic games, which he did in Berlin in 1936 in the presence of Nazi leader Adolf Hitler

Ethel Waters (1896-1977) singer and actress who began in vaudeville and progressed to recording, film, theater and television; first African American to star in her own television show and the second African American to be nominated for an Oscar

The street naming convention was chosen by Ed Richards. There was some concern that the naming convention might be considered pandering or somehow reinforce segregation. Richards' partner, John Winters, advocated for a street named after Charles Drew, the pioneering physician and scientist, but was unsuccessful.²⁷

Biltmore Hills is the product of a biracial development team who leveraged federal community development programs to create a neighborhood specifically for African American homebuyers at the end of the Jim Crow era. Advertising and promotions consistently describe the neighborhood as "for negroes" or "a colored subdivision." While created in part as a result of exclusion from other areas, it was designed to emphasize its positive association with African American character. The neighborhood references prominent Black Americans for street names not only as a marketing tactic, but as a vehicle for encouraging Black pride. The neighborhood still includes many families of original owners and has a strong sense of community identity.

²⁷ Lisa Bellamy, "A Stroll along these Streets is Trip through Time," *The News and Observer*, March 1, 1990.

Biltmore Hills
Name of Property

Wake, NC
County and State

9. Major Bibliographical References

Bibliography

- Ames, David L. and Linda Flint McClelland. *Historic Residential Suburbs*. National Register Bulletin, NPS, 2002.
- Ames, David L., Linda Flint McClelland and Sarah Dilard Pope. *Historic Residential Suburbs in the United States, 1830-1960*. National Register Multiple Property Documentation Form, 2004.
- Bellamy, Lisa. "A Stroll along these Streets is Trip through Time." *The News and Observer*, March 1, 1990.
- "Biltmore Hills Area is Annexed." *The News and Observer*, March 1, 1990.
- "Biltmore Hills Development Boasts New, Modern Homes." *The Carolinian*, November 7, 1959.
- Cauthen, Carmen. *Historic Black Neighborhoods of Raleigh*. The History Press, 2023.
- Christiansen, Rob. "Black Leaders Fear Effects of Beltline." *The News & Observer*, October 31, 1974.
- "Coming Very Soon (advertisement)." *The News and Observer*, September 13, 1959.
- Crosswell, Jack. "City Population Estimate: 90,400." *The News and Observer*, August 22, 1959.
- Declaration, *Wake County Deed Book 1416*.
- Edmisten, Linda Harris and Linda Simmons-Henry. *Culture Town*. Raleigh Historic Districts Commission, 1993.
- George, Cindy. "Winters Built Legacy in Raleigh." *The News and Observer*, February 17, 2004.
- Hanbury, Mary Ruffin. *Raleigh's Black Heritage and Historic Places: 1945-1975*, 2023.
- Hanchett, Thomas W. "The Other 'Subsidized Housing:' Federal Aid to Suburbanization, 1940s-1960s." *Journal of Housing and Community Development* (January/February 2001).
- Hanchett, Thomas W. "Federal Incentives and the Growth of Local Planning, 1941-1948." *Journal of the American Planning Association* (Spring 1994).

Biltmore Hills

Name of Property

Wake, NC

County and State

- “Housing Project for Negroes Going Up On Old Garner Road.” *The News and Observer*, November 8, 1959.
- Jackson, Kenneth T. *Crabgrass Frontier: The Suburbanization of the United States*. Oxford University Press, 1987.
- Jefferys, Grady. “E.N. Richards: Passion for Work Leaves Mark on State.” *The News and Observer*, November 17, 1963.
- “John Wesley Winters, Sr. (obituary).” *The News and Observer*, February 19, 2004.
- Karas, David. “Highway to Inequity: The Disparate Impact of the Interstate Highway System on Poor and Minority Communities in American Cities.” *New Visions for Public Affairs* 7 (April 2015).
- Larsen, Eric L. “Integrating Segregated Urban Landscapes of the Late-Nineteenth and Early-Twentieth Centuries.” *Historical Archaeology* 37, no. 3 (September 2003).
- Larson, Karl. “A Separate Reality: The Development Of Racial Segregation In Raleigh, North Carolina, 1865-1915.” Master’s thesis, University of North Carolina-Greensboro, 1983.
- Little, M. Ruth. *Post-World War II and Modern Architecture in Raleigh, North Carolina, 1945-1965*. National Register Multiple Property Document.
- Little, M. Ruth. “Getting the American Dream for Themselves: Postwar Modern Subdivisions for African Americans in Raleigh, North Carolina.” *Buildings & Landscapes: Journal of the Vernacular Architecture Forum* 19, no. 1 (Spring 2012).
- Little, M. Ruth. “The Development of Modernism in Raleigh 1945-1965.” North Carolina State Historic Preservation Office, unpublished report, 2006.
- Long, Irving. “Winters Depicts Tense Situation.” *The News and Observer*, May 31, 1967.
- Lowery, Raymond. “Flight to Suburbia.” *The News & Observer*, September 25, 1955.
- Mason, Norman P. “A Salute to America’s Home Builders.” *The News and Observer*, September 13, 1959.
- Mattson, Richard. “The Evolution of Raleigh’s African American Neighborhoods in the 19th and 20th Centuries,” 1988.
- “Mortgage Insurance for Low-Cost Private Housing Okayed.” *The News and Observer*, January 31, 1959.

Biltmore Hills

Name of Property

Wake, NC

County and State

National Historic Landmarks Program. "Civil Rights In America: Racial Discrimination In Housing." A National Historic Landmarks Theme Study, March 2021.

"Notice to Bid." *The News and Observer*, July 9, 1959.

"100 Housing Loans OK'd for Raleigh." *The News & Observer*, June 2, 1961.

Satter, Beryl. *Family Properties: Race, Real Estate, and the Exploitation of Black Urban America*. Metropolitan Books, 2009.

Shimron, Yonat. "Hulk on the Hill." *The News and Observer*, May 8, 1995.

"The Last Fourth (editorial)." *The Carolinian*, June 11, 1966.

United States Census Records.

Wake County deed books.

Wake County Government. "Racially Restricted Covenants Project."

<https://www.wake.gov/departments-government/register-deeds/racially-restrictive-covenants-project>

Williams, Alicia B. "Biltmore Hills casts off Albatross." *The News and Observer*, January 15, 1999.

Winters, John. Interview with Linda Simmons-Henry, June 1, 1989.

<https://raleighhrmprogram.catalogaccess.com/objects/9314>

Previous documentation on file (NPS):

- ☐ preliminary determination of individual listing (36 CFR 67) has been requested
- ☐ previously listed in the National Register
- ☐ previously determined eligible by the National Register
- ☐ designated a National Historic Landmark
- ☐ recorded by Historic American Buildings Survey # _____
- ☐ recorded by Historic American Engineering Record # _____
- ☐ recorded by Historic American Landscape Survey # _____

Primary location of additional data:

- ☐ State Historic Preservation Office
- ☐ Other State agency

Biltmore Hills

Name of Property

Wake, NC

County and State

☐ Federal agency

☐ Local government

☐ University

☐ Other

Name of repository: _____

Historic Resources Survey Number (if assigned): _____

10. Geographical Data

Acres of Property 105

Use either the UTM system or latitude/longitude coordinates

Latitude/Longitude Coordinates

Datum if other than WGS84: _____

(enter coordinates to 6 decimal places)

1. Latitude: 35.753241° Longitude: -78.628857°

2. Latitude: 35.754129° Longitude: -78.616452°

3. Latitude: 35.747459° Longitude: -78.618662°

4. Latitude: 35.747960° Longitude: -78.629939°

Verbal Boundary Description

The boundary conforms to the original plats for the neighborhood and is indicated on the map entitled National Register Boundary Map Biltmore Hills.

Boundary Justification

The includes all of the parcels historically associated with the Biltmore Hills community as indicated on the original plats recorded with the Wake County Register of Deeds

11. Form Prepared By

name/title: Mary Ruffin Hanbury

organization: Hanbury Preservation Consulting

street & number: PO Box 6049

city or town: Raleigh state: NC zip code: 27628

e-mail: maryruffin@hanburypreservation.com

telephone: 919 828 1905

date: July 18, 2025

Biltmore Hills
Name of Property

Wake, NC
County and State

Photo Log

Biltmore Hills
Raleigh
Wake County, North Carolina
Mary Ruffin Hanbury

June 2025
800 Block of Hadley Road, View to
Southwest
1 of 22

852 Campanella Lane, Type 1 House,
View to South
8 of 22

June 2025
700 Block of Newcombe Road, View to
West
2 of 22

June 2022
914 Newcombe Road, Type 2 House,
View to South
9 of 22

June 2025
800 Block of Newcombe Road, View to
Northeast
3 of 22

November 2022
2120 Gilliam Lane, Type 3 House, View
to West
10 of 22

June 2025
900 Block of Hadley Road, View to
Southwest
4 of 22

September 2022
827 Hadley Road, Type 4 House, View
to North
11 of 22

June 2025
700 Block of Bunche Drive, View to
Northeast
5 of 22

August 2022
813 Bunche Drive, Type 5 House, View
to Northwest
12 of 22

June 2025
800 Block of Bunche Drive, View to
Northeast
6 of 22

September 2022
807 Hadley Road, Type 6 House, View
to Northeast
13 of 22

June 2025
800 Block of Campanella Lane, View to
Northeast
7 of 22

August 2022
736 Bunche Drive Drive, Type 7 House,
View to South
14 of 22

May 2022

Biltmore Hills

Name of Property

October 2022

2114 Dandridge Drive, Type 8 House,
View to Northwest
15 of 22

September 2022

863 Hadley Road, Type 9 House, View
to North
16 of 22

September 2022

1112 Kitt Place, Type 10 House, View
to South
17 of 22

November 2022

808 Fitzgerald Drive, Type 11 House,
View to Southwest
18 of 22

Wake, NC

County and State

November 2022

2013 Waters Drive, Type 12 House,
View to Southeast
19 of 22

November 2022

2100 Gilliam Lane, Type 13 House,
View to Southwest
20 of 22

September 2022

2025 Waters Drive, Type 14 House,
View to Southeast
21 of 22

November 2022

2001 Waters Drive, Type 15 House,
View to East
22 of 22

Biltmore Hills
Name of Property

Wake, NC
County and State

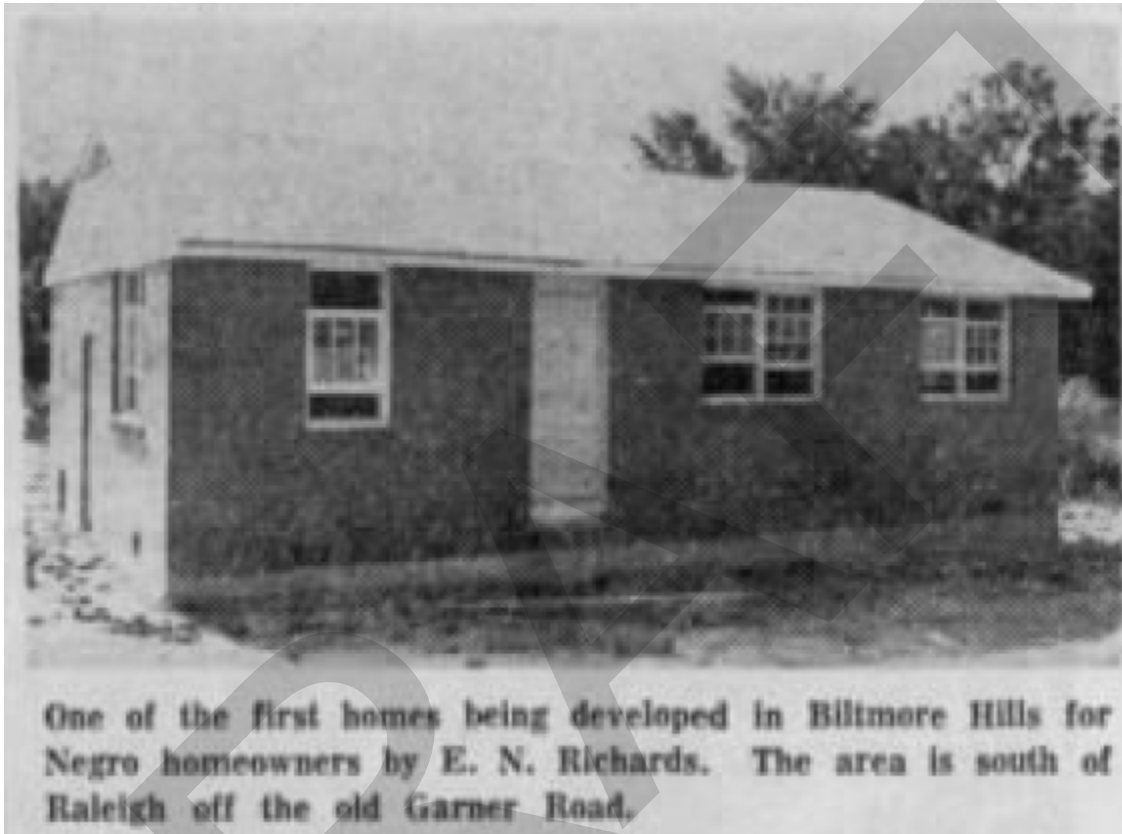


Fig 1. Image from *The News and Observer* September 13, 1959

Biltmore Hills
Name of Property


Wake, NC
County and State



Fig 2. Image from *The News and Observer* November 10, 1959

Biltmore Hills
Name of Property

Wake, NC
County and State

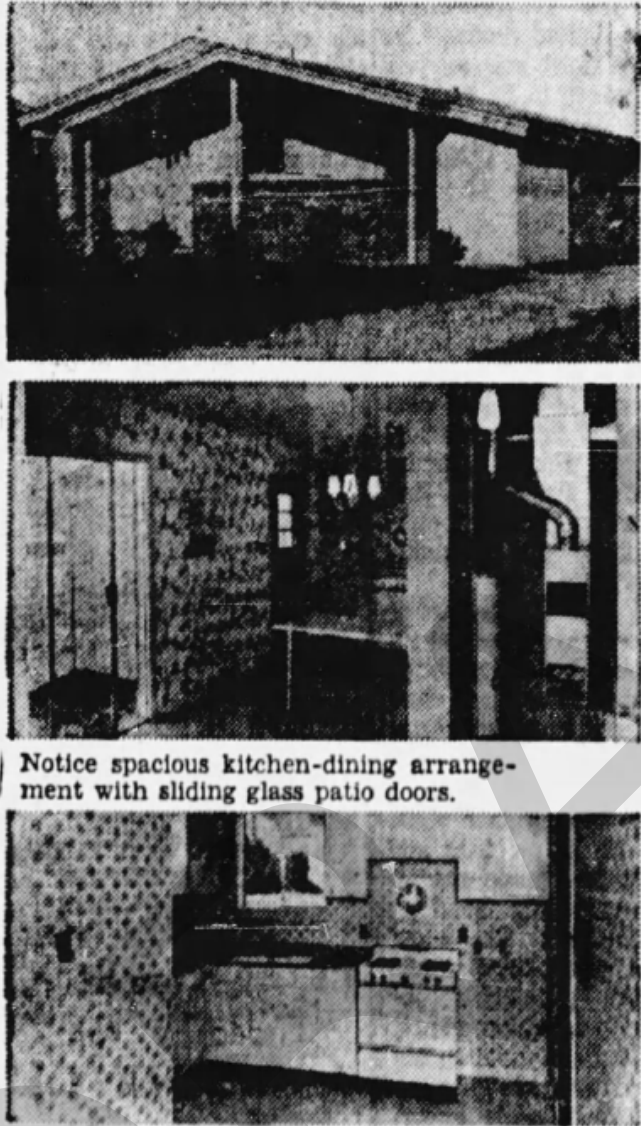

BILTMORE HILLS NEW HOMES- NEW FEATURES

These new 3-bedroom custom homes have forced warm air heat to *every* room . . . modern cathedral ceilings . . . beautiful new lighting features . . . modern kitchens with plenty of cabinets . . . sliding glass patio doors . . . plus many other features that you've always wanted. Select your "dream" home now in the NEW BILTMORE HILLS. Call John Winters at VA 8-5786 and arrange a personal inspection.

Notice spacious kitchen-dining arrangement with sliding glass patio doors.

Automatic washer connections are included in all kitchens.

Fig 3. Advertisement from *The News and Observer* December 9, 1961

Paperwork Reduction Act Statement: This information is being collected for nominations to the National Register of Historic Places to nominate properties for listing or determine eligibility for listing, to list properties, and to amend existing listings. Response to this request is required to obtain a benefit in accordance with the National Historic Preservation Act, as amended (16 U.S.C.460 et seq.). We may not conduct or sponsor and you are not required to respond to a collection of information unless it displays a currently valid OMB control number.

Estimated Burden Statement: Public reporting burden for each response using this form is estimated to be between the Tier 1 and Tier 4 levels with the estimate of the time for each tier as follows:

- Tier 1 – 60-100 hours
- Tier 2 – 120 hours
- Tier 3 – 230 hours
- Tier 4 – 280 hours

Biltmore Hills
Name of Property

Wake, NC
County and State

The above estimates include time for reviewing instructions, gathering and maintaining data, and preparing and transmitting nominations. Send comments regarding these estimates or any other aspect of the requirement(s) to the Service Information Collection Clearance Officer, National Park Service, 1201 Oakridge Drive Fort Collins, CO 80525.

DRAFT